



DEENDAYAL PORT AUTHORITY

(Erstwhile: DEENDAYAL PORT TRUST)

Administrative Office Building
Post Box NO. 50
GANDHIDHAM (Kutch).
Gujarat: 370 201.
Fax: (02836) 220050
Ph.: (02836) 220038

www.deendayalport.gov.in

EG/WK/4660 (EC)/ Part-V/ 59

Date: 06/08/2025
07

To,
The Deputy Director General of Forests,
Ministry of Environment, Forest & Climate Change,
Integrated Regional Office,
Gandhinagar, A wing-407 & 409
Aranya Bhavan Near CH-3 Circle
Sector 10A, Gandhinagar - 382010

Sub: "Construction of 13th to 16th Cargo Berths at Kandla" by M/s Deendayal Port Authority (Erstwhile Deendayal Port Trust) – **Compliance Report of conditions stipulated in Environmental & CRZ Clearance and Monitoring Report in Data Sheet reg.**

- Ref.:** 1) EC & CRZ Clearance dated 1/10/2008.
2) KPT letter no. EG/WK/4660 (EC)/654 dated 6/10/2010.
3) KPT letter no. EG/WK/4660 (EC)/ 112 dated 4/2/2012.
4) KPT letter no. EG/WK/4660(EC)/223 dated 4/9/2012.
5) KPT letter no. EG/WK/4660(EC)/144 dated 16 (17) /5/2013.
6) KPT letter no. EG/WK/4660 (EC)/Part 111/1087 dated 9/12/2013.
7) KPT letter no. EG/WK/4660 (EC)/Part 111/250 dated 17/05/2014.
8) KPT letter no. EG/WK/4660 (EC)/Part 111/198 dated 14/11/2014.
9) KPT letter no. EG/WK/4660 (EC)/Part 111/256 dated 11/05/2015.
10) KPT letter no. EG/WK/4660 (EC)/Part 111/162 dated 15/10/2015.
11) KPT letter no. EG/WK/4660 (EC)/Part 111/133 dated 09/05/2016.
12) KPT letter no. EG/WK/4660 (EC)/Part IV/167 dated 26/12/2016.
13) DPT letter no. EG/WK/4660 (EC)/Part IV/325 dated 26/06/2018.
14) DPT letter no. EG/WK/4660 (EC)/Part V/53 dated 14(16)/2/2019.
15) DPT letter no. EG/WK/4660 (EC)/Part V/205 dated 30(6)/11 (12)/2019.
16) DPT letter no. EG/WK/4660 (EC)/Part V dated 15/01/2021.
17) DPT letter no. EG/WK/4660 (EC)/Part V/92 dated 30(07)/9(10)/2021.
18) DPT letter no. EG/WK/4660 (EC)/Part V dated 28/03/2022
19) DPA letter no. EG/WK/4660 (EC)/Part V/149 dated 19/07/2022
20) DPA letter no. EG/WK/4660 (EC)/Part V/230 dated 02/02/2023
21) DPA letter no. EG/WK/4660 (EC)/Part V/350 dated 14/08/2023
22) DPA letter no. EG/WK/4660 (EC)/Part V/37 dated 19/03/2024
23) DPA letter no. EG/WK/4660 (EC)/Part V/93 dated 24/07/2024
24) DPA letter no. EG/WK/4660 (EC)/Part V/05 dated 17/01/2025

Sir,

It is requested to kindly refer above cited references for the said subject.

In this connection, it is to state that, as directed under above referred letter dated 5/8/2009 of MoEF, Regional Office, Gandhinagar, Deendayal Port Authority (Erstwhile

.....cont.....

Deendayal Port Trust) vide above referred letters had regularly submitted Six Monthly compliance report of stipulated conditions and Monitoring report in Data Sheet, in connection with subject project.

Now, as directed in above referred letter dated 5/8/2009 of MoEF, GoI, we are submitting herewith compliance report in the PARIVESH 2 PORTAL for the period October, 2024 to March, 2025. Further, we are also submitting herewith Monitoring Report in Data Sheet.

This is for your kind information and record please.

This has the approval of the Chief Engineer, Deendayal Port Authority.

Thanking You.

Yours faithfully,



XEN (EMC)
Deendayal Port Authority

Annexure -1

Half Yearly Compliance Report**2025****01 Jun(01 Oct - 31 Mar)****Acknowledgement**

Proposal Name	Construction of 13th to 16th Cargo Berth at Kandla by M/s Kandla Port Trust (KPT) (Now: Deendayal Port Trust)		
Name of Entity / Corporate Office	Deendayal Port Authority		
Village(s)	N/A		
District	KACHCHH		
Proposal No.	IA/GJ/MIS/75528/2018	Category	INFRA-2
Plot / Survey / Khasra No.	N/A	Sub-District	N/A
State	GUJARAT	Entity's PAN	*****EQUIRED
MoEF File No.	No.11-70/2006-IA-III	Entity name as per PAN	Deendayal Port Authority

Compliance Reporting Details**Reporting Year** 2025**Remarks (if any)****Reporting Period** 01 Jun(01 Oct - 31 Mar)**Details of Production and Project Area****Name of Entity / Corporate Office** Deendayal Port Authority

	Project Area as per EC Granted	Actual Project Area in Possession
Private	0	0
Revenue Land	0	0
Forest	0	0
Others	6.6	6.6
Total	6.6	6.6

Production Capacity

Sr. no	Product Name	units	Valid Upto	Capacity	Production last year	Capacity as per CTO
--------	--------------	-------	------------	----------	----------------------	---------------------

Conditions**Specific Conditions**

Sr.No.	Condition Type	Condition Details
1	Statutory compliance	All measures indicated in the letter dated 4/8/2008 shall be strictly complied with.

PPs Submission: Being Complied Compliance Report of conditions stipulated in the CRZ recommendation granted by Forest and Environment Department, GoG vide letter dated 14/02/2008 is placed in Annexure A.		Date: 06/08/2025
2	Statutory compliance	Necessary clearances from the Gujarat State Pollution Control Board shall be obtained before initiating the project.
PPs Submission: Complied GPCB vide order no. PCC/CCA-BHUI-179(3)/575 dated 9/1/2009 granted a No Objection Certificate to the said project. Currently, all the 4 berths are under operation. Further, GPCB vide order dated 22/1/2021 has issued Consolidated Consent and Authorization (Valid up to 21/7/2025). Subsequently, GPCB issued a Correction in the CCA order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/ 588116 dated 9/4/2021.		Date: 05/08/2025
3	Marine/Coastal	The project proponent shall not undertake any destruction of mangroves during construction and operation of project.
PPs Submission: Complied Point noted. All the 4 berths are under operation. As per the directions of the GCZMA and MoEFCC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for 'Mangrove Plantation in an area of 50 Ha for Deendayal Port Authority' for the period of 10/06/2024 to 09/03/2025. The Final report submitted by GUIDE, Bhuj is attached herewith as Annexure B. It is also relevant to mention here that, as per the direction of the Gujarat Coastal Zone Management Authority, DPA has already prepared and submitted a report on the mangrove conservation and management plan formulated by the Gujarat Institute of Desert Ecology during the study period of Jan-April, 2015 (Report already submitted along with earlier compliance reports submitted). For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work to M/s GUIDE, Bhuj for Monitoring of mangrove plantation carried out by DPA (Period from 24/5/2021 to 23/5/2022). The final report submitted by M/s GUIDE has already been communicated with the earlier compliance report submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for Monitoring of Mangrove Plantation 1600 Ha carried out by DPA for the Period of 10/06/2024 to 09/06/2025. The inception report has already been communicated with earlier compliance report submitted.		Date: 06/08/2025
4	WASTE MANAGEMENT	Sewage arising in the Port area shall be treated to conform to the standards stipulated by Gujarat State Pollution Control Board and shall be utilized/ recycled or gardening, plantation and irrigation.
PPs Submission: Complied The sewage generated in the port area is treated in the 1.5 MLD STP at Kandla. The treated wastewater is utilized for gardening and plantation purposes. In addition to that, it also has septic tanks at places where STP is inaccessible. DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEFCC, GoI. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.		Date: 06/08/2025
5	Risk Mitigation and Disaster Management	Project proponent shall prepare Disaster Management Plan covering emergency evacuation mechanisms etc. deal with natural disaster events and regularly update from time to time.
PPs Submission: Complied DPA is already having a Disaster Management Plan. A copy of the same has been communicated with earlier submitted compliance reports.		Date: 14/07/2025
6	Marine/Coastal	The facilities to be constructed in the COASTAL REGULATION ZONE area as part of this project shall be strictly in conformity with the provisions of the COASTAL REGULATION ZONE Notification,

		1991 as amended subsequently.
PPs Submission: Complied All the 4 berths are currently under operation.		Date: 14/07/2025
7	Marine/Coastal	No product other than those permissible in the COASTAL REGULATION ZONE Notification, 1991 shall be stored in the COASTAL REGULATION ZONE area.
PPs Submission: Complied Point Noted. Cargo is being stored at the backup area of berths, viz. 13th to 16th CB, as per the EC and CRZ Clearance accorded by the MoEFCC, GoI.		Date: 14/07/2025
8	Marine/Coastal	There shall be no withdrawal of groundwater in the COASTAL REGULATION ZONE area for this project. The proponent shall ensure that as a result of the proposed constructions, ingress of saline water into ground water does not take place. Piezometers shall be installed for regular monitoring for this purpose at appropriate locations on the project site.
PPs Submission: Complied All the 4 berths are currently under operation.		Date: 14/07/2025
9	GREENBELT	Green belt area shall be developed along the project and budget earmarked.
PPs Submission: Complied DPA had entrusted the work to the Forest Department, Gujarat, for developing a green belt in and around the Port area at a cost of Rs. 352 lakhs in an area of about 32 hectares, and the work is already completed. Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for 'Green belt development in Deendayal Port Authority and its Surrounding Areas, Charcoal site' (Phase-I) vide Work Order No.EG/WK/4757/Part (Greenbelt GUIDE), dated 31st May 2022. The final report has already been communicated with the earlier compliance report. DPA has assigned the Greenbelt development in Deendayal Port Authority and its surrounding areas, Phase II, to M/s GUIDE vide Work order EG/WK/4751/Part (Greenbelt)/327 dated 23.06.2023. The Final Report have already been communicated along with the last compliance report.		Date: 14/07/2025
General Conditions		
Sr.No.	Condition Type	Condition Details
1	Human Health Environment	Adequate provisions for infrastructure facilities such as water supply, fuel, sanitation etc. shall be ensured for construction workers during the construction phase of the project so as to avoid feeling of trees / mangroves and pollution of water and surroundings.
PPs Submission: Complied All the 4 berths are currently under operation.		Date: 14/07/2025
2	WASTE MANAGEMENT	The project authorities must make necessary arrangement for disposal of solid wastes and for the treatment of Effluents by providing a proper wastewater treatment plant outside the COASTAL REGULATION ZONE area. The quality of treated effluents, solid wastes and noise level etc. must conform to the standards laid down by the competent authorities including the Central/State Pollution Control Board and the Union Ministry of Environment and Forests under the Environment (Protection) Act, 1986, whichever are more stringent.

PPs Submission: Complied Companies authorized by the State Pollution Control Board (SPCB) have been awarded the work of collecting, transporting, and disposing of solid waste by the Deendayal Port Authority. Further, DPA has appointed GEMI, Gandhinagar, for the work of Preparation of Plan for Management of Plastic Wastes, Solid Waste, including C and D waste, E-waste, Hazardous waste, including Biomedical and Non-Hazardous Waste in the Deendayal Port Authority vide Work Order dated 24/01/2023. The work is completed and the Final report has already been communicated along with last compliance report. Generated sewage is treated in DPA's existing STP (1.5 MLD capacity). In addition to that, it also has septic tanks at places where STP is inaccessible. DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to the GPCB, IRO, MoEFCC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.			Date: 05/08/2025
3	MISCELLANEOUS	In order to carry out the environmental monitoring during the operational phase of the project, the project authorities shall provide an environmental laboratory well equipped with standard equipment and facilities and qualified manpower to carry out the testing of various environmental parameters.	
PPs Submission: Complied DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to the GPCB, IRO, MoEFCC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.			Date: 06/08/2025
4	LAND RECLAMATION	The sand dunes if any on the site shall not be disturbed in any way.	
PPs Submission: Complied No sand dunes at project site prevail.			Date: 14/07/2025
5	MISCELLANEOUS	A copy of the clearance letter will be marked to the concerned Panchayat/local NGO, if any from whom any suggestion/representation has been received while processing the proposal.	
PPs Submission: Complied No suggestion/ representation has been received while processing the proposal.			Date: 14/07/2025
6	WASTE MANAGEMENT	The proponents shall provide for a regular monitoring mechanism as to ensure that the treated effluents conform to the prescribed standards. The records of analysis reports must be properly maintained and made available for inspection to the concerned State/Central officials during their visits.	
PPs Submission: Complied DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to the GPCB, IRO, MoEFCC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C.			Date: 06/08/2025
7	Statutory compliance	Construction of the proposed structures shall be undertaken meticulously conforming to the existing Central/Local rules and regulations including COASTAL REGULATION ZONE Notification, 1991 and its amendments. All the construction design/drawings relating to the proposed construction activities must	

		have approvals of the concerned State Government Department/Agencies.
PPs Submission: Complied Currently, all the 4 berths are under operation.		Date: 14/07/2025
8	Statutory compliance	The Gujarat Pollution Control Board shall display a copy of the clearance letter at the Regional Office, District Industries Centre and Controller's Office/Tehsildar's Office for 30 days.
PPs Submission: Complied -		Date: 14/07/2025
9	Corporate Environmental Responsibility	The funds earmarked for environment protection measures shall be maintained, in a separate account and there shall be no diversion of these funds for any other purpose. A year-wise expenditure on environmental safeguards shall be reported to this Ministry's Regional Office at Bhopal and the State Pollution Control Board.
PPs Submission: Complied Point noted. The allocation made under the scheme of Environmental Services and Clearance thereof other related Expenditure during RBE 2024-25 is Rs. 585 Lakhs. The expenditure made under the Environmental Services and Clearance of other related Expenditure is Rs. 522 Lakhs from October 2024 to March 2025. The yearly expenditure on environmental safeguards is regularly submitted in the monitoring datasheet to the Ministry's Regional Office at Bhopal (Now Gandhinagar).		Date: 14/07/2025
10	MISCELLANEOUS	Full support shall be extended to the officers of this Ministry's Regional Office at Bhopal and the officers of the central and State Pollution Control Board by the project proponents during their inspection for monitoring purpose, by furnishing full details and action plans including the action taken reports in respect of mitigate measures and other environment protection activities.
PPs Submission: Complied DPA had given the required support to the officer of the Ministry's Regional Office, Bhopal, during a site inspection carried out on 29/12/2016 for the purpose of certifying EC Conditions. DPA has also given required support to the officials of the Gujarat Pollution Control Board during their visits to DPA for inspection, etc. Further, it is also assured that DPA shall extend full support in future to the officials of the Ministry's Regional Office at Bhopal (Now Gandhinagar) and the officers of the Central and State Pollution Control Board during their inspection.		Date: 14/07/2025
11	MISCELLANEOUS	This ministry reserves the right to revoke this clearance, if any of the conditions stipulated are not complied with to satisfaction of this ministry.
PPs Submission: Complied Point Noted.		Date: 14/07/2025
12	MISCELLANEOUS	This Ministry or any other competent authority may stipulate any other additional conditions subsequently, if deemed necessary, for environment protection, which shall be complied with.
PPs Submission: Complied Point Noted.		Date: 14/07/2025
13	MISCELLANEOUS	In case of deviation or alteration in the project including the implementing agency, a fresh reference shall be made to this Ministry for modification in the clearance conditions or imposition of new

		ones for ensuring environment protection.
PPs Submission: Agreed to Comply Point Noted.		Date: 14/07/2025
14	Statutory compliance	The project proponent shall advertise in at least two local newspapers widely circulated in the region around the project, one of which shall be in the vernacular language of the locality Concerned, informing that the project has been accrued environment clearance and copies of clearance letters are available with the State Pollution Control Board and may also be seen at website of the Ministry of Environment and Forests at http://www.envfornic.in. The advertisement shall be made within 7 days from the date of issue of the clearance letter and a copy of the same shall be forwarded to the Regional office of this Ministry at Bangalore.
PPs Submission: Complied Advertisements had already been made in Kutch Mitra on 21/10/2008 and Kutch Uday on 22/10/2008. Further, Newspaper cuttings had already been sent to the Regional Office, MoEFCC, Bhopal, vide DPA letter No.: EG/WK/4660(EC)/01 dated 31/10/2008.		Date: 14/07/2025
15	Statutory compliance	The above-mentioned stipulations will be enforced among others under the water (Prevention and Control of Pollution) Act, 1974, the Air (Prevention and Control of Pollution) Act, 1981, the Environment (Protection) Act 1986, the Hazardous Chemicals (Manufactures, storage and Import) Rules, 1989, the Coastal Regulation Zone Notification, 1991 and its subsequent amendments and the Public Liability Insurance Act, 1991 and the Rules made there under from time to time. The project proponents shall also ensure that the proposal complies with the provisions of the approved Coastal Zone Management Plan of Gujarat State.
PPs Submission: Complied DPA has obtained consolidated consent and authorization vide GPCB (Consent Order no-AWH-110594 dated of issue-8/12/2020, with a validity period up to 21/7/2025)- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 and subsequently, issued Correction in CCA order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/ 588116 dated 9/4/2021. A copy of the same has already been communicated with the earlier compliance reports submitted. Further an amendment has issued by GPCB vide letter no. PC/CCA-KUTCH-812(6)/GPCB ID-28494/781072 dated 11/01/2024. DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to the GPCB, IRO, MoEFCC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure C. Public Liability Insurance is renewed from time to time as required. The Public Liability Insurance has been renewed and is valid till 23/07/2025. A copy is attached herewith as Annexure D. Deendayal Port Authority had already obtained Coastal Regulation Zone Recommendations dated 14/02/2008 from the State Forest and Environment Department, Government of Gujarat, for the project. All the 4 berths are under operation.		Date: 06/08/2025
16	Statutory compliance	The project proponent shall inform the Regional office at Bhopal as well as the Ministry the date of financial closer and final approval of the Project by the concerned authorities and the date of Start of Land Development work.
PPs Submission: Complied The necessary details have already been provided by the DPA from time to time, along with the earlier compliance reports submitted. Now, all the 4 berths are under operation.		Date: 14/07/2025

Visit Remarks

Last Site Visit Report Date:

N/A

Additional Remarks:

Note: This acknowledgement is as per the details submitted by project proponent. In no way is this document to be considered as conclusion on any action on the compliance of the project. This is strictly for the project proponent's reference purpose.

Annexure -A

Annexure 1

Compliance Report for the Period October, 2024 to March, 2025.

Name of Work: Construction of 13th to 16th Cargo Berth at Kandla, District Kachchh.

CRZ Recommendations: Letter No. ENV-IO-2006-138-P dated 14/02/2008 of Director (Environment), Forest & Environment Department, GoG. Further, the Ministry of Environment & Forest-New Delhi, Govt. of India accorded the Environmental/ CRZ clearance vide letter no. 11-70/2006-IA.III dated Sep 2008 & the validity of the same had been extended by MoEF, GoI vide letter No.F.NO.11-70/2006-IA.III dated 7th February, 2014 for a further period of 5 years.

STATUS OF Berths:

13th Cargo Berth: Under operation since 18/2/2013.

15th Cargo Berth: Under Operation since 16/11/2013.

14th Cargo Berth: Under Operation since 8/4/2019.

16th Cargo Berth: Under Operation since 10/3/2019.

CONSENT TO OPERATE:

Consolidated Consent & Authorization (CC&A) issued by the GPCB (Consent Order no. AWH-110594 dated issue-8/12/2020, with a validity period up to 21/7/2025)- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021.

Sr. No.	Conditions in CRZ Recommendation Letter	Compliance
Specific Conditions		
1	The provisions of the CRZ notification of 1991 and subsequent amendments issued from time to time shall be strictly adhered to by the KPT. No activity in contradiction to the Provisions of the CRZ Notification shall be carried out by the KPT.	All the 4 berths are under operation. The provisions of the CRZ notification of 1991 and subsequent amendments issued from time to time are being strictly followed by Deendayal Port Authority (Erstwhile Deendayal Port Trust).
2	The KPT shall participate financially for installing and operating the Vessel Traffic Management System in the Gulf of Kachchh and shall also take lead in preparing and operationalizing and updating regularly after getting it vetted by the Indian Coast Guard.	DPA had already contributed an amount of Rs. 41.25 Crores for installing and operating the VTMS in the Gulf of Kachchh. VTMS has been handed over to the Directorate General of Lighthouse and Lightships, Ministry of Shipping, and GoI for operating and updating regularly to statutory authorities.
3	The KPT shall strictly ensure that no creeks or rivers are blocked due to any activity at Kandla.	All the four berths are under operation
4	Mangrove plantation in an area of 1000 ha. Shall be carried out by the KPT within 5 years in time bound manner on Gujarat coastline either within or outside the Kandla port Trust area at an appropriate place in consultation with the Forest and Environment Department. A six-monthly compliance report along with the satellite images shall be submitted to the Ministry of Environment and Forest as well as to this Department without fail.	As per the directions of the GCZMA and MoEF&CC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Mangrove Plantation in an area of 50 Ha for Deendayal Port Authority" for the period of 10/06/2024 to 09/03/2025. The Final report submitted by GUIDE, Bhuj is attached herewith as Annexure A. It is also relevant to submit here that, as per the direction of the Gujarat Coastal Zone Management Authority, DPA had already prepared & submitted a report on mangrove conservation and management plan formulated by Gujarat Institute of Desert Ecology during the study period of Jan-April, 2015 (Report already submitted along with earlier compliance reports submitted).

		For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work to M/s GUIDE, Bhuj, for Monitoring of mangrove plantation carried out by DPA (Period from 24/5/2021 to 23/5/2022). The final report submitted by GUIDE, Bhuj has already been communicated with the earlier compliance report submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. The inception report has already been communicated with earlier compliance report submitted.
5	No activities other than those permitted by the competent authority under the CRZ Notification shall be carried out in the CRZ area.	All the four berths are under operation
6	No groundwater shall be tapped for any purpose during the proposed expansion modernization activities.	All the four berths are under operation
7	All necessary permissions from different Government Departments / agencies shall be obtained by the KPT before commencing the expansion activities.	DPA obtained Consolidated Consent & Authorization (CC&A) from the GPCB vide Consent Order no AWH-110594 date of issue-8/12/2020, with a validity period up to 21/7/2025- Detailed Order issued by the GPCB vide outward no. 581914 dated 22/1/2021 & subsequently, issued Correction in CC&A order vide letter no. PC/CCA-KUTCH-812(5)/GPCB ID 28494/588116 dated 9/4/2021 (The copy of the Order has already been communicated with the earlier compliance report submitted).
8	No effluent or sewage shall be discharged into the sea/creek or in the CRZ area and It shall be treated to conform to the Norms prescribed by Gujarat Pollution Control Board and would be reused/recycled within the plant premises to the extent possible.	Generated sewage is treated in DPA's existing STP (1.5 MLD capacity). In addition to that, it also has septic tanks at places where STP is inaccessible. The treated sewage is being used for gardening and plantation purposes. DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and

		Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B.
9	All the recommendations and suggestion given by the NIOT in their Comprehensive Environment Impact Assessment report for conservation / protection and betterment of environment shall be implemented strictly by the KPT.	Currently, all the four berths are under operation. As per the directions of the GCZMA and MoEF&CC, GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1600 Hectares since the year 2005. The details have already been communicated with the earlier compliance reports submitted. Further DPA has assigned work to to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Mangrove Plantation in an area of 50 Ha for Deendayal Port Authority" for the period of 10/06/2024 to 09/03/2025. The Final report submitted by GUIDE, Bhuj is attached herewith as Annexure A. For regular monitoring, DPA vide work order dated 3/5/2021 has assigned work to M/s GUIDE, Bhuj for "Monitoring of mangrove plantation" carried out by DPA (Period from 24/5/2021 to 23/5/2022). The final report submitted by GUIDE, Bhuj, has already been communicated with the last compliance report submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. The inception report submitted by GUIDE has already been submitted with earlier compliance report. DPA assigned work to M/s GUIDE, Bhuj for "Regular monitoring of Marine Ecology in and around Deendayal Port Authority (Erstwhile Deendayal Port Trust) and continuous Monitoring Program covering all seasons on various aspects of the Coastal Environs" since 2017.

		In continuation of same, DPA had issued work order to GUIDE, Bhuj for "Regular Monitoring of Marine Ecology in and around Deendayal Port Authority" for the year 2024-2027. The work is in progress. The First season report submitted by GUIDE is attached herewith as Annexure C. To control fugitive emissions, DPA has installed Mist Canon in the Port area. Further, regular sprinkling through tankers on roads and other staking yards is being done to control dust pollution in other areas. it is relevant to mention that Pollution under Control (PUC) Certificates have been made mandatory for vehicles in the port area. For waste generated from ships, DPA issued a Grant of License/Permission to carry out the work of collection and disposal of "Hazardous Waste/Sludge/Waste Oil" and for removal of "Dry Solid Waste (Non- Hazardous)" from Vessels calling at Deendayal Port through DPA contractors. Further, all ships are required to follow DG Shipping circulars regarding the reception facilities at the Swachch Sagar portal. Further, DPA vide work order dated 24/01/2023 has appointed GEMI, Gandhinagar, for "Preparation of Plan for Management of Plastic Wastes, Solid Waste including C&D waste, Hazardous wastes including Biomedical and Non-Hazardous Waste in the Deendayal Port Authority area". The Final report submitted by GEMI has already communicated with earlier compliance report. DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental
--	--	---

		monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B.
10	The construction activities and dredging shall be carried out only under the constant supervision and guidelines of the NIOT.	All the four berths are currently under operation.
11	The KPT shall contribute financially for any common study or project that may be proposed by this Department for environmental management/conservation/improvement for the Gulf of Kachchh.	Point noted
12	The construction debris and/or any other of waste shall not be disposed of into the sea, creek or the CRZ areas. The debris shall be removed from the construction site immediately after the construction is over.	All the 4 berths are currently under operation.
	General Conditions	
13	The construction camps shall be located outside the CRZ area and the construction labour shall be provided with the necessary amenities, including sanitation, water supply and fuel and it shall be ensured that the environmental conditions are not deteriorated by the construction labours.	All the 4 berths are currently under operation.
14	The KPT shall bear the cost of the external agency that may be appointed by this Department for supervision / monitoring of proposed activities and the environmental impacts of the proposed activities.	Point noted
15	The KPT shall take up massive greenbelt development activities in and around Kandla and also within the KPT limits.	Deendayal Port Authority had taken up massive greenbelt development activities in and around Kandla, Residential colony, administrative building, etc. DPA had entrusted the work to the Forest Department, Gujarat, in August 2019 for developing a green belt in and around the Port area at a cost of Rs. 352 lakhs in an area of about 32 hectares, and the work is completed. Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for "Green belt development in Deendayal

		Port Authority and its Surrounding Areas, Charcoal site' (Phase-I) (5,000 plants)" vide Work Order No.EG/WK/4757/Part [Greenbelt GUIDE, dated 31st May 2022. The work is completed. Further, DPA assigned work to GUIDE, Bhuj, via a work order dated 23/06/2023 for "Green belt development in Deendayal Port Authority and its Surrounding Areas (Phase II) (10,000 plants). The Final report has already been submitted along with earlier compliance report.
16	The KPT shall have to contribute financially for talking up the socio-economic upliftment activities in this region in construction with the Forest and Environment Department and the District Collector / District Development Officer.	The details of CSR activities undertaken /to be undertaken by DPA are placed at Annexure D.
17	A separate budget shall be earmarked for environmental management and socioeconomic activities and details there of shall be furnished to this Department as well as the MoEF, GOI. The details with respect to the expenditure from this budget head shall also be furnished.	The allocation made under the scheme of "Environmental Services & Clearance thereof other related Expenditure" during RBE 2024-25 is Rs. 585 Lakhs. The expenditure made under the "Environmental Services & Clearance of other related Expenditure" is Rs. 522 Lakhs from October 2024 to March 2025.
18	A separate environmental management cell with qualified personnel shall be created for environmental monitoring and management during construction and operational phases of the project.	DPA already has an Environment Management Cell. Further, the DPA has also appointed an expert agency to provide Environmental Experts from time to time. DPA appointed M/s Precitech Laboratories, Vapi, to provide Environmental Experts via a work order dated 5/2/2021 for a period of 3 years. Further, DPA appointed M.s Precitech Laboratories, Vapi, to Provide Environmental Experts via work order dated 4/10/2024. The work order is attached herewith as Annexure E. In addition, it is relevant to submit here that DPA has appointed a Manager (Environment) on a contractual basis for a period of 3 years, further extendable to 2 years (A copy of the details has

		already been communicated with the last compliance report submitted).
19	An Environmental report indicating the changes, if any, with respect to the baseline environmental quality in the coastal and marine environment shall be submitted every year by the KPT to this Department as well as to the MoEF, GOI.	DPA has been appointing a NABL-accredited laboratory to monitor environmental parameters, and reports are being submitted from time to time to the GPCB, IRO, MoEF&CC, GoI, and Gandhinagar. Recently, DPA appointed GEMI, Gandhinagar, to regularly monitor environmental parameters vide Work Order dated 15/02/2023. The work is in progress, and the latest environmental monitoring report submitted by GEMI, Gandhinagar, is attached herewith as Annexure B .
20	The KPT shall have to contribute financially to support the National Green Corps Scheme being implemented in Gujarat by the GEER Foundation, Gandhinagar, in construction with Forests and Environment Department	Point noted
21	Six monthly reports on compliance of the conditions mentioned in this letter shall have to be furnished by the KPT on regular basis to this department/ MoEF, GOI.	DPA has regularly submitted the compliance reports to GCZMA, Gandhinagar, MoEF&CC, and GOI. The last compliance report of the conditions stipulated in CRZ recommendations issued by GCZMA was submitted on 17/01/2025.
22	Any other condition that may be stipulated by this department from time to time for environmental protection/management purpose shall also have to be complied with by the KPT.	Point noted

Annexure -B

FINAL REPORT
for the Project entitled
Mangrove Plantation in an area of 50 Hectares for Deendayal Port Authority, Kandla
(As per EC & CRZ Clearance Dt.01.01.2024. Annexure-B, Specific condition No.7)

DPA Work order No. EG/WK/4751/Part (Revamping-EC onwards)/69. Dt. 10.06.2024



Submitted by



Gujarat Institute of Desert Ecology
Mundra Road, Bhuj-370 001
Dist: Kachchh, Gujarat, India

Submitted to



Deendayal Port Authority
Gandhidham- 370201
Dist: Kachchh, Gujarat-, India

February
2025



Gujarat Institute of Desert Ecology

Certificate

This is state that the Final Report for project entitled "Mangrove Plantation in an area of 50 Hectares for Deendayal Port Authority, Kandla" has been prepared in line with the Work order issued by the Deendayal Port Authority Vide: Ref. No. EG/WK/4751/Part (Revamping-EC onwards)/69. Dt.10.06.2024. In order to comply with the stipulated condition of the EC & CRZ Clearance dated 1/1/2024 read with CRZ Recommendation dated 25/8/2022 - Condition no.7.

The work order is for a period of Nine months (10.06.2024 - 09.03.2025) for the above-mentioned study.

Authorized Signatory

DIRECTOR

Gujarat Institute of Desert Ecology
Bhuj - Kachchh.



Project Team

Project Coordinator: Dr. V. Vijay Kumar, Director

Project Personnel

Principal Investigator

Dr. B. Balaji Prasath, Senior Scientist

Co-Investigator

Dr. Kapilkumar Ingle, Project Scientist-II

Team Members

Dr. L. Prabhadevi, Advisor

Mr. Dayesh Parmar, Senior Scientific Officer

Mr. Ketan Kumar Yogi, Junior Research Fellow

Contents

1. Background of the study	1
1.1. Mangrove status in Gujarat and Gulf of Kachchh	2
1.2. Rationale of the project	3
2. Objectives	4
3. Study Area	4
4. Methodology	6
4.1. Field Studies	6
4.1.1. Site Overview:	6
4.1.2. Geographical Patterns:	6
4.1.3. Landscape Assessment:	6
4.2. Plantation Techniques	6
4.2.1. Raised bed method (Otila method)	6
4.2.2. Transplantation of nursery raised saplings (Poly bag method)	7
5. Site visit	8
5.1. On-site observations	8
5.2. Analysis of water and sediment samples	9
5.2.1. Water analysis	9
5.2.2. Sediment/ soil analysis	9
6. Summary of the Report	34
7. Future Considerations for Mangrove Plantation	38
7.1. Carry out regular monitoring of mangrove plantation	38
7.2. Regular gap filling to be done	38
8. References	38

Snapshot of the Project," Mangrove Plantation in an area of 50 Hectares for Deendayal Port Authority, Kandla"

S.No	Components of the Study	Remarks
1	Deendayal Port letter sanctioning the project	EG/WK/4751/Part (Revamping-EC onwards)/69, dated 10.06.2024
2	Duration of the project	Nine months (10.06.2024 - 09.03.2025)
3.	Location of Mangrove Plantation Site	The location finalized for mangrove plantation is shown in Figure 1. Suitable site was selected based on water and sediment quality, intertidal fauna, and propagules.
4.	Total Area	50 Hectares
5.	EC & CRZ Clearance Reference	As per EC & CRZ Clearance Dt. 01.01.2024, Annexure-B, Specific condition No. 7
6	Field Studies	
6a	Site Overview	Inspection to understand site conditions and potential risks (e.g., grazing).
6b	Geographical Patterns	Study existing mangrove species to determine their distribution and identify suitable planting locations.
6c	Landscape Assessment	The stability of the root system of existing mangroves were be examined.
7	Plantation Techniques	
7a	Raised Bed Method (Otl Method)	Create earthen mounts to plant 15-30 seeds; suitable for areas with low to moderate water currents.
7b	Transplantation of Nursery Raised Saplings	Grow saplings in polythene bags; nature for 3-4 months before transplanting; higher success rate

1. Background of the study

Mangroves are among the most productive ecosystems, providing various ecosystem services and resources to both the ocean environment and humankind. This unique ecosystem occurs in the tropics and subtropics, where land meets the oceans, often bordering estuaries and backwaters. Mangrove forests have the remarkable ability to rise upward in place or move landward or seaward in response to sea level changes (Woodroffe *et al.* 2016). Mangroves typically grow on wet, muddy substrates with minimal water fluctuations, specifically in the mudflat regions of tropical and subtropical areas. These are dense forests of trees and shrubs that are tolerant to salt, usually flourishing in tidal areas. The importance derived from these forests is critical, including coastal protection, biodiversity conservation, and climate change mitigation. All mangroves produce fertilizer from rotting litter fall and root growth deceiving ambient water sediment. Mangrove ecosystems support various plant and animal species, breeding, nursery and feeding grounds for numerous marine and terrestrial organisms. Despite their ecological importance, mangrove forests face different threats such as deforestation, pollution, and climate change. Specific measures have been taken towards conserving these valuable ecosystems including them into biosphere reserves and Ramsar sites.

According to the Forest Survey of India (FSI, 2019), the global mangrove cover is approximately 14.79 million hectares. Asia leads with 5.55 million hectares, followed by Africa with 3.24 million hectares, North and Central America with 2.57 million hectares, and South America with 2.13 million hectares. South Asia has the highest mangrove area, constituting about 6.8% of the world's total mangrove cover. Anthropogenic pressures have reduced global range of these forests to less than even half of their original total cover throughout the globe as mentioned by Ragavan *et al.* (2016) while Singh (2020) observed that almost 75% of the tropical coast has been taken up by mangrove forests. India's mangrove ecosystems are incredibly important, covering around 4,992 km², which makes up about 0.15% of the country's total land area. Despite occupying a relatively small fraction of India's geographical area, mangroves are hotspots of biological activity, supporting a wide range of flora and fauna. They help in sequestering carbon, thus mitigating climate change effects. Major mangrove areas in India include the Sundarbans in West Bengal, which is the largest mangrove forest in the world.

The present study on "Mangrove Plantation in an area of 50 Hectares for Deendayal Port Authority, Kandla" is being conducted to comply with the specific conditions outlined in the EC & CRZ Clearance dated 01.01.2024 and CRZ Recommendation condition no. 7 as given in Annexure B.

1.1. Mangrove status in Gujarat and Gulf of Kachchh

Gujarat state has the longest coast (1650 km²) with largest coastal area (28,000 km²) under cover of mangroves. Gujarat mangrove ecosystem is the second largest after Sundarbans in West Bengal (ISFR 2019). Though contentious, around 15 mangrove species are reported from 13 coastal districts of Gujarat. Of these, the southern coast of Gulf of Kachchh and South Gujarat coast are important for mangrove diversity. The species *Avicennia marina* is the most populous along the Gujarat coast. Along the coastal stretch of Gulf of Kachchh (GoK) has the most considerable mangrove extent of 986 km² out of 1140 km². Kachchh district, constituting the northern coast (northern shore) of GoK alone has 798 km² of mangroves constituting 70% of the whole Gujarat mangroves. Waterlogged mud with low oxygen levels supports such vegetation in tropical and subtropical regions. In the Kachchh coast has various habitats such as expansive mudflats and small sandy beaches with different physico-chemical variables like extreme salinity temperature inundation factor. This vibrating ecosystem can allow the species to thrive and exhibit many adaptive modifications.

Biodiversity-oriented planting schemes aim to boost species richness through ongoing plantation and meticulous monitoring activities. Restoring mangrove ecosystems with dominant species like *Avicennia marina*, *Ceriops tagal*, and *Rhizophora mucronata* plays a crucial role in enhancing species diversity. By increasing the variety of plant species, these schemes not only create a more resilient and productive ecosystem but also help in providing essential resources and services to local populations, such as fish breeding habitats, wood, and other forest products. Continuous planting and monitoring ensure that these ecosystems remain healthy and sustainable, benefiting both the environment and the people living in coastal regions. Mangrove biodiversity seeks attention towards such spots on the Kachchh coast, which require supplementation of plant cover at selected sites. For instance, although successful efforts at restoring mangroves exist, the presence of *A. marina* alone in most parts corroborates the role of high salinity of the water because of limited fresh water influx annually. The arid coastal conditions lack of

continuous freshwater flow through the river inhibits the spread and growth of mangroves which are constantly exposed to tidal inundation. The plantation of mangroves as well as creation of awareness regarding the importance of mangrove and their ecosystem services are the crucial tasks to avoid such loss.

1.2. Rationale of the project

Deendayal Port Authority (DPA) has been one of India's largest ports in terms of cargo volume handled. Being located in Gujarat state on the northwest coast of India, the port is one of the biggest creek-based ports in India. In India, it is one among twelve major ports and situated at Gulf of Kachchh's tail end, Gujarat's western part. The greatest advantage of this location is a high semi-diurnal tidal range of about 6 to 7 meters which allows for sufficient draft in the dredged channels at the Port. DPA has been and still is undergoing continuous development and expansion particularly over recent times and is located in the creek environment encompassing mangroves (193.1 km²) and mudflats (312.9 km²).

Over the last seven decades, it should be noted that due to these vast resources available at its doorstep; the port authorities have a desire to conserve, protect and enhance these coastal habitats. The coastal belt in and around Kandla region is characterized by a network of creek systems and mudflats which are covered by sparse halophytic vegetation like scrubby to dense mangroves, creek water and salt encrusted land mass which forms the major land component. The surrounding environment in a radius of 10 km from the Port is mostly built-up areas consisting salt works, human habitations and Port related structures on west and north, creek system, mangrove formations and mudflats in the east and south.

Deendayal Port as part of the expansion of the infrastructure facility has significant movements of materials and people within the area and construction activities as well. Additionally, as part of the environmental policy intended to accomplish 50 ha mangrove plantation and the task is entrusted with the Gujarat institute of Desert ecology, Bhuj, Kachchh district. Similar efforts towards conserving and preserving mangrove cover in the prospective areas have been implemented by the Deendayal Port Authority (DPA) to maintain numerous unheralded ecological services by these marine plants. Total mangrove plantation till date by DPA through several implementing agencies at Sat Saida Bet, Nakti Creek and Kantiyajal.. To ensure the project follows the

most contemporary standards and practices in the field. In accordance with the CRZ Recommendation Condition, Mr. Nischal Joshi of the Gujarat Ecology Commission (GEC) was consulted for his expert opinion during the initial stages of the work.

2. Objectives

Within the overall objective of mangrove plantation in the DPA port limits the following activity wise objectives are envisaged.

- Assess the technical suitability of the proposed land for mangrove plantation
- Assess the physico-chemical properties of soil and nearby water and tidal pattern in the proposed plantation site.
- Formulate site specific plantation strategy and execute it with the adopting appropriate techniques.

3. Study Area

The location finalized for mangrove plantation is shown in Figure 1, as per their suitability including water and sediment quality characteristics, occurrence of intertidal fauna, availability of propagules, signs of natural regeneration etc. Further, based on the water quality characteristics reported elsewhere, the site is better choice for the plantation of mangrove species, *A. marina*. In the studies conducted earlier, the salinity levels of this area is reported to be ranging between 35 - 40 ppt which is suitable for the selected species. The pH of the pour water is recorded to be in the range of 6.0 - 8.5. In addition to the above said criteria, plantation in general should be established in Intertidal areas where a good tidal flushing is happening atleast 15 days in a month.



Figure.1 Proposed location for Mangrove plantation activities at DPA area

4. Methodology

4.1. Field Studies

4.1.1. Site Overview:

- The inspection were provide an overall understanding of the site, not only for the plantation but also for potential risks (such as camel or cattle grazing).
- Accessibility for post-plantation monitoring were be evaluated to ensure ease of assessment.

4.1.2. Geographical Patterns:

- Existing mangrove species in the area were be studied to understand their presence and distribution.
- Geographical patterns were be analyzed to identify suitable locations for planting mangroves.

4.1.3. Landscape Assessment:

- Rainwater runoff into the creeks and the influencing zones were be observed to assess its impact on the mangrove ecosystem.
- The stability of the root system of existing mangroves were be examined.
- Sources of freshwater within the area were also be considered.

4.2. Plantation Techniques

Three methods preferred for the sake of mangrove plantation which were be as follows in this study period:

4.2.1. Raised bed method (Osla method)

- This is popular method of mangrove plantation in Gujarat useful for a few species such as *A. marina* and provide better result compare to other methods.
- In this method, earthen mounts of a specific height were be made which support to plant 15 to 30 seeds/ propagules.
- This method is suitable in the areas where the current of water is low and moderate (Plate 1).

4.2.2. Transplantation of nursery raised saplings (Poly bag method).

- This technique has higher success rate unlike other methods and therefore, nursery of the various species is required to grow the saplings (Plate 2).
- This technique is time consuming and laborious compared to direct dibbling and raised bed methods.
- On the open intertidal mudflats, the saplings were be grown in polythene bags through sowing the matured seeds or propagules.
- The saplings were be nurtured 3-4 months before transplantation and after attaining a height 30-45 cm in polythene bags.
- Site specific conditions were determining the number of saplings to be transplanted, however, 2500 saplings per ha is generally followed.
- In some occasions also nursery raised saplings were be used for gap filling and thereby increasing the survival rate of the plants table1.

After being successfully raised in the nursery, saplings between 30 and 45 cm tall should be chosen at different times to be transplanted at the intended location. Below are the specifics of the plantation's sapling height and germination period (plate 3). A total of 46 nursery beds were established, with each bed containing 800 to 1,200 polybags. Each polybag is sown with 3 to 4 seeds, facilitating optimal seedling production (Figures 8-13). In addition, ota raised method, in each bed sown 5 – 6 seeds were raised in plantation site (Figures 15-17)

Table 1: Details of sapling for plantation

Species	Germination period (days)	Germination percentage	Height (cm)of saplings
<i>Avicennia marina</i>	6-10	70-80	30-45
<i>Rhizophora mucronata</i>	30-35	50-60	60

With these methods, the extra seeds were also spreaded in the plantation area where the older trees are present and generally the area where natural regeneration of seeds happens.

5. Site visit

Before the initiation of mangrove plantation activity, a through pre-project survey was conducted to examine the proposed plantation site. In this survey, the crucial technical factors like land elevation, tidal pattern, physical and chemical properties of soil and water (by laboratory analysis), access to the site, level of protection such as cattle grazing, human disturbance and other potential risks, etc. were observed. This survey helps to decide the suitability of site for mangrove plantation in DPA port limit.

5.1. On-site observations

- The indicators of regular flooding of site by tide water was observed in on-site visit. The site area was wet and with plenty of mud which is required for plantation.
- There was no presence of very hard, dried soil surface in the site was observed anywhere.
- The presence of a few natural mangrove (*A. marina*) trees was observed around and in the plantation site which denotes the site is suitable for the plantation.
- The presence of crab holes and mudskippers holes is the indicator that the soil of the site is soft and regularly get wet due to tides.
- The pneumatophores of nearby mangroves were found in the nearby area which indicate that there is no sediment deposition and buried pneumatophores in this area.
- Nearby area also shows the presence of halophytic/ salt marsh plants such as *Sesuvium* and also *Salicornia* nearby creek.
- The *Sesuvium* leaves were green and fresh, also not thicker which represent the good condition of the site.
- The presence of sub-creek system may ensure the availability of tidal water which were be primary need of the plantation.
- A few natural regeneration plants were also observed in the site.
- The presence of the jackal foot marks observed which denotes the overall area have a good ecosystem and where the jackal food (crabs) sources are available.

5.2. Analysis of water and sediment samples

5.2.1. Water analysis

The water samples were collected from the plantation site in pre-cleaned polyethene bottles and rinsed with sample water, and transported to the laboratory in icebox for further analysis such as pH analysis by pH meter, salinity was determined by refractometer. The pH of water sample was found 7.25 and salinity 18 psu. Although there is no domestic freshwater source, and tidal water salinity generally higher, due to the rainy season the salinity shows lower values. However, the lower salinity is also in favour of germination of mangrove seeds.

5.2.2. Sediment/ soil analysis

Sediment samples were collected by using a non-metallic plastic spatula from random locations; three from each transect to cover the whole study area. The collected samples were air-dried at room temperature (Jackson, 1958), homogenized using an agate mortar and pestle, sieved through a standard sieve of 2 mm mesh (Tandon, 2005). The particles with size less than 2mm were retained in pre cleaned plastic bottles for further analysis for various parameters. Total Organic Carbon (TOC), pH, texture, bulk density, etc were analysed.

Texture of sediment: The texture of soil/sediment is one of the key factors when choosing a site for plantation mangroves. Generally, mangrove ecosystems typically have the types of soils which includes muds or clay or sandy mud, etc. The texture of soil significantly impacts the survival and growth of mangroves. The presence of clay texture which makes soil muddy may expected to offer a stable base for mangrove roots to flourish under tidal conditions. Thus, evaluating the soil conditions at the plantation site is crucial before starting mangrove planting activities. Here we collected 3 samples, and all shows good amount of clay percentage in them which may be favourable for the plantation.

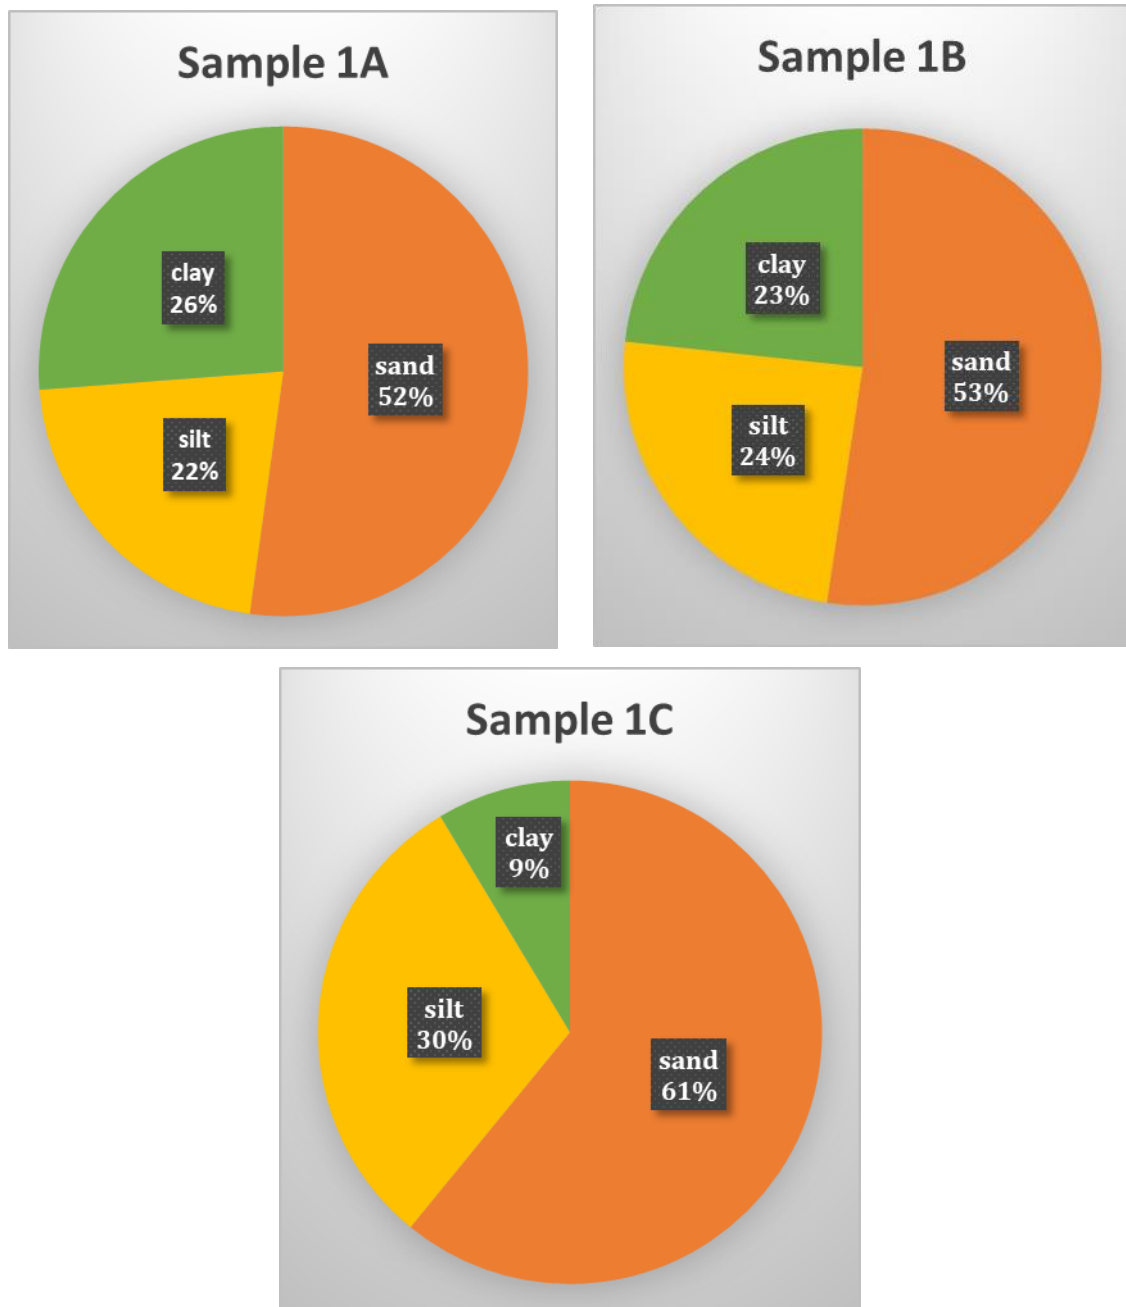


Figure 2: Sediment textural composition in the sampling sites

Bulk density of soil: It refers to the amount of soil organic matter within a given volume of soil. This property can vary significantly and is influenced by the soil's texture, structure, and organic matter content. Soils with high organic matter tend to have lower bulk density, while compacted soils exhibit higher bulk density.

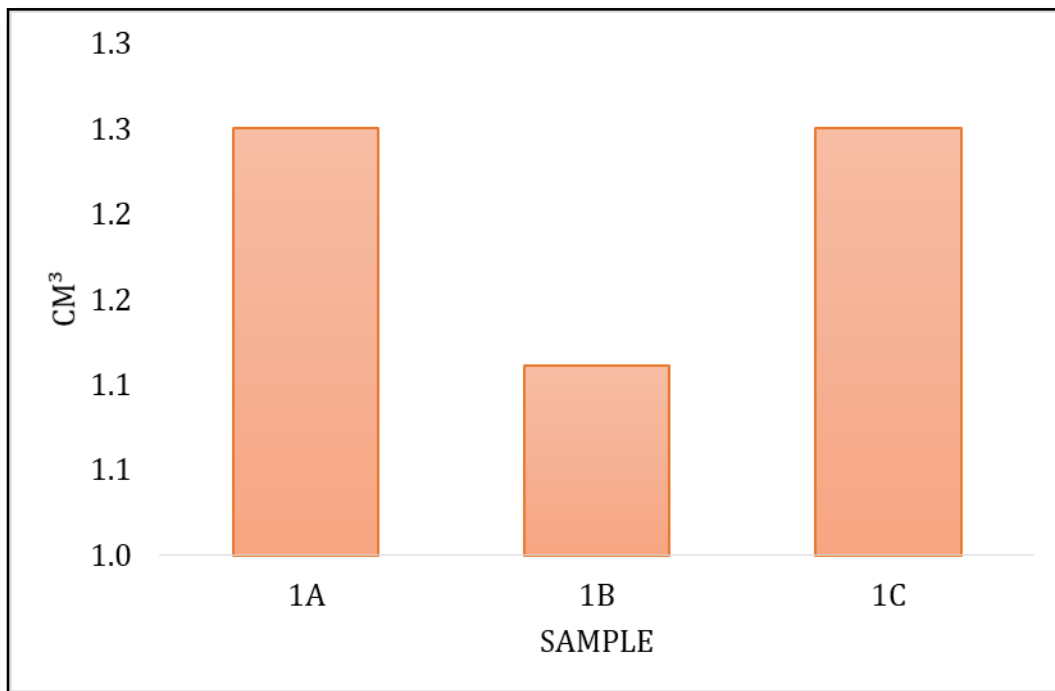


Figure 3: Bulk density of sediment samples

Total Organic Carbon: Organic carbon levels are influenced by living organisms, and the diversity of life forms in mudflats affects the total organic carbon (TOC) estimates. In all samples, the TOC percentage was ranged from 2.7 % to 2.85%

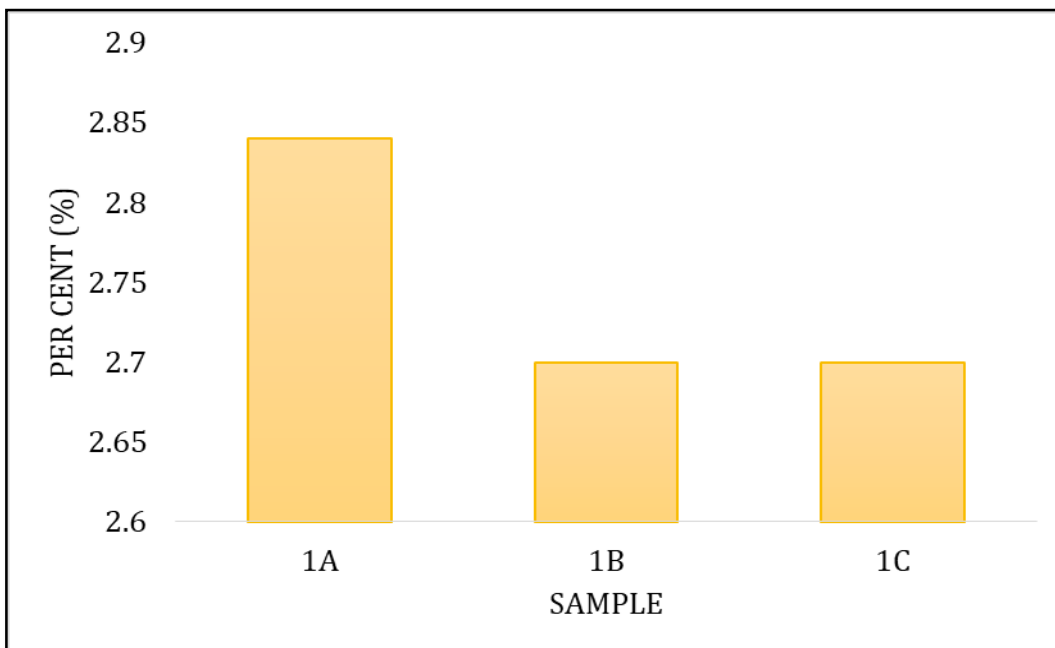


Figure 4: Total Organic Carbon content of sediment samples



Plate 1: Selection of suitable sites for mangrove plantation in DPA area based on sediment characteristics, tidal pattern, cattle grazing etc



Plate 2: Site identification, planning and field observation at mangrove plantation site on July 17th to 31st, 2024



Plate 3: Mangrove Seed Collection at Kandla on 1st to 07th August, 2024



Plate 4: Team involved in collection and separation of healthy mangrove seeds on 8th to 17th August, 2024



Plate 5: Women involved in processing of mangrove seeds on 17th to 25th August, 2024



Plate 6: Preparation and filling of bags for submerged Nursery Development Activity on 25th to 30th August, 2024



Plate 7: Labour Involvement in filling of bags for nursery preparation at Kandla on 25th August to 5th September, 2024



Plate 8: Seed sowing of *Avicennia marina* in polybags at nursery at Kandla on 6th to 15th September, 2024



Plate 9: Site submerged during high tide on 15th September, 2024



Plate 10: Germination of *A. marina* seeds in polybags and germination during visit of GUIDE team at Kandla on 15th to 25th September, 2024



Plate 11: Nursery of *A. marina* saplings in natural tidal inundation at Kandla on 5th to 25th October, 2024



Plate 12: Insect pests and diseases in *A. marina* leaf and stem in saplings during visit of GUIDE team at Kandla on 25th October to 5th November, 2024



Plate 13: Labour Involvement in Opla bed raised method at Kandla 1st to 07th September, 2024



Plate 14: Seed sowing of *A. marina* in Orla beds at nursery at Kandla on 10th to 25th September, 2024



Plate 15: Germination of *A. marina* in Orla beds observed during visit of GUIDE team at Kandla on 5th to 25th October,



Plate 16: Mangrove Growth of *A. marina* prior to Transplanting from Nursery to Plantation Site by the GUIDE Team at Kandla on 30th November



Plate 17: Labour Participation in Loading Nursery Bags onto Boats for Transportation to Plantation Sites at Kandla on 1st December to 15th December, 2024



Plate 18: Labour Involvement plantation the *A. marina* at Kandla on 1st December, 2024 to 31st January, 2025



Plate 19: Labour Involvement plantation the *A. marina* at Kandla on 1st December, 2024 to 31st January, 2025



Plate 20: Labour Involvement in *A. marina* Plantation during GUIDE Team Visit to Kandla on 15th January, 2025



Plate 21: *A. marina* Plantation during GUIDE Team and DPA Team Visit to Kandla on 15th January, 2025



Plate 22: Mangrove outplanting, including row establishment and saplings placing inside hole, levelling soil surface at Kandla on 10th February, 2025

6. Summary of the Report

The aim of the report is to assess the situation of growing mangrove saplings at DPA Gulf of Kutch. In order to comply with the stipulated condition of the EC & CRZ Clearance dated 1/1/2024 accorded by the MoEF&CC, GoI read with CRZ Recommendation dated 25/8/2022 for “Augmentation of Liquid Cargo Handling capacity from 8 to 23.8 MMTPA through modernization of existing Pipeline network at Oil Jetty area of DPA, Kandla”), DPA assigned work of “Mangrove Plantation in an area of 50 Hectares for Deendayal Port Authority reg.”, to GUIDE, Bhuj vide work order dated 10/6/2024.

The DPA has initiated a program for plantation of mangroves to improve these ecosystems within the limits of its port. The general focus of this project is to evaluate mangrove plantation in an area of 50 Hectares for Deendayal Port Authority, site conditions for planting, study the soil and water characteristics, and formulate and execute a site-specific planting plan utilizing nursery grown transplant, otla method and other forms. The objective is to increase the mangrove species, improve the resilience of the ecosystem and provide the local population with valuable resources and services, all while ensuring the sustainability of mangrove cover over the long term. The increased ecological stability and productivity of the region, and provide necessary resources and services to the local and marginalized communities throughout the work in a selected, defined and timetabled manner to observe the speed of the work done. The Mangrove Plantation in an area of 50 Hectares of *Avicennia marina* and *Rhizophora mucronata* at scientifically identified location (Satsaida bet) is completed.

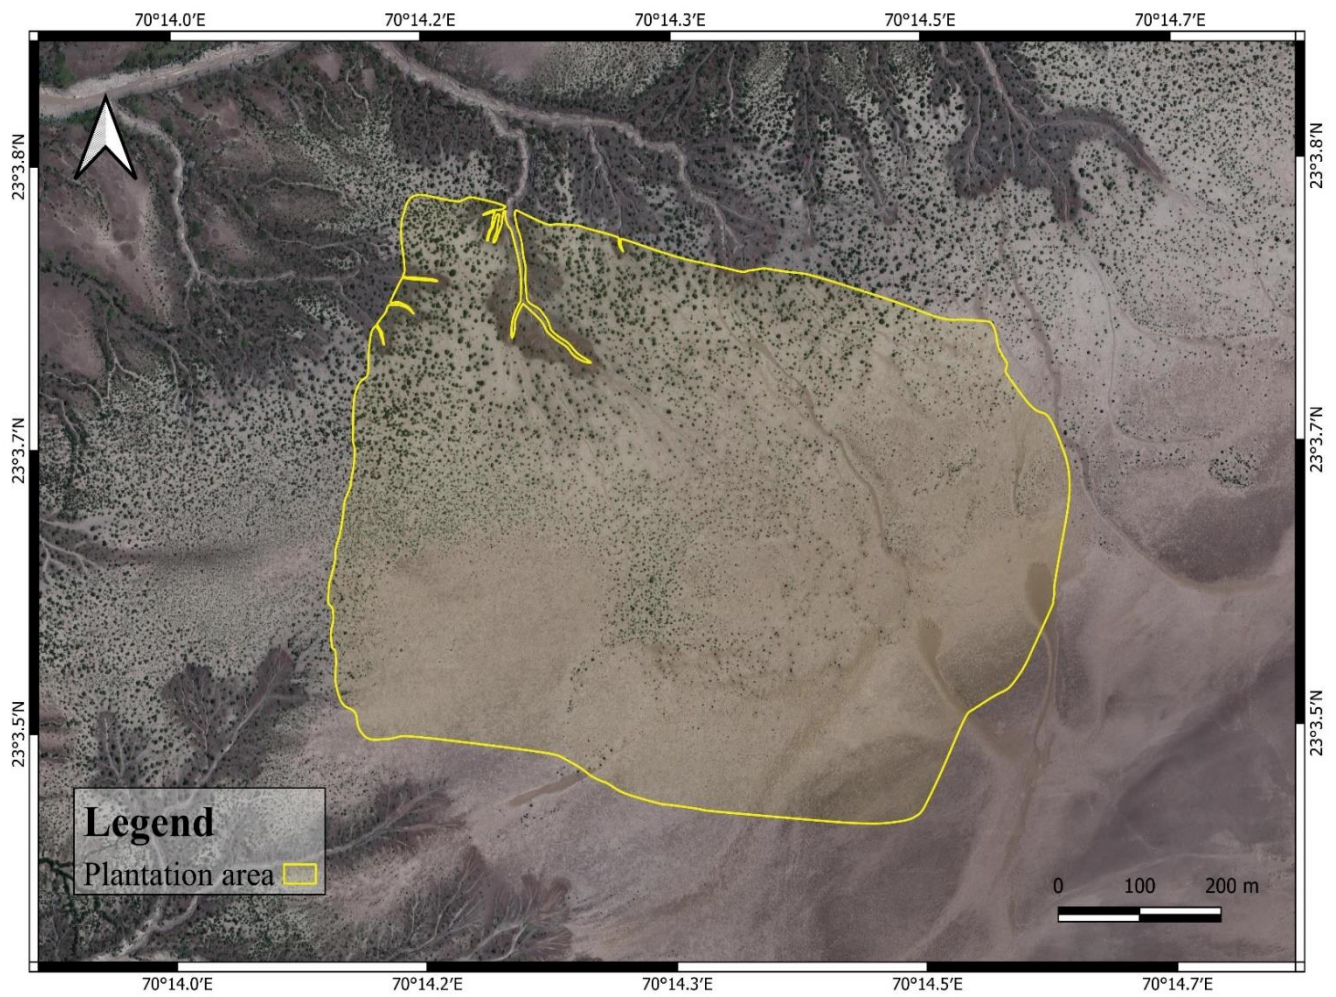


Figure 5: Mangrove plantation site area at Kandla, Gujarat, India



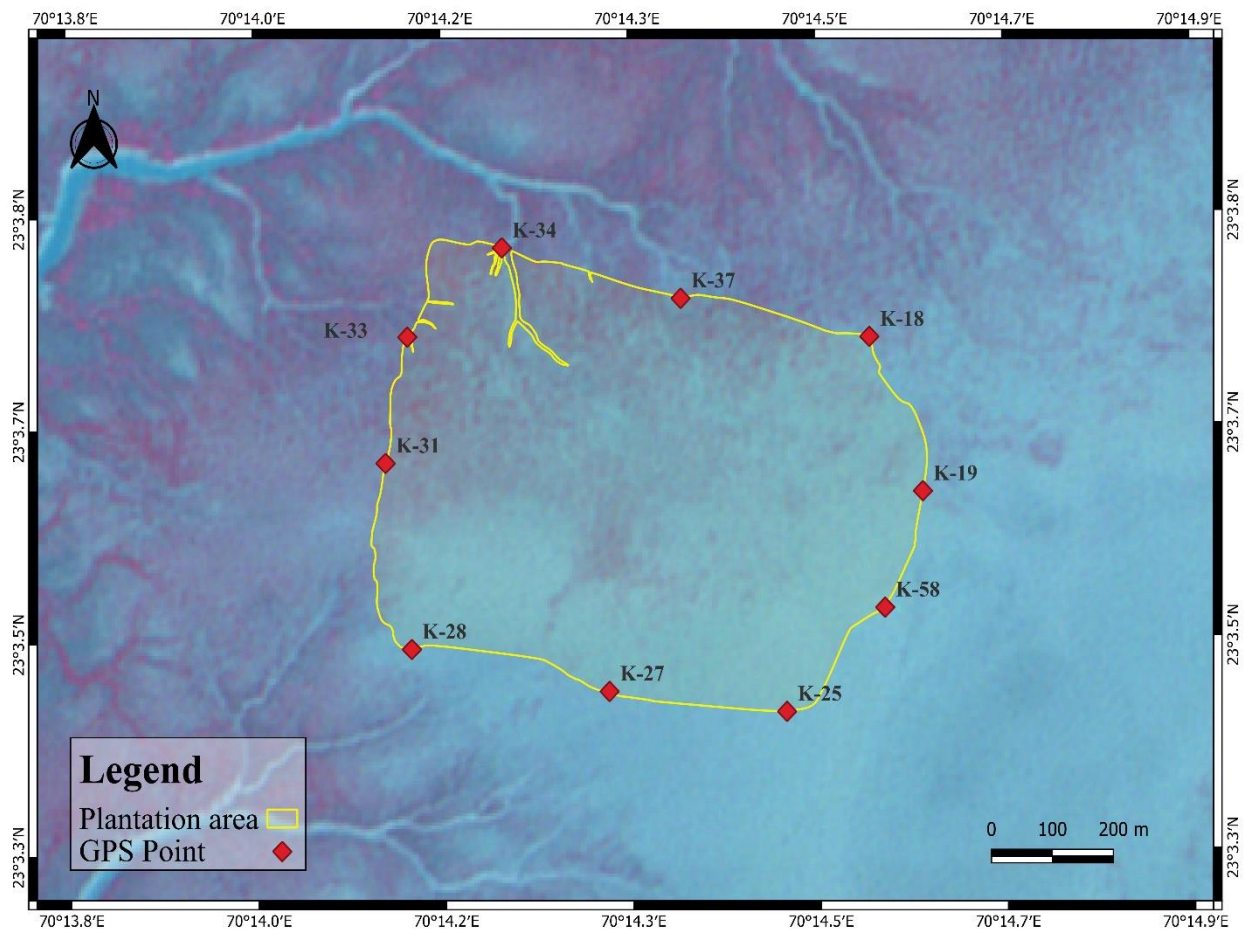
Plate 24: Growing saplings during GUIDE Team Visit to Kandla on 10th February, 2025



Plate 25: Labour Involvement plantation the *Rhizophora mucronata* at Kandla on 31st January to 28th March, 2025

Table: 2 GPS Points of Mangrove Project Site at Kandla, Gujarat, India

No	Point No.	Longitude	Latitude
1	K-18	70.243	23.062
2	K-19	70.244	23.06
3	K-23	70.243	23.058
4	K-25	70.241	23.057
5	K-27	70.239	23.057
6	K-28	70.235	23.058
7	K-31	70.235	23.061
8	K-33	70.235	23.062
9	K-35	70.237	23.064
10	K-37	70.24	23.063

**Figure 6:** Mangrove plantation site area with GPS location points at kandla, Gujarat, India

7. Future Considerations for Mangrove Plantation

DPA needs to focus on the mangrove plantation project in Kandla. In ensuring that, this report puts forward the steps that need monitoring for the future.

7.1. Carry out regular monitoring of mangrove plantation

The regular monitoring of mangrove plantations is must in the plantation site to ensure growth status of the planted mangroves. It will also help in detection of any signs of disease or damage early. Regular monitoring also helps to understand any threats to mangrove such as potential erosion or grazing etc, also help to protect the local ecosystem and biodiversity. It will useful in the measurement of effectiveness of conservation efforts.

7.2. Regular gap filling to be done

Maintenance of the plantation is crucial for its continued success. Regular upkeep is needed, including filling in gaps where plants may have failed to establish. In addition to *Avicennia marina*, it's important to plant a variety of mangrove species to boost biodiversity. This increased diversity enhances the ecosystem's resilience to environmental changes, such as fluctuations in salinity, temperature, and sea level rise. Regular monitoring and management practices ensure the plantation's long-term health and ecological stability, contributing to the protection of coastal areas and marine life habitats.

8. References

ISFR (2019) India state of forest report. Ministry of Environment Forest and Climate Change Dehradun

Ragavan P, Saxena A, Jayaraj RSC, Mohan PM, Ravichandran K, Saravanan S, Vijayaraghavan A (2016) A review of the mangrove floristics of India. Taiwania 61(3)

- Singh JK (2020) Structural characteristics of mangrove forest in different coastal habitats of Gulf of Khambhat arid region of Gujarat, west coast of India. *Heliyon* 6(8):e04685. <https://doi.org/10.1016/j.heliyon.2020.e04685>
- Woodroffe CD, Rogers K, McKee KL, Lovelock CE, Mendelssohn IA, Saintilan N (2016) Mangrove sedimentation and response to relative sea-level rise. *Annual review of marine science* 8(1):243–266
- APHA (2017). *Standard Methods for the Examination of Water and Wastewater*, 23rd edition. American Public Health Association, 1546.
- Strickland, J.D.H. and Parsons, T.R. (1972) *A Practical Handbook of Seawater Analysis*. 2nd edition. Ottawa, Canada, Fisheries Research Board of Canada, 310pp. (Bulletin Fisheries Research Board of Canada, Nr. 167 (2nd ed)). DOI: <http://dx.doi.org/10.25607/OBP-1791>
- Tandon, V.R. (2005) Medicinal Uses and Biological Activities of *Vitex negundo*. *Natural Product Radiance*, 4, 162-165.
- Jackson, M.L. (1958) *Soil Chemical Analysis*. Prentice-Hall Inc., Englewood Cliffs, NJ, 498 p.

Annexure -C

Environmental Monitoring Report (EMR)
prepared under
**“Preparing and monitoring of environmental monitoring and management plan
for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years”**

(Monitoring Period: December 2024 -January 2025)



Document Ref No.: GEMI/DPA/782(2)(4)/2024-25/165

Submitted to:
Deendayal Port Authority (DPA), Kandla



Gujarat Environment Management Institute (GEMI)

(An Autonomous Institute of Government of Gujarat)

GEMI Bhavan, 246-247, GIDC Electronic Estate, Sector-25, Gandhinagar-382025

“AN ISO 9001:2015, ISO 14001:2015 AND ISO 45001:2018 Certified Institute”

Certificate

This is to certify that the Monthly Environment Monitoring Plan (EMP) report for the period 15th December 2024 to 14th January 2025 for the work entitled, **“Preparing and Monitoring of Environmental Monitoring and Management Plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years”** has been prepared in line with the work order no. **EG/WK/EMC/1023/2011/iii/239** dated 15/02/2023 allotted by Deendayal Port Authority.

The report has been delivered as per the terms and conditions of the work order Sr. No. 4(2).


S. S. O. & Lab Head
Authorized Signatory

© Gujarat Environment Management Institute (GEMI)

All rights reserved. This “Environment Monitoring Report (Dec-2024-Jan-2025)” is prepared as a part of the project “Preparing and monitoring of Environmental monitoring and Management plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years”. No part of this report may be reproduced, distributed or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording or otherwise, without the prior permission of Director, Gujarat Environment Management Institute (GEMI).

Disclaimer:

Gujarat Environment Management Institute (GEMI) has taken all reasonable precautions in the preparation of this report. The data presented in this report have been collected as per the relevant Standard Operating Procedures, Protocols and Guidelines. GEMI believes that the information and facts presented in the report are accurate as on the date it was written. However, it is impossible to dismiss absolutely, the possibility of errors or omissions. GEMI therefore specifically disclaims any liability resulting from the use or application of the information contained in this report. The information is not intended to serve as legal advice related to the individual situation.

About this Document

Gujarat Environment Management Institute (GEMI) has been assigned with the work of “Preparing and monitoring of Environmental monitoring and Management plan for Deendayal Port Authority (DPA) at Kandla and Vadinar for a period of 3 years” by DPA, Kandla. Under the said project the report titled “*Environment Monitoring Report (Dec-2024-Jan-2025)*” is prepared.

- **Name of the Report:** *Environment Monitoring Report (Dec-2024-Jan-2025)*
- **Date of Issue:** 15/02/2025
- **Version:** 1.0
- **Report Ref.:** GEMI/DPA/782(2)(4)/2024-25/165

Table of Contents

CHAPTER 1: INTRODUCTION.....	1
1.1 Introduction	2
1.2 Green Ports Initiative.....	2
1.3 Importance of EMP	3
1.4 Objectives and scope of the Study	4
CHAPTER 2: METHODOLOGY.....	6
2.1 Study Area	7
a. Kandla.....	7
b. Vadinar	7
2.2 Environmental Monitoring at Kandla and Vadinar.....	11
CHAPTER 3: METEOROLOGY MONITORING.....	13
3.1 Meteorology Monitoring.....	14
3.2 Results and discussion	16
3.3 Data Interpretation and Conclusion.....	17
CHAPTER 4: AMBIENT AIR QUALITY MONITORING	20
4.1 Ambient Air Quality.....	21
4.2 Result and Discussion	27
4.3 Data Interpretation and Conclusion.....	33
4.4 Remedial Measures:.....	35
CHAPTER 5: DG STACK MONITORING	37
5.1 DG Stack Monitoring.....	38
5.2 Result and Discussion	41
5.3 Data Interpretation and Conclusion.....	41
CHAPTER 6: NOISE MONITORING.....	42
6.1 Noise Monitoring	43
6.2 Result and Discussion	47
6.3 Data Interpretation and Conclusion.....	48
6.4 Remedial Measures.....	48
CHAPTER 7: SOIL MONITORING.....	49
7.1 Soil Quality Monitoring:	50
7.2 Result and Discussion	54

7.3	Data Interpretation and Conclusion.....	54
CHAPTER 8: DRINKING WATER MONITORING		57
8.1	Drinking Water Monitoring.....	58
8.2	Result and Discussion	63
8.3	Data Interpretation and Conclusion.....	65
8.4	Remedial Measures.....	66
CHAPTER 9: SEWAGE TREATMENT PLANT MONITORING		68
9.1	Sewage Treatment Plant (STP) Monitoring:.....	69
9.2	Result and Discussion	75
9.3	Data Interpretation and Conclusion.....	77
9.4	Remedial Measures:.....	77
CHAPTER 10: MARINE WATER QUALITY MONITORING		79
10.1	Marine Water	80
10.2	Result and Discussion	84
10.3	Data Interpretation and Conclusion.....	86
CHAPTER 11: MARINE SEDIMENT QUALITY MONITORING.....		89
11.1	Marine Sediment Monitoring.....	90
11.2	Result and Discussion	93
11.3	Data Interpretation and Conclusion.....	94
CHAPTER 12: MARINE ECOLOGY MONITORING		98
12.1	Marine Ecological Monitoring.....	99
12.2	Result and Discussion	106
Annexure 1: Photographs of the Environmental Monitoring conducted at Kandla		115
Annexure 2: Photographs of the Environmental Monitoring conducted at Vadinar.....		116

List of Tables

Table 1: Details of Automatic Weather Station.....	14
Table 2: Automatic Weather Monitoring Station details.....	14
Table 3: Meteorological data for Kandla and Vadinar.....	16
Table 4: Details of Ambient Air monitoring locations.....	21
Table 5: Parameters for Ambient Air Quality Monitoring.....	27
Table 6: Summarized results of PM ₁₀ , PM _{2.5} , SO ₂ , NO _x , VOC and CO for Ambient Air quality monitoring.....	27
Table 7: Summarized results of Benzene for Ambient Air quality monitoring	33
Table 8: Summarized results of Polycyclic Aromatic Hydrocarbons	33

Table 9: Summarized results of Non-methane VOC.....	33
Table 10: Details of DG Stack monitoring locations.....	38
Table 11: DG stack parameters.....	41
Table 12: DG monitoring data.....	41
Table 13: Details of noise monitoring locations.....	43
Table 14: Details of the Noise Monitoring.....	46
Table 15: Ambient Air Quality norms in respect of Noise.....	46
Table 16: The Results of Ambient Noise Quality.....	47
Table 17: Details of the Soil quality monitoring.....	50
Table 18: Soil parameters.....	51
Table 19: Soil Quality for the sampling period.....	54
Table 20: Details of Drinking Water Sampling Locations.....	58
Table 21: List of parameters for Drinking Water Quality monitoring.....	61
Table 22: Summarized results of Drinking Water quality.....	63
Table 23: Details of the monitoring locations of STP.....	69
Table 24: Treated effluent Standards (as per CC&A of Kandla STP).....	69
Table 25: Norms of treated effluent as per CC&A of Vadinar STP.....	72
Table 26: List of parameters monitored for STP's at Kandla and Vadinar.....	75
Table 27: Water Quality of inlet and outlet of STP of Kandla.....	76
Table 28: Water Quality of inlet and outlet of STP of Vadinar.....	76
Table 29: Details of the sampling locations for Marine water.....	80
Table 30: List of parameters monitored for Marine Water.....	83
Table 31: Results of Analysis of Marine Water Sample for the sampling period.....	85
Table 32: Details of the sampling locations for Marine Sediment.....	90
Table 33: List of parameters to be monitored for Sediments at Kandla and Vadinar.....	93
Table 34: Summarized result of Marine Sediment Quality.....	94
Table 35: Standard Guidelines applicable for heavy metals in sediments.....	96
Table 36: Comparison of Heavy metals with Standard value in Marine Sediment.....	96
Table 37: Details of the sampling locations for Marine Ecological.....	99
Table 38: List of parameters to be monitored for Marine Ecological Monitoring.....	102
Table 39: Values of Biomass, Net Primary Productivity (NPP), Gross Primary Productivity (GPP), Pheophytin and Chlorophyll for Kandla and Vadinar.....	107
Table 40: Phytoplankton variations in abundance and diversity in sub surface sampling stations.....	109
Table 41: Species richness Index and Diversity Index in Phytoplankton.....	110
Table 42: Zooplankton variations in abundance and diversity in sub surface sampling stations.....	110
Table 43: Species richness Index and Diversity Index in Zooplankton.....	111
Table 44: Benthic Fauna variations in abundance and diversity in sub surface sampling....	112
Table 45: Species richness Index and Diversity Index in Benthic Organisms.....	113

List of Maps

Map 1: Locations of Kandla and Vadinar	8
Map 2: Locations of Kandla Port.....	9
Map 3: Locations of Vadinar Port.....	10
Map 4: Locations for Ambient Air Monitoring at Kandla.....	24
Map 5: Locations for Ambient Air Monitoring at Vadinar	25
Map 6: Locations for DG Stack monitoring at Kandla.....	39
Map 7: Locations for DG Stack monitoring at Vadinar	40
Map 8: Locations for Noise Monitoring at Kandla.....	44
Map 9: Locations for Noise Monitoring at Vadinar	45
Map 10: Locations for Soil Quality Monitoring at Kandla	52
Map 11: Locations for Soil Quality Monitoring at Vadinar	53
Map 12: Locations for Drinking Water Monitoring at Kandla	59
Map 13: Locations for Drinking Water Monitoring at Vadinar.....	60
Map 14: Locations for STP Monitoring at Kandla	73
Map 15: Locations for STP Monitoring at Vadinar	74
Map 16: Locations for Marine Water Monitoring at Kandla	81
Map 17: Locations for Marine Water Monitoring at Vadinar.....	82
Map 18: Location of Marine Sediment Monitoring at Kandla.....	91
Map 19: Locations of Marine Sediment Monitoring at Vadinar.....	92
Map 20: Locations of Marine Ecological Monitoring at Kandla.....	100
Map 21: Locations of Marine Ecological Monitoring at Vadinar	101

List of Figures

Figure 1: Methodology flow chart	12
Figure 2: Photographs of Automatic Weather Monitoring Station at Kandla and Vadinar....	15
Figure 3: Process flow diagram of STP at Kandla	70
Figure 4: Process flow diagram of STP at Gopalpuri.....	71
Figure 5: Process flowchart for the STP at Vadinar.....	72

List of Graphs

Graph 1: Spatial trend in Ambient PM ₁₀ Concentration.....	32
Graph 2: Spatial trend in Ambient PM _{2.5} Concentration	31
Graph 3: Spatial trend in Ambient SO _x Concentration.....	32
Graph 4: Spatial trend in Ambient NO _x Concentration.....	32
Graph 5: Spatial trend in Ambient CO Concentration	32
Graph 6: Spatial trend in Ambient Total VOCs.....	32

List of Abbreviations

A	Acceptable Limits as per IS: 10500:2012
AAQ	Ambient Air Quality
AWS	Automatic Weather monitoring stations
BIS	Bureau of Indian Standards
BOD	Biochemical Oxygen Demand
BQL	Below Quantification Limit
CCA	Consolidated Consent & Authorization
CO	Carbon Monoxide
COD	Chemical Oxygen Demand
CPCB	Central Pollution Control Board
DO	Dissolved Oxygen
DPA	Deendayal Port Authority
EC	Electrical Conductivity
EMMP	Environmental monitoring and Management Plan
EMP	Environment Management Plan
FPS	Fine Particulate Sampler
FY	Financial Year
GEMI	Gujarat Environment Management Institute
IFFCO	Indian Farmers Fertiliser Cooperative Limited
IMD	India Meteorological Department
IOCL	Indian Oil Corporation Limited
LNG	Liquefied Natural Gas
MGO	Marine Gas Oil
MMTPA	Million Metric Tonnes Per Annum
MoEF	Ministry of Environment & Forests
MoEF&CC	Ministry of Environment, Forest and Climate Change
NAAQS	National Ambient Air Quality Standards
NO_x	Nitrogen oxides
NTU	Nephelometric Turbidity Unit
OOT	Off Shore Oil Terminal
OSR	Oil Spill Response
P	Permissible Limits as per IS: 10500:2012
PAH	Poly Aromatic Hydrocarbons
PM	Particulate Matter
PTFE	Polytetrafluoroethylene
RCC	Reinforced Concrete Cement
RDS	Respirable Dust Sampler
SAR	Sodium Adsorption Ratio
SBM	Single Bouy Mooring
SO_x	Sulfur oxides
STP	Sewage Treatment Plant
TC	Total Coliforms
TDS	Total Dissolved Solids
TOC	Total organic Carbon
TSS	Total Suspended Solids
VOC	Volatile Organic Compounds

CHAPTER 1: INTRODUCTION

1.1 Introduction

Kandla Port, also known as the Deendayal Port is a seaport in Kachchh District near the city of Gandhidham in Gujarat state in western India. Located on the Gulf of Kachchh, it is one of major ports on the western coast, and is located at 256 nautical miles southeast of the Port of Karachi in Pakistan and over 430 nautical miles north-northwest of the Port of Mumbai (Bombay). It is the largest port of India by volume of cargo handled. Deendayal Port's journey began in 1931 with the construction of RCC Jetty by Maharao Khengarji. Kandla was constructed in the 1950s as the chief seaport serving western India, after the independence of India. On 31st March 2016, Deendayal Port created history by handling 100 MMT cargo in a year and became the first Major Port to achieve this milestone. Deendayal Port Authority (DPA), India's busiest major port in recent years, is gearing up to add substantial cargo handling capacity with private sector participation. DPA has created new record by handling 137 MMTPA (at Kandla and Vadinar) during the financial year 2022-23. The DPA had commissioned the Off-shore Oil Terminal facilities at Vadinar in the year 1978, for which M/s. Indian Oil Corporation Limited (IOCL) provided Single Bouy Mooring (SBM) system, with a capacity of 54 MMTPA. Further, significant Quantum of infrastructural upgradation has been carried out & excellent maritime infrastructure has been created at Vadinar for the 32 MMTPA Essar Oil Refinery in Jamnagar District.

1.2 Green Ports Initiative

DPA is committed to sustainable development and adequate measures are being taken to maintain the Environmental well-being of the Port and its surrounding environs. Weighing in the environmental perspective for sustained growth, the Ministry of Shipping had started, Project Green Ports" which will help in making the Major Ports across India cleaner and greener. "Project Green Ports" will have two verticals - one is "Green Ports Initiatives" related to environmental issues and second is "Swachh Bharat Abhiyaan".

The Green Port Initiatives include twelve initiatives such as preparation and monitoring plan, acquiring equipment required for monitoring environmental pollution, acquiring dust suppression system, setting up of sewage/waste water treatment plants/ garbage disposal plant, setting up Green Cover area, projects for energy generation from renewable energy sources, completion of shortfalls of Oil Spill Response (OSR) facilities (Tier-I), prohibition of disposal of almost all kind of garbage at sea, improving the quality of harbour wastes etc.

DPA had also appointed GEMI as an Advisor for "Making Deendayal Port a Green Port-Intended Sustainable Development under the Green Port Initiatives. DPA has also signed MoU with Gujarat Forest Department in August 2019 for Green Belt Development in an area of 31.942 Ha of land owned by DPA. The plantation is being carried out by the Social Forestry division of Kachchh.

1.3 Importance of EMP

Port activities can cause deterioration of air and marine water quality in the surrounding areas due to multifarious activities. The pollution problems usually caused by port and harbour activities can be categorized as follows:

1. Air pollutant emissions due to ship emissions, loading and unloading activities, construction emission and emissions due to vehicular movement.
2. Coastal habitats may be destroyed and navigational channels silted due to causeway construction and land reclamation.
3. Deterioration of surface water quality may occur during both the construction and operation phases.
4. Harbour operations may produce sewage, bilge wastes, solid waste and leakage of harmful materials both from shore and ships.
5. Human and fish health may be affected by contamination of coastal water due to urban effluent discharge.
6. Oil pollution is one of the major environmental hazards resulting from port/harbour and shipping operations. This includes bilge oil released from commercial ships handling non-oil cargo as well as the more common threat from oil tankers.
7. Unregulated mariculture activities in the port and harbour areas may threaten navigation safety.

Hence, for the determination of levels of pollution, identification of pollution sources, control and disposal of waste from various point and non-point sources and for prediction of pollution levels for future, regular monitoring and assessment are required during the entire construction and operation phase of a major port. As per the Ministry of Environment, Forest and Climate Change (**MoEF&CC**), The Environmental Management Plan (EMP) is required to ensure sustainable development in the area surrounding the project. Hence, it needs to be an all encompassing plan consist of all mitigation measures for each item wise activity to be undertaken during the construction, operation and the entire life cycle to minimize adverse environmental impacts resulting from the activities of the project. for formulation, implementation and monitoring of environmental protection measures during and after commissioning of projects. The plan should indicate the details of various measures are taken and proposed to be taken for appropriate management of the environment of Deendayal Port Authority.

It identifies the principles, approach, procedures and methods that will be used to control and minimize the environmental and social impacts of operational activities associated with the port. An EMP is a required part of environmental impact assessment of a new port project but could also be evolved for existing ports. It is useful not only during the construction and operational phases of the new port but also for operation of existing ports to ensure the effectiveness of the mitigation measures implemented and to further provide guidance as to the most appropriate way of dealing with any unforeseen impacts.

It is extremely essential that port and harbour projects should have an Environmental Monitoring and Management Plan (EMMP), which incorporates monitoring of Ambient Air, Drinking Water, Noise, Soil, Marine (water, sediment, ecology) quality along with the collection of online meteorological data throughout the duration of the project.

To ensure the effective implementation of the EMP and weigh the efficiency of the mitigation measures, it is essential to undertake environmental monitoring both during construction and operation period. In view of the above, Gujarat Environment Management Institute (GEMI) has been awarded with the work “**Preparing and Monitoring of Environmental Monitoring and Management Plan for Deendayal Port Authority at Kandla and Vadinar for a period of 3 years**” vide letter No. EG/WK/EMC/1023/2011/III/239 dated: 15/02/2023 by DPA.

This document presents the Environmental Monitoring Report (EMR) for Kandla and Vadinar for the environmental monitoring done during the period from 17th December-16th January 2024-2025.

1.4 Objectives and scope of the Study

In line with the work order, the key objective of the study is to carry out the Environmental Monitoring and preparation the Management Plan for Kandla and Vadinar for a period of 3 years". Under the project, Environmental monitoring refers to systematic assessment of ambient air, water (drinking and surface), soil, sediment, noise and ecology in order to monitor the performance and implementation of a project in compliance with Environmental quality standards and/or applicable Statutory norms.

The scope of work includes not limited to following:

1. To review the locations/stations of Ambient Air, Ambient Noise, drinking water, and Marine Water, Soil and Sediments monitoring within the impacted region in-and-around DPA establishment, in view of the developmental projects.
2. To assess the Ambient Air quality, quality at 6 stations at Kandla and 2 at Vadinar in terms of gases and particulate matter.
3. To assess the DG stack emissions (gases and particulate matter).
4. To assess Drinking water quality at twenty locations (18 at Kandla and 2 at Vadinar) in terms of Physical, Chemical and Biological parameters viz., Color, Odor, turbidity, conductivity, pH, Total Dissolved Solids, chlorides, Hardness, total iron, sulfate, NH_4 , PO_4 , and bacterial count on a monthly basis.
5. To assess the Marine water quality in terms of aquatic Flora and Fauna and Sediment quality in terms of benthic flora and fauna.
6. To assess Marine Water Quality and sediment in term of physical and chemical parameter.
7. To assess the trends of water quality in terms of Marine ecology by comparing the data collected over a specified time period.
8. Weekly sample collection and analysis of inlet & Outlet points of the Sewage Treatment Plant (STP) to check the water quality being discharged by DPA as per the CC&A.
9. Carrying out monthly Noise monitoring; twice a day at the representative stations for a period of 24 hours.
10. Meteorological parameters are very important from air pollution point of view, hence precise and continuous data collection is of utmost importance. Meteorological data on wind speed, wind direction, temperature, relative humidity, solar radiation and

rainfall shall be collected from one permanent station at DPA, Kandla and one permanent station at Vadinar.

11. To suggest mitigation measures, based on the findings of this study and also check compliance with Environmental quality standards, Green Port Initiatives, MIV 2030, and any applicable Statutory Compliance.
12. To recommend Environment Management Plans based on Monitoring programme and findings of the study.

CHAPTER 2: METHODOLOGY

2.1 Study Area

Under the study, the locations specified by Deendayal Port Authority for the areas of Kandla and Vadinar would be monitored. The details of the study area as follows:

a. Kandla

Deendayal Port (Erstwhile Kandla Port) is one of the twelve major ports in India and is located on the West Coast of India, in the Gulf of Kutch at 23001'N and 70013'E in Gujarat. The Major Port Authorities Act 2021 is the governing statute for Administration of Major Ports, under which, Deendayal Port Trust (DPT) has become Deendayal Port Authority (DPA). At Kandla, DPA has sixteen (16) cargo berths for handling various types of Dry Bulk Cargo viz, fertilizer, food grains, Coal, sulphur, etc.

- **Climatic conditions of Kandla**

Kandla has a semi-desert climate. Temperature varies from 25°C to 44°C during summer and 10°C to 25°C during winter. The average annual temperature is 24.8 °C. The average rainfall is 410 mm, most of which occurs during the monsoon from the months of June-to-September.

b. Vadinar


Vadinar is a small coastal town located in Devbhumi Dwarka district of the Gujarat state in India located at coordinates 22° 27' 16.20" N - 069° 40' 30.01". DPA had commissioned the Off Shore Oil Terminal (OOT) facilities at Vadinar in the year 1978, for which M/s. Indian Oil Corporation Limited (IOCL) provided Single Bouy Mooring (SBM) system, with a capacity of 54 MMTPA. The OOT of the DPA contributes in a large way to the total earnings of this port. Vadinar is now notable due to the presence of two refineries-one promoted by Reliance Industries and Essar Oil Ltd.

DPA also handled 43.30 MMT at Vadinar (which includes transshipment), the containerized cargo crossed 4.50 lakh TEU, grossing a total of 100 MMT overall. Major commodities handled by the Deendayal Port are Crude Oil, Petroleum product, Coal, Salt, Edible Oil, Fertilizer, etc.

- **Climatic conditions of Vadinar**

Vadinar has a hot semi-arid climate. The summer season lasts from March-to-May and is extremely hot, humid, but dry. The climatic conditions in Vadinar are quite similar to that recorded in its district head quarter i.e., Jamnagar. The annual mean temperature is 26.7 °C. Rainy season with extremely erratic monsoonal rainfall that averages around 630 millimetres. The winter season is from October-to-February remains hot during the day but has negligible rainfall, low humidity and cool nights.

The Kandla and Vadinar port have been depicted in the **Map 1** as follows:

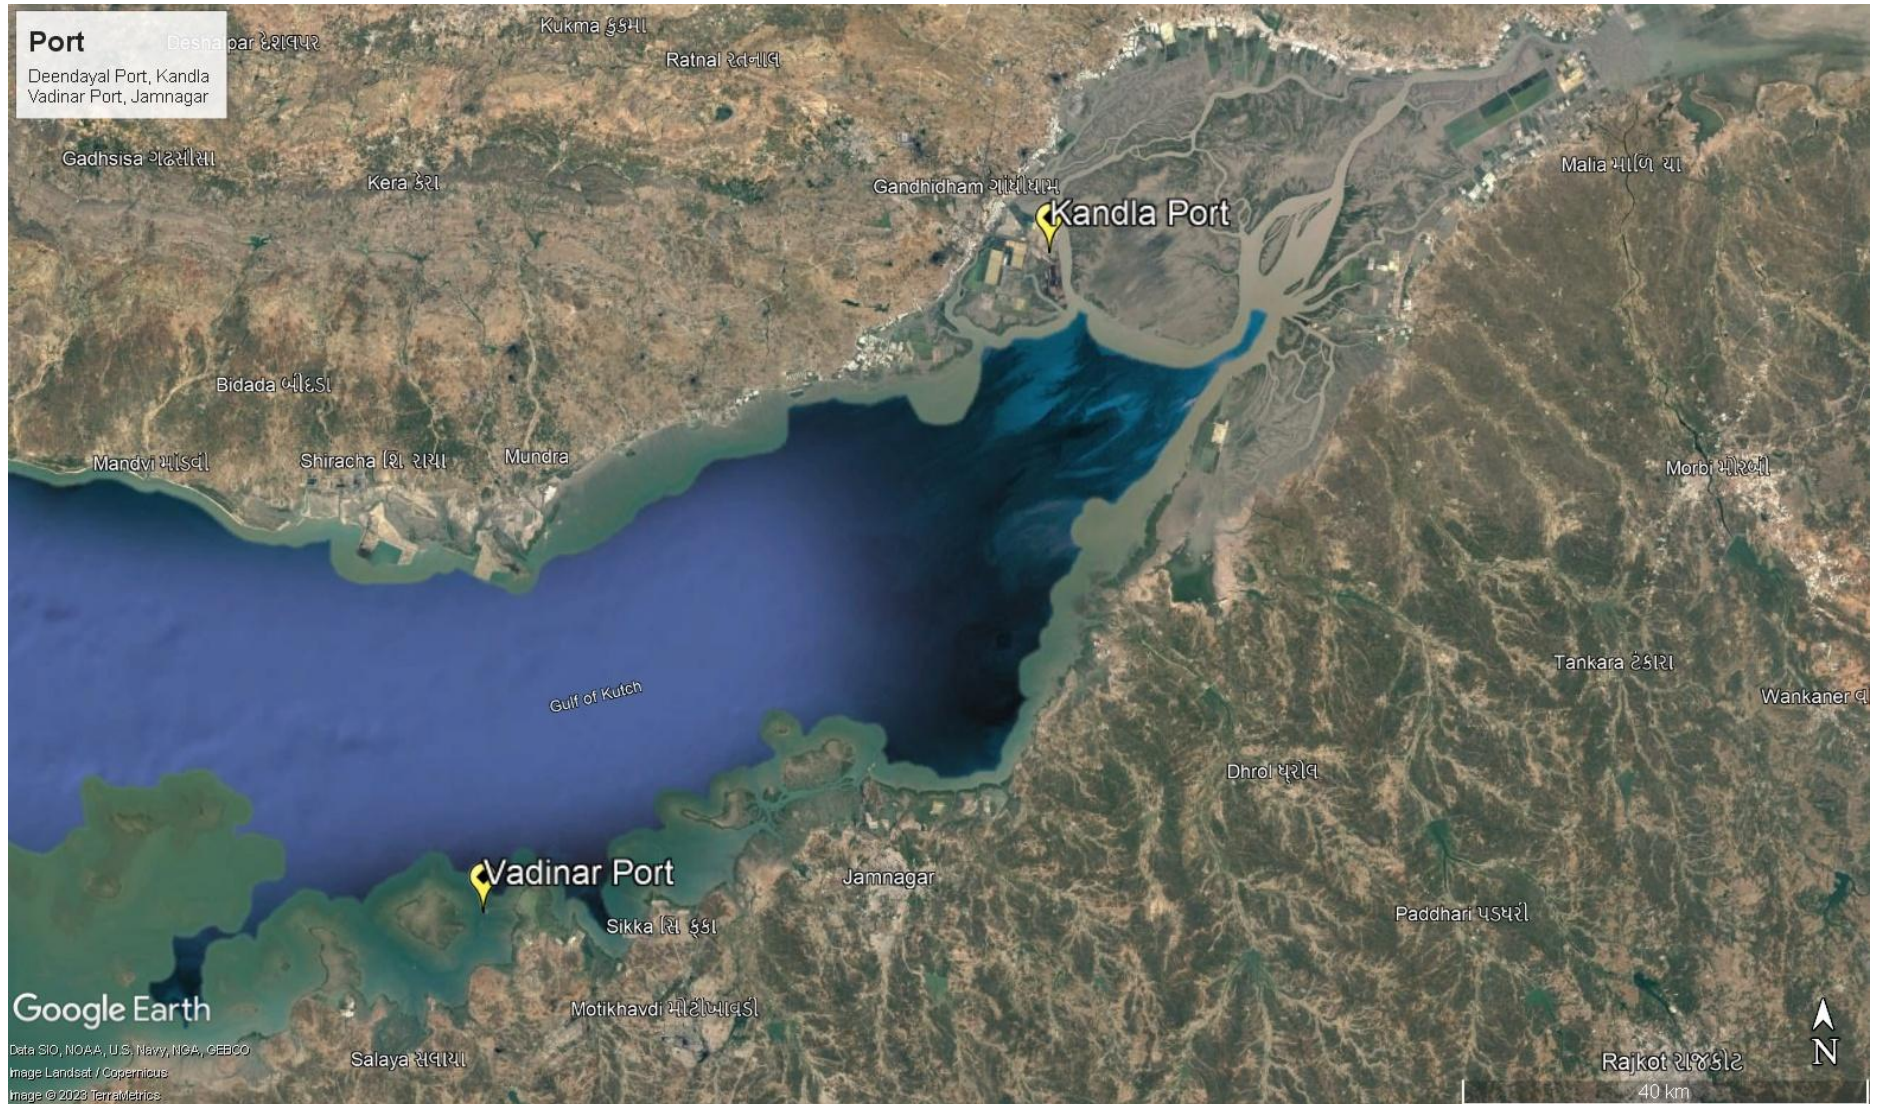

Map 1: Locations of Kandla and Vadinar Port



Map 2: Locations of Kandla Port



Map 3: Locations of Vadinar Port

2.2 Environmental Monitoring at Kandla and Vadinar

Regular monitoring of environmental parameters is of immense importance to assess the status of environment during project operation. With the knowledge of baseline conditions, the monitoring programme will serve as an indicator for identifying any deterioration in environmental conditions, thereby assist in recommending suitable mitigatory steps in time to safeguard the environment. Monitoring is as important as that of control of pollution since the efficiency of control measures can only be determined by a well-defined monitoring program. Environmental Monitoring is vital for monitoring the environmental status of the port for sustainable development. The list of main elements for which Environmental monitoring is to be carried out have been mentioned below:

- Meteorology
- Ambient Air
- DG Stack
- Noise
- Soil
- Drinking Water
- Sewage Treatment Plant
- Marine (Surface) water
- Marine Sediments
- Marine Ecology

GEMI has been entrusted by DPA to carry out the monitoring of the various aforementioned environmental aspects at the port, so as to verify effectiveness of prevailing Environment Management plan, if it confirms to the statutory and/or legal compliance; and identify any unexpected changes. Standard methods and procedures have been strictly adhered to in the course of this study. QA/QC procedures were strictly followed which covers all aspects of the study, and includes sample collection, handling, laboratory analyses, data coding, statistical analyses, interpretation and communication of results. The analysis was carried out in GEMI's NABL/MoEF accredited/recognized laboratory.

Methodology adopted for the study

Methodology is a strictly defined combination of practices, methods and processes to plan, develop and control a project along the continuous process of its implementation and successful completion. The aim of the project management methodology is to allow the control of whole process of management through effective decision-making and problem solving. The methodology adopted for the present study is shown in **Figure 1** as given below:

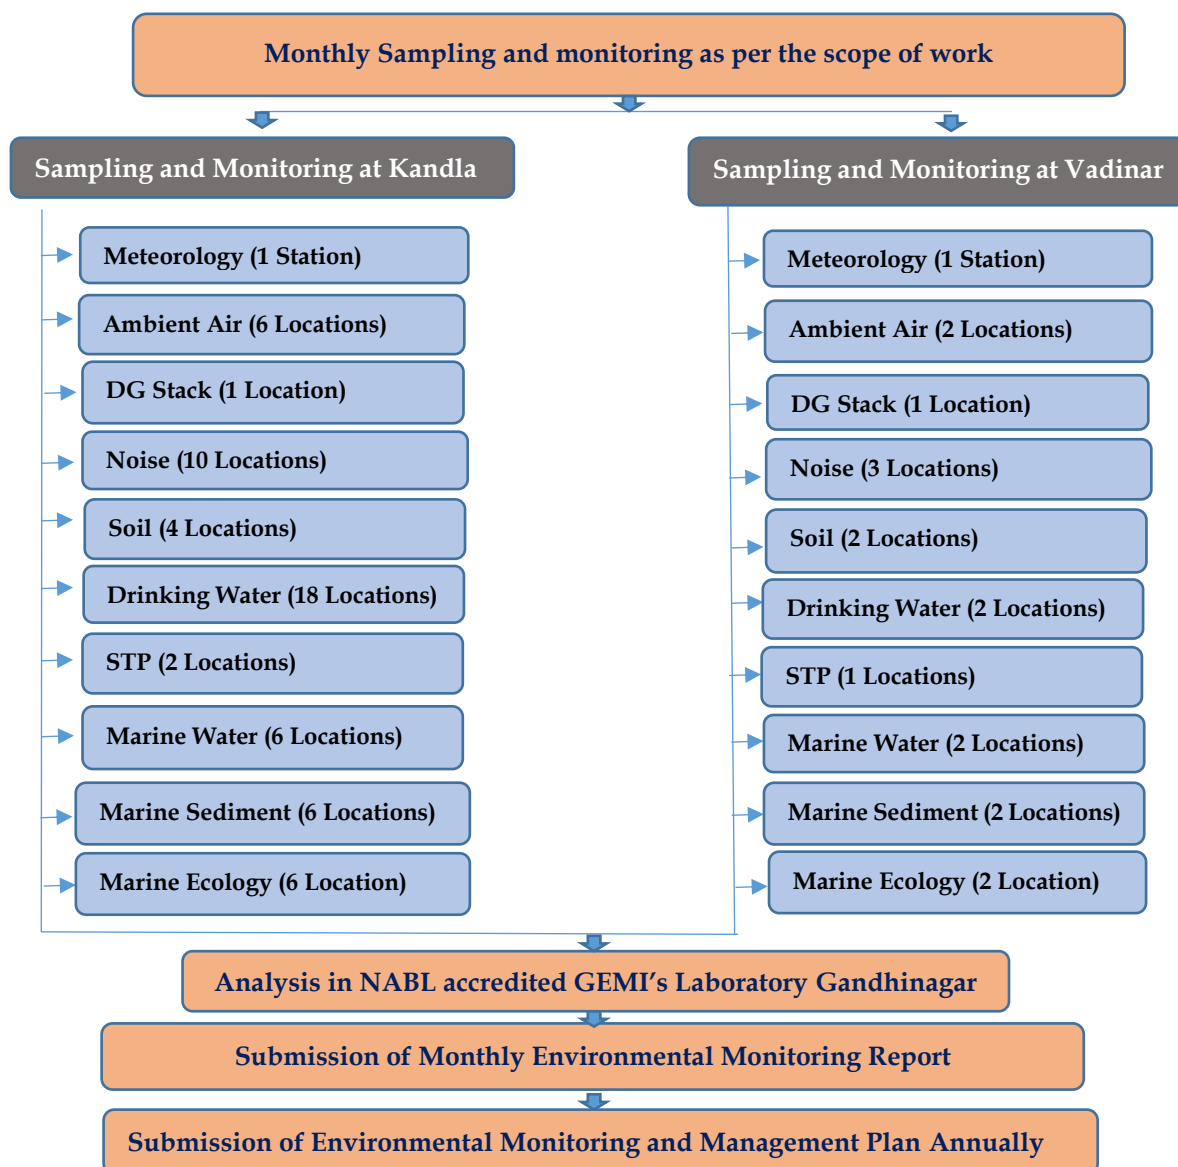


Figure 1: Methodology flow chart

The details of various sectors of Environment monitoring are described in subsequent chapters.

CHAPTER 3: METEOROLOGY MONITORING

3.1 Meteorology Monitoring

Meteorological conditions play a crucial role in dispersion of air pollutants as well as in environmental pollution studies particularly in pollutant transport irrespective of their entry into the environment. The wind speed and direction play a major role in dispersion of environment pollutants. In order to determine the prevailing micro-meteorological conditions at the project site an Automatic Weather Monitoring Stations (AWS) of Envirotech make (Model: WM280) were installed at both the sites of Kandla and Vadinar at 10 m above the ground. The details of the AWS installed have been mentioned in **Table 1** as follows:

Table 1: Details of Automatic Weather Station

Sr. No.	Site	Location Code	Location Name	Latitude Longitude
1.	Kandla	AWS-1	Environment Laboratory (DPA)	23.00996N 70.22175E
2.	Vadinar	AWS-2	Canteen Area	22.39994N 69.716608E

Methodology

During the study, a continuous automatic weather monitoring station was installed at both the sites to record climatological parameters such as Wind speed, Wind Direction, Relative Humidity, Solar Radiation, Rainfall and Temperature to establish general meteorological regime of the study area. The methodology adopted for monitoring meteorological data shall be as per the standard norms laid down by Bureau of Indian Standards (BIS) and the India Meteorological Department (IMD). The details of Automatic Weather Monitoring Station have been mentioned in **Table 2**.

Table 2: Automatic Weather Monitoring Station details

Sr. No.	Details of Meteorological Data	Unit of Measurement	Instrument	Frequency
1.	Wind Direction	degree	Automatic Weather Monitoring Station (Envirotech WM280)	Hourly Average
2.	Wind Speed	Km/hr		
3.	Rainfall	mm/hr		
4.	Relative Humidity	% RH		
5.	Temperature	°C		
6.	Solar Radiation	W/m ²		

The Meteorological parameters were recorded at an interval of 1 hour in a day and the average value for all the Meteorological parameters were summarized for the sampling period of at both the observatory site.

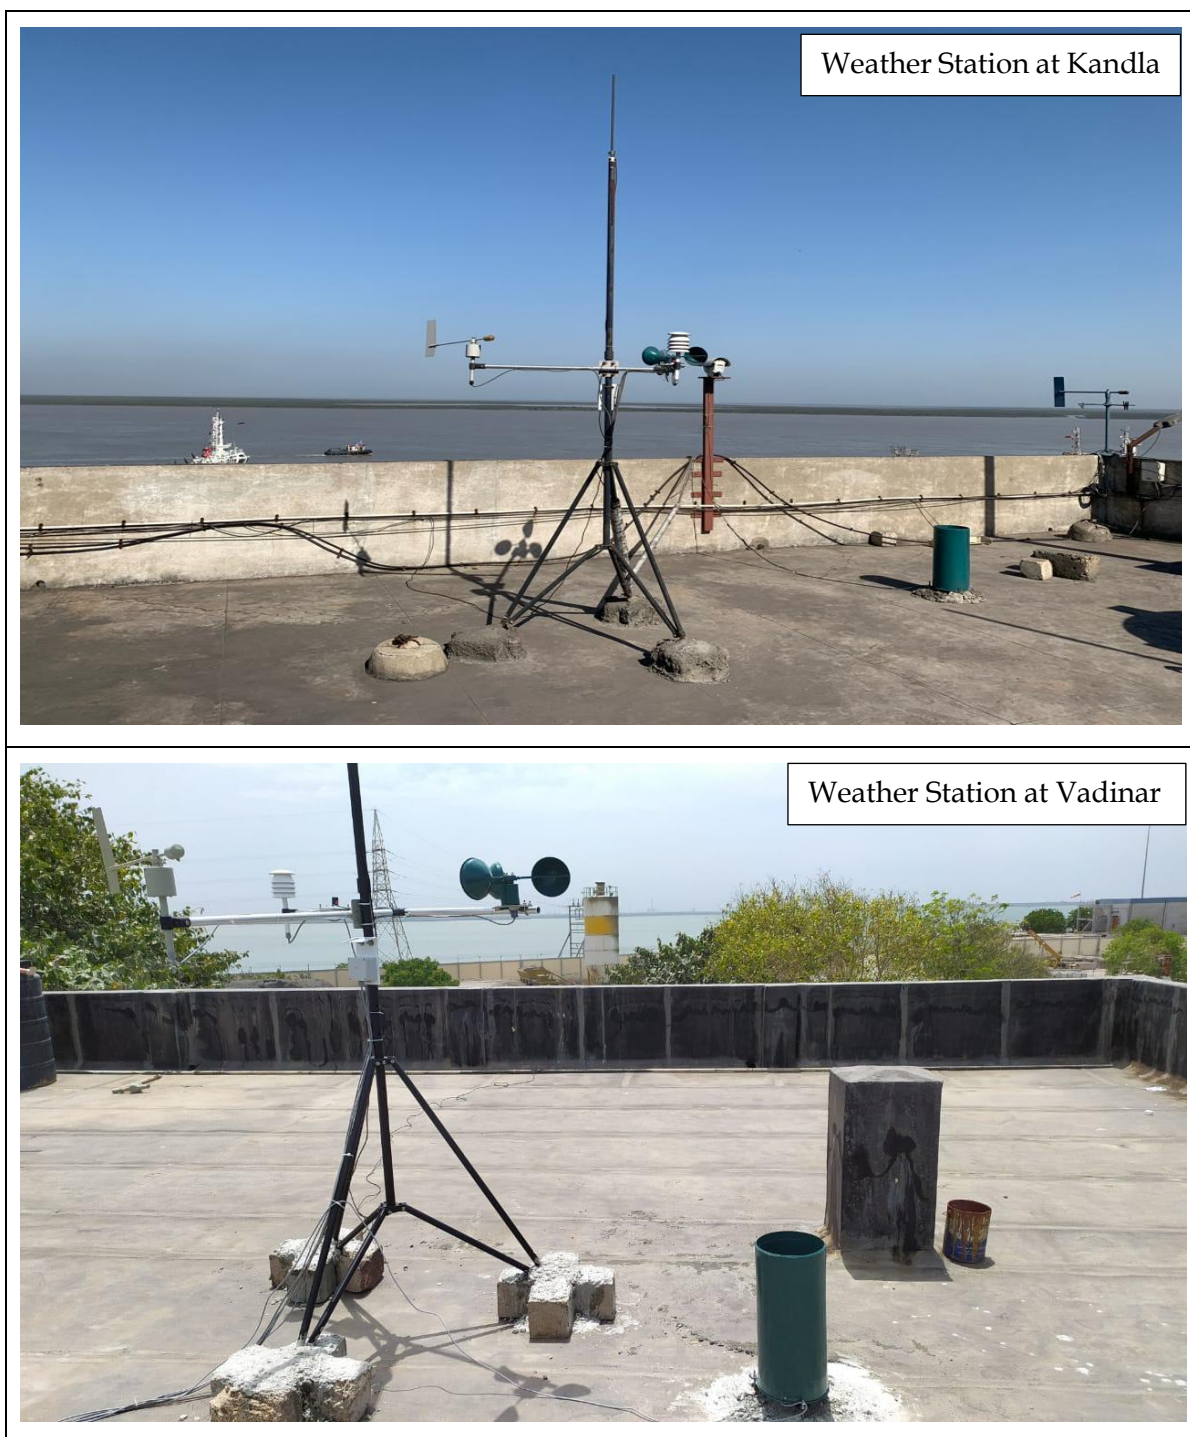


Figure 2: Photographs of Automatic Weather Monitoring Station at Kandla and Vadinar

3.2 Results and discussion

The summary of hourly climatological observations recorded at Kandla and Vadinar during the monitoring period, with respect to significant parameters has been mentioned in **Table 3** as follows:

Table 3: Meteorological data for Kandla and Vadinar

Details of Micro-meteorological data at Kandla Observatory												
Monitoring Period	Wind Speed (Km/h)			Temperature (°C)			Relative humidity (%)			Solar Radiation (W/m ²)	Wind Direction (°)	Rainfall (mm)
Stat.	Mean	Max.	Min	Mean	Max	Min	Mean	Max	Min			
December-January, 2024-2025	7.25	48	3.12	20.27	34.1	13.5	52.38	78	27.8	57.19	South	0
Details of Micro-meteorological data at Vadinar Observatory												
Monitoring Period	Wind Speed (Km/h)			Temperature (°C)			Relative humidity (%)			Solar Radiation (W/m ²)	Wind Direction (°)	Rainfall (mm)
Stat.	Mean	Max.	Min	Mean	Max	Min	Mean	Max.	Min			
December-January, 2024-2025	7.91	74.7	2.96	20.90	27.3	14.1	60.62	104.1	29.4	69.28	South-West	0

3.3 Data Interpretation and Conclusion

- **Temperature**

- a. **Kandla:** The ambient temperature for the monitoring period varies between the range of 13.5–34.1 °C for Kandla, with average temperature of 20.27°C.
- b. **Vadinar:** The ambient temperature for the monitoring period varies between the range of 14.1–27.3°C for Vadinar, with average temperature of 20.90°C.

- **Relative Humidity**

- a. **Kandla:** The Relative Humidity recorded between the range of 27.8–78, with average Humidity of 52.38%.
- b. **Vadinar:** During the study period, the Relative Humidity varies between 29.4–101.1%, with average Humidity of 60.62%.

- **Rainfall**

- a. **Kandla:** 0 rainfall was observed at Kandla.
- b. **Vadinar:** 0 rainfall was observed at Vadinar.

- **Wind Speed**

Wind speed and Direction play a significant role in transporting the pollutants and thus decides the air quality.

- a. **Kandla:** Wind speed recorded ranges between 3.12–48 Km/hr.
- b. **Vadinar:** During the monitoring period, the Wind speed recorded ranges between 2.96–74.7 Km/hr.


- **Solar Radiation:**

- a. **Kandla:** The average Solar Radiation for the monitoring period was recorded as 57.19 W/m².
- b. **Vadinar:** The average Solar Radiation was recorded as 69.28 W/m².

- **Wind rose diagram -**


The wind-rose diagram for the monitoring period has been drawn on the basis of hourly wind speed and direction data.

This Wind Rose Diagram reveals that at Kandla and Vadinar, during the monitoring period, the prevailing winds predominantly blow from the West South West direction at Kandla, whereas, high speed winds were also observed to blow from South direction. At Vadinar, the winds were observed to blow from South-West direction.

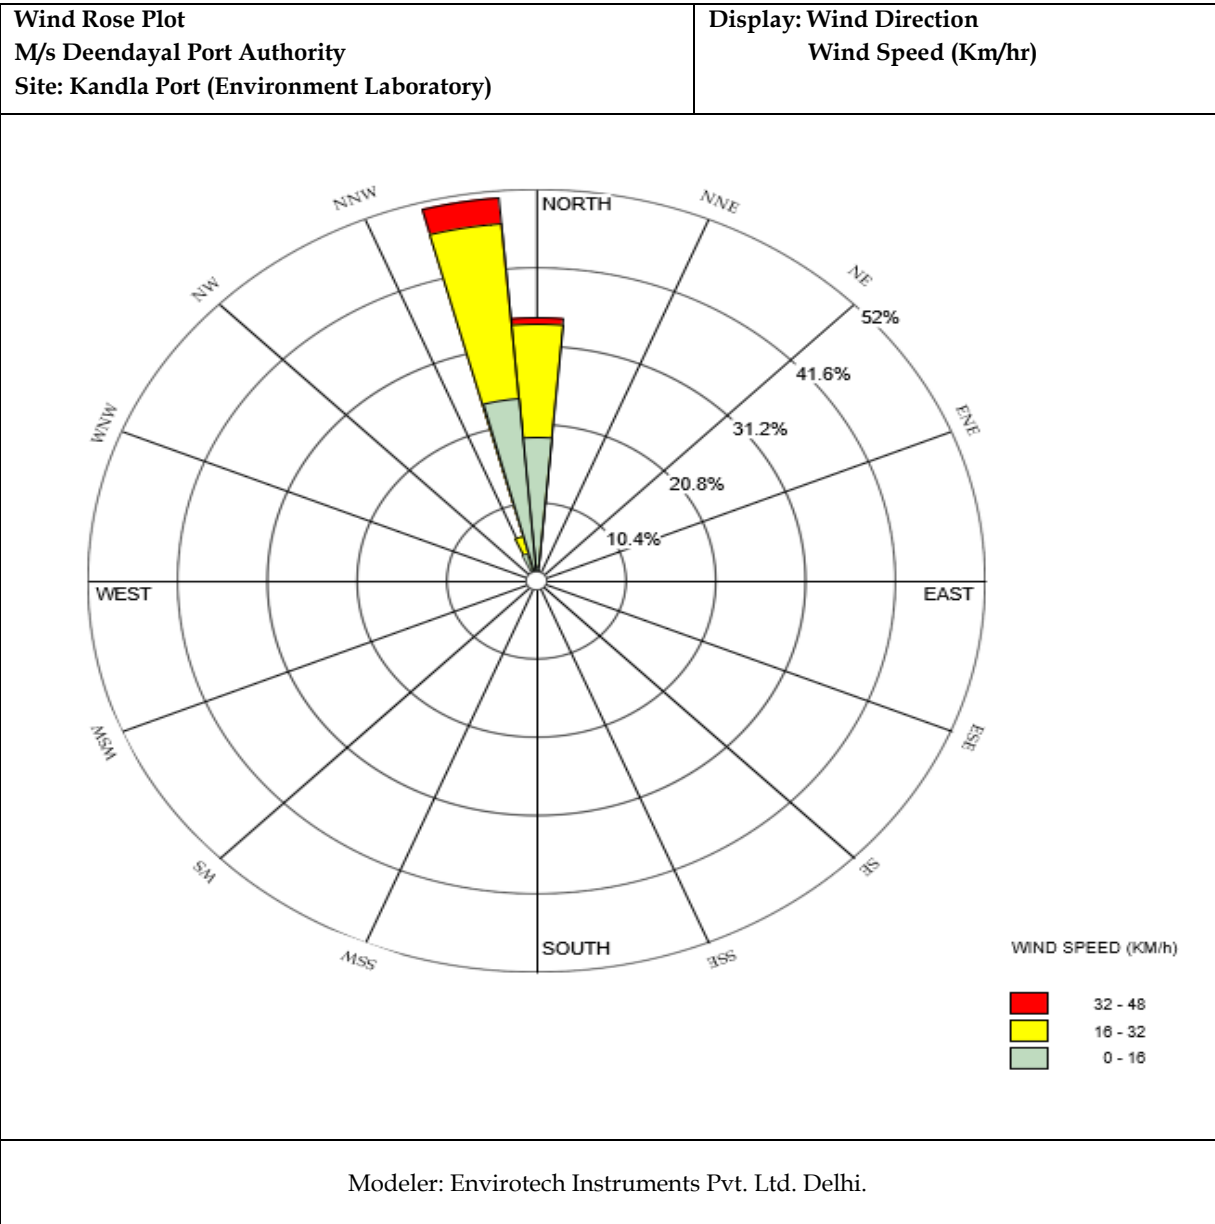

Wind Rose Plot
M/s Deendayal Port Authority
Site: Vadinar Port (Canteen Area)

Display: Wind Direction
Wind Speed (Km/hr)

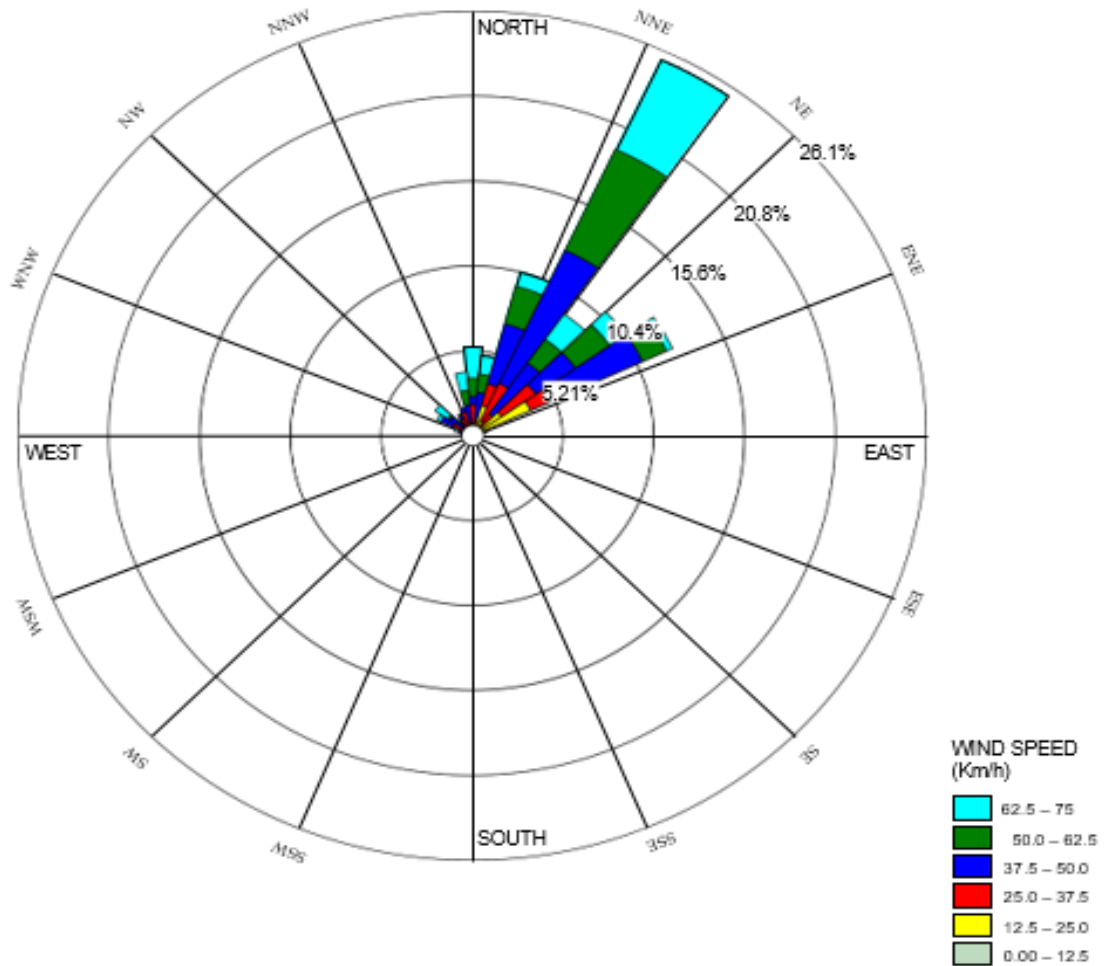

Modeler: Envirotech Instruments Pvt. Ltd. Delhi.

CHAPTER 4: AMBIENT AIR QUALITY MONITORING

4.1 Ambient Air Quality

It is necessary to monitor the ambient air quality of the study area, in order to determine the impact of the shipping activities and port operations on the ambient air quality. The prime objective of ambient air quality monitoring is to assess the present air quality and its conformity to National Ambient Air Quality Standards i.e. NAAQS, 2009. Ambient air quality has been monitored from 17th December 2024 to 16th January 2025.

Methodology

The study area represents the area occupied by DPA and its associated Port area. The sources of air pollution in the region are mainly vehicular traffic, fuel burning, loading & unloading of dry cargo, fugitive emissions from storage area and dust arising from unpaved village roads. Considering the below factors, under the study, as per the scope specified by DPA eight locations wherein, 6 stations at Kandla and 2 at Vadinar have been finalized within the study area

- Meteorological conditions;
- Topography of the study area;
- Direction of wind;
- Representation of the region for establishing current air quality status
- Representation with respect to likely impact areas.

The description of various air quality stations monitored at Kandla and Vadinar have been specified in **Table 4**.

Table 4: Details of Ambient Air monitoring locations

Sr. No.	Location Code	Location Name	Latitude Longitude	Significance	
1.	Kandla	A-1	Oil Jetty No. 1	23.029361N 70.22003E	Liquid containers and emission from ship
2.		A-2	Oil Jetty No. 7	23.043538N 70.218617E	
3.		A-3	Kandla Port Colony	23.019797N 70.213536E	Vehicular activity and dust emission
4.		A-4	Marine Bhavan	23.007653N 70.222197E	Construction and vehicular activity, road dust emission,
5.		A-5	Coal Storage Area	23.000190N 70.219757E	Coal Dust, Vehicular activity
6.		A-6	Gopalpuri Hospital	23.081506N 70.135258E	Residential area, dust emission, vehicular activity
7.	Vadinar	A-7	Admin Building	22.441806N 69.677056E	Vehicular activity
8.		A-8	Vadinar Colony	22.401939N 69.716306E	Residential Area, burning waste, vehicular activity

The monitoring locations at Kandla and Vadinar have been depicted in map in **Map 4 and 5** respectively.

Ambient Air monitoring photos

Kandla

A-1: Oil Jetty No. 1



A-2: Oil Jetty No. 7




A-3: Kandla Port Colony



A-4: Marine Bhavan



A-5: Coal Storage Area

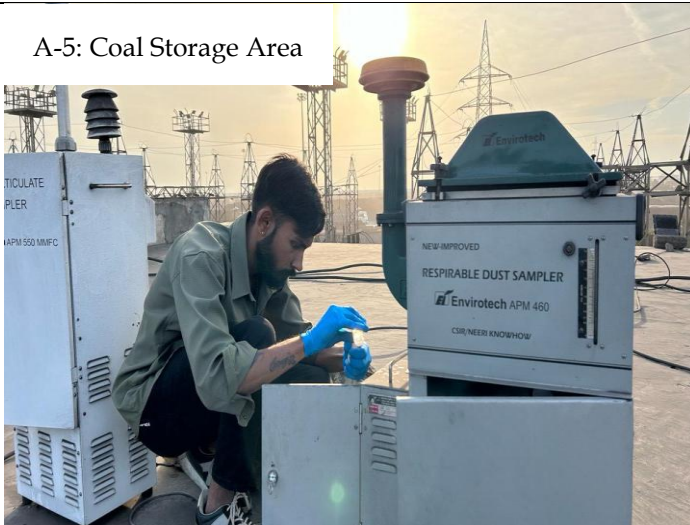


A-6: Gopalpuri Hospital




Vadinar

A-7: Admin Building

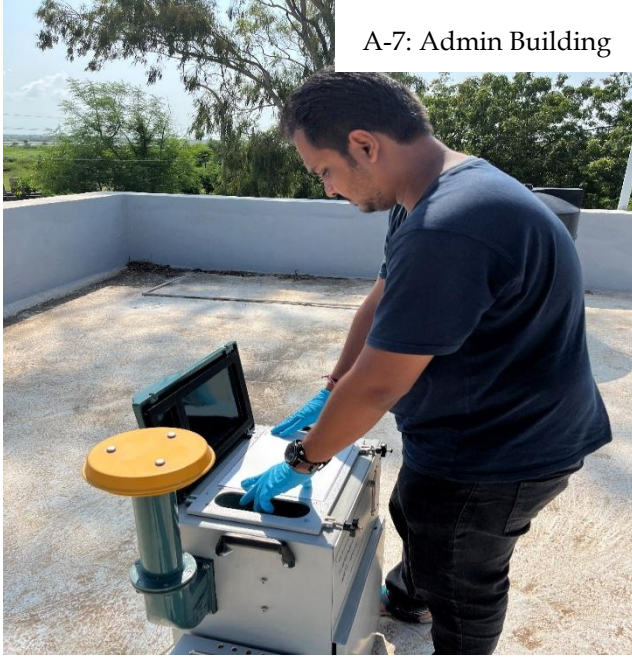


A-8: Vadinar Colony

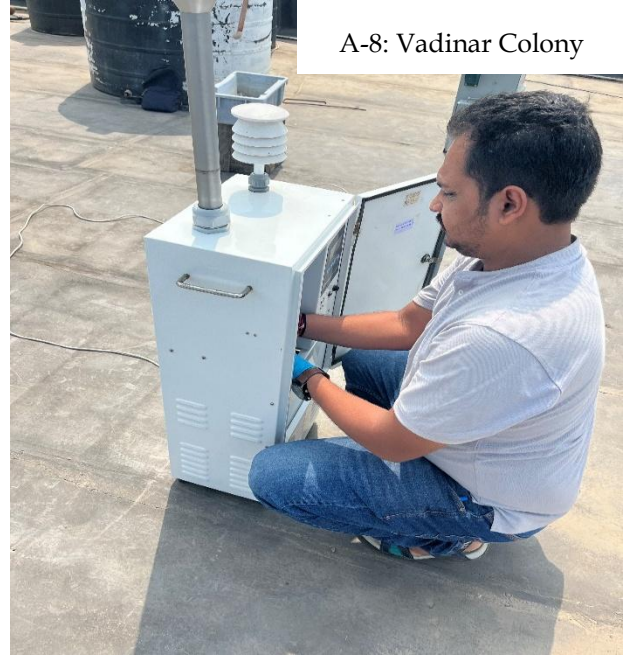



Map 4: Locations for Ambient Air Monitoring at Kandla

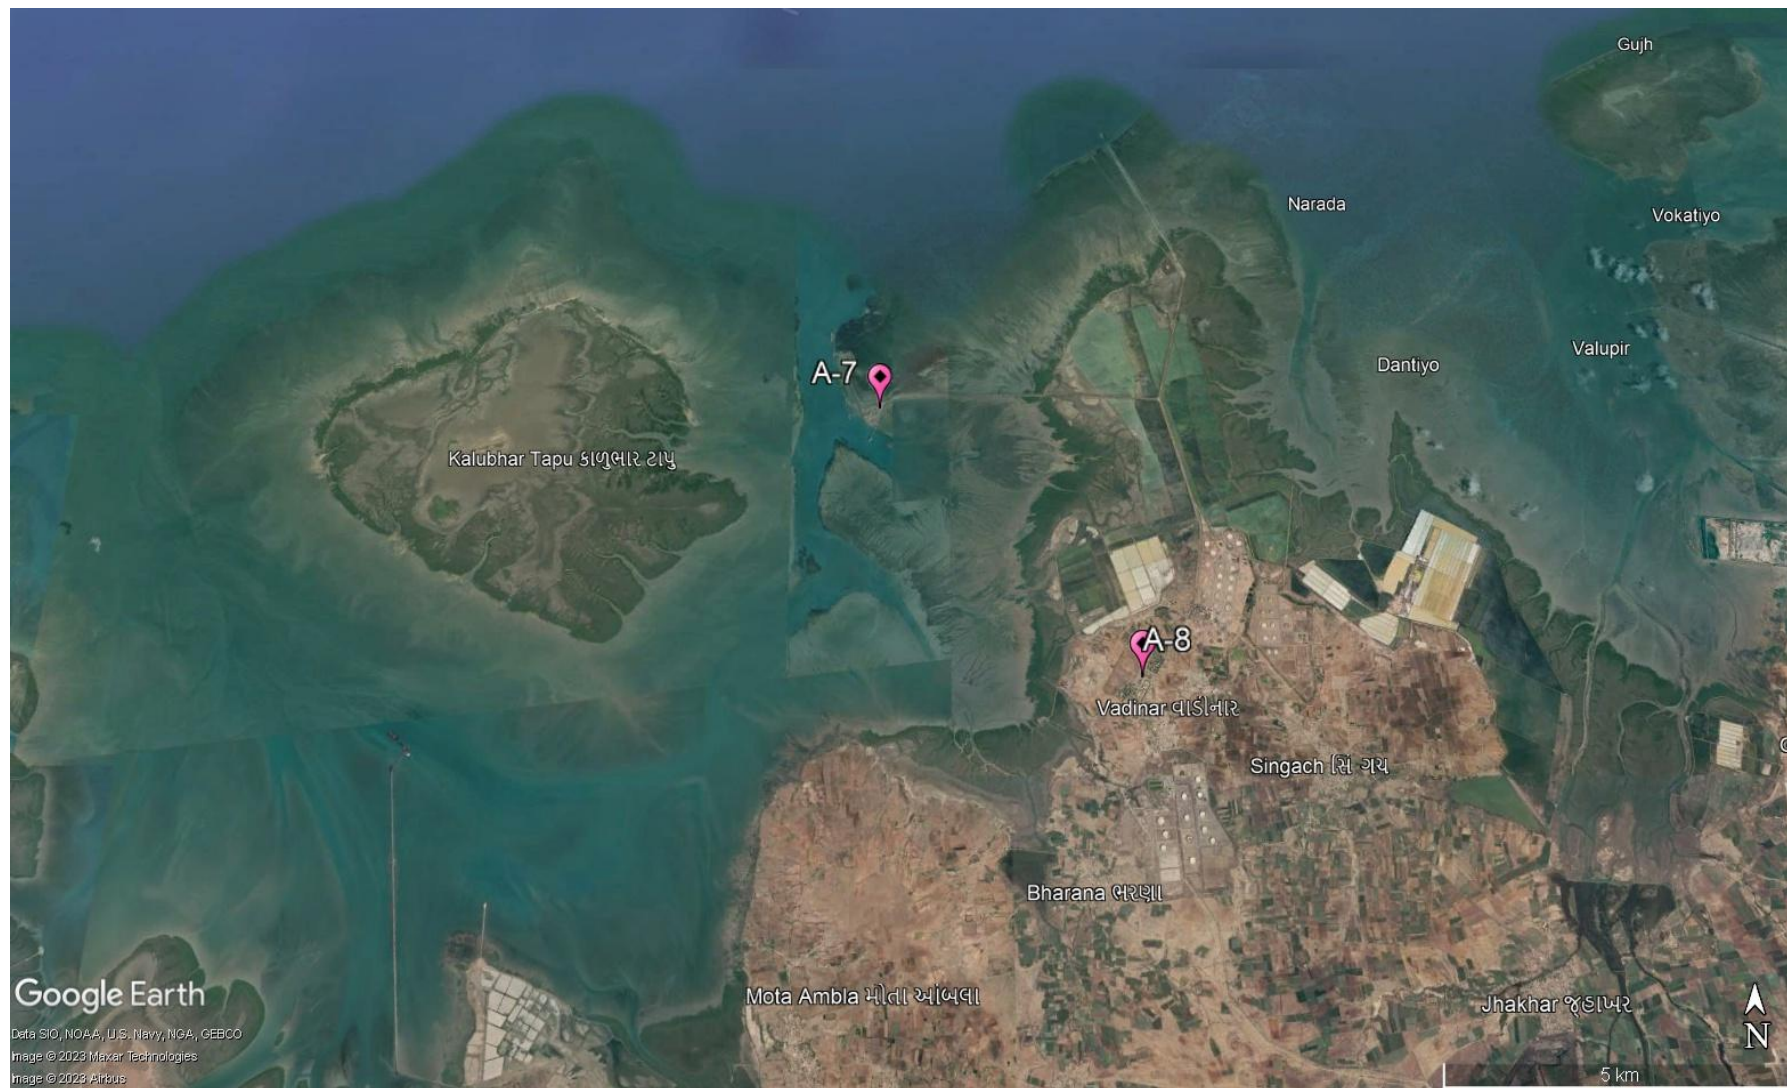

Map 5: Locations for Ambient Air Monitoring at Vadinar

Frequency

The sampling for Particulate matter i.e. PM₁₀ and PM_{2.5} and the gaseous components like SO_x, NO_x, CO as well as the Total VOCs were monitored twice in a week for a period of 24 hours a day. Whereas, the sampling for the components of PAH, Benzene and non-Methane VOCs was conducted on monthly basis.

Sampling and Analysis

The Sampling of the Ambient Air Quality parameters and analysis is conducted as per the CPCB guidelines of National Ambient Air Quality Monitoring. The sampling was performed at a height of 3.5 m (approximately) from the ground level. For the sampling of PM₁₀, calibrated 'Respirable Dust Samplers' were used, where Whatman GF/A microfiber filter paper of size 8" x 10" were utilized, where the Gaseous attachment of the make Envirotech instrument was attached with Respirable Dust Sampler for the measurement of SO_x and NO_x. The Fine Particulate Sampler for collection of PM_{2.5} was utilized for the particulate matter of size <2.5 microns. A known volume of ambient air is passed through the cyclone to the initially pre-processed filter paper. The centrifugal force in cyclone acts on particulate matter to separate them into two parts and collected as following:

- Particles <10 µ size (Respirable): GF/ A Filter Paper
- Particles <2.5 µ size (Respirable): Polytetrafluoroethylene (PTFE)

Sampling and analysis of ambient SO₂ was performed by adopting the 'Improved West and Gaeke Method'. The ambient air, drawn through the draft created by the RDS, is passed through an impinger, containing a known volume of absorbing solution of Sodium tetrachloromercurate, at a pre-determined measured flow rate of 1 liter/minute (L/min). Similarly, NO_x was performed by adopting the 'Jacob Hochheister Modified' (Na arsenite) method. The impinger contains known volume of absorbing solution of Sodium Arsenite and Sodium Hydroxide.

Data has been compiled for PM₁₀, PM_{2.5}, SO_x and NO_x samples of 24-hour carried out twice a week. In case of CO, one hourly sample were taken on selected monitoring days using the sensor-based CO Meter. For the parameters Benzene, Methane & Non-methane and Volatile Organic Carbons (VOCs), the Low Volume Sampler is used, where the charcoal tubes are used as sampling media. The sampling in the Low Volume Sampler (LVS) is carried out as per IS 5182 (Part 11): 2006 RA: 2017, where the ambient air flow rate is maintained at 200 cc/min, the volume of air that passes through the LVS during two hours monitoring is approx. 24 L.

The sampling of PAHs is carried out as per IS: 5182 (Part 12): 2004. Where, the EPM 2000 Filter papers are utilized in the Respirable Dust Sampler (RDS). For the parameters, Benzene, PAH & Non-methane VOC's, monthly monitoring is carried out. The details of the parameters with their frequency monitored are mentioned in **Table 5:**

Table 5: Parameters for Ambient Air Quality Monitoring

Sr. No.	Parameters	Units	Reference method	Instrument	Frequency
1.	PM ₁₀	µg/m ³	IS 5182 (Part 23): 2006	Respirable Dust Sampler (RDS) conforming to IS:5182 (Part-23): 2006	Twice in a week
2.	PM _{2.5}	µg/m ³	IS:5182 (Part:24):2019	Fine Particulate Sampler (FPS) conforming to IS:5182 (Part-24): 2019	
3.	Sulphur Dioxide (SO _x)	µg/m ³	IS 5182 (Part:2): 2001	Gaseous Attachment conforming to IS:5182 Part-2	
4.	Oxides of Nitrogen (NO _x)	µg/m ³	IS:5182 (Part-6): 2006	Gaseous Attachment conforming to IS:5182 Part-6	
5.	Carbon Monoxide (CO)	mg/m ³	GEMI/SOP/AAQM/11 ; Issue no 01, Date 17.01.2019: 2019	Sensor based Instrument	
6.	VOC	µg/m ³	IS 5182 (Part 17): 2004	Low Flow Air Sampler	
8.	PAH	µg/m ³	IS: 5182 (Part 12): 2004	Respirable Dust Sampler (RDS) conforming to IS:5182 (Part-12): 2004	Monthly
7.	Benzene	µg/m ³	IS 5182 (Part 11): 2006 RA: 2017	Low Flow Air Sampler	
9.	Non-methane VOC	µg/m ³	IS 5182 (Part 11): 2006	Low Volume Sampler	

4.2 Result and Discussion

The summarized results of ambient air quality monitoring for the study period are presented in Table-6 to 9 along with the graphical representation from Graph 1 to Graph 6. Various parameters monitored during the study have been presented by their maximum, minimum, average and Standard deviation.

Table 6: Summarized results of PM₁₀, PM_{2.5}, SO₂, NO_x, VOC and CO for Ambient Air quality monitoring

Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
A-1: Oil Jetty No.1, Kandla	16-12-2024	288.45	59.98	53.31	33.23	0.05	0.88
	18-12-2024	284.13	76.86	50.42	24.14	0.06	0.63
	23-12-2024	285.33	68.85	13.09	21.12	0.12	0.83
	26-12-2024	132.58	23.08	9.45	10.48	0.17	0.79
	30-12-2024	154.79	62.87	16.62	21.43	0.1	0.82




Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
	02-01-2025	260.09	80.83	20.07	27.43	0.12	0.81
	06-01-2025	210.54	60.52	13.86	18.97	0.2	0.82
	07-01-2025	221.02	56.07	14.78	23.16	0.21	0.81
	Minimum	132.58	23.08	9.45	10.48	0.05	0.63
	Maximum	288.45	80.83	53.31	33.23	0.21	0.88
	Average	229.62	61.13	23.95	22.50	0.13	0.80
	Std. Deviation	60.85	17.62	17.51	6.57	0.06	0.07
A-2: Oil Jetty No.7, Kandla	16-12-2024	157.04	47.49	14.12	18.32	0.16	0.84
	18-12-2024	190.54	74.27	12.34	12.52	0.20	0.88
	23-12-2024	208.91	80.64	28.18	20.47	0.19	0.89
	26-12-2024	158.75	23.69	8.56	14.75	0.14	0.81
	30-12-2024	221.71	60.32	14.96	11.16	0.07	0.84
	02-01-2025	141.48	67.90	17.16	13.84	0.13	0.84
	06-01-2025	187.49	51.67	16.66	32.53	0.11	0.85
	07-01-2025	186.94	44.70	13.05	7.47	0.09	0.88
	Minimum	141.48	23.69	8.56	7.47	0.07	0.81
	Maximum	221.71	80.64	28.18	32.53	0.20	0.89
	Average	181.61	56.34	15.63	16.38	0.14	0.85
	Std. Deviation	27.34	18.37	5.75	7.67	0.05	0.03
A-3: Kandla Port Colony, Kandla	16-12-2024	103.64	26.50	10.26	27.56	0.25	0.76
	18-12-2024	115.94	30.87	14.83	20.56	0.10	0.79
	23-12-2024	142.12	24.10	28.78	10.32	0.06	0.82
	26-12-2024	136.52	24.26	12.69	15.27	0.14	0.86
	30-12-2024	127.02	15.86	11.58	17.60	0.18	0.87
	02-01-2025	169.82	21.33	20.57	12.37	0.20	0.81
	06-01-2025	100.35	33.68	13.54	8.53	0.24	0.85
	07-01-2025	101.56	21.41	24.56	11.30	0.16	0.77
	Minimum	100.35	15.86	10.26	8.53	0.06	0.76
	Maximum	169.82	33.68	28.78	27.56	0.25	0.87
	Average	124.62	24.75	17.10	15.44	0.17	0.82
	Std. Deviation	24.30	5.64	6.75	6.31	0.07	0.04
A-4: Marine Bhavan, Kandla	16-12-2024	112.54	27.08	9.54	8.76	0.14	0.79
	18-12-2024	106.87	13.67	15.68	11.74	0.21	0.83
	23-12-2024	126.95	25.34	12.45	10.37	0.18	0.89
	26-12-2024	145.50	15.98	21.89	11.52	0.11	0.76
	30-12-2024	135.26	19.57	22.42	13.90	0.08	0.81
	02-01-2025	125.63	24.68	16.74	12.39	0.07	0.88
	06-01-2025	110.25	18.76	19.85	5.75	0.10	0.81
	07-01-2025	147.32	15.48	11.02	18.20	0.12	0.86
	Minimum	106.87	13.67	9.54	5.75	0.07	0.76
	Maximum	147.32	27.08	22.42	18.20	0.21	0.89
	Average	126.29	20.07	16.20	11.58	0.13	0.83
	Std. Deviation	15.66	5.06	4.93	3.65	0.05	0.05


Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
A-5: Coal Storage Area, Kandla	16-12-2024	159.63	36.38	26.58	8.84	0.29	0.93
	18-12-2024	125.48	29.31	14.67	9.78	0.07	0.98
	23-12-2024	169.84	40.28	13.52	30.62	0.23	1.02
	26-12-2024	415.26	22.13	19.64	11.40	0.16	0.97
	30-12-2024	425.68	51.64	20.15	28.51	0.17	0.88
	02-01-2025	348.61	27.88	12.06	19.77	0.19	0.92
	06-01-2025	228.78	24.65	8.4	24.39	0.13	0.96
	07-01-2025	157.62	34.58	26.87	13.28	0.10	0.99
	Minimum	125.48	22.13	8.40	8.84	0.07	0.88
	Maximum	425.68	51.64	26.87	30.62	0.29	1.02
	Average	253.86	33.36	17.74	18.32	0.17	0.96
	Std. Deviation	123.55	9.57	6.74	8.70	0.07	0.04
A-6: Gopalpuri Hospital, Kandla	16-12-2024	56.81	16.60	4.94	15.15	0.05	0.75
	18-12-2024	45.26	21.16	36.41	14.27	0.09	0.70
	23-12-2024	112.63	10.92	4.87	10.10	0.10	0.69
	26-12-2024	154.21	18.61	4.37	7.73	0.19	0.68
	30-12-2024	199.56	79.04	13.01	<6	0.13	0.64
	02-01-2025	183.59	73.01	21.16	27.47	0.17	0.61
	06-01-2025	104.11	66.03	13.01	6.42	0.07	0.62
	07-01-2025	76.55	67.61	13.51	27.9	0.17	0.6
	Minimum	45.26	10.92	4.37	6.42	0.05	0.60
	Maximum	199.56	79.04	36.41	27.90	0.19	0.75
	Average	116.59	44.12	13.91	15.58	0.12	0.66
	Std. Deviation	57.60	29.58	10.78	8.86	0.05	0.05
A-7: Admin Building, Vadinar	16-12-2024	60.52	24.61	12.03	6.12	0.08	0.70
	18-12-2024	92.96	54.94	11.45	<6	0.19	0.60
	23-12-2024	160.57	79.35	11.37	17.11	0.15	0.62
	26-12-2024	169.87	82.15	12.66	6.65	0.16	0.62
	30-12-2024	86.86	46.73	12.67	<6	0.14	0.63
	02-01-2025	82.64	69.48	45.56	12.19	0.17	0.62
	06-01-2025	91.27	29.82	14.91	<6	0.16	0.56
	07-01-2025	125.49	84.19	26.28	7.01	0.13	0.72
	Minimum	60.52	24.61	11.37	6.12	0.08	0.56
	Maximum	169.87	84.19	45.56	17.11	0.19	0.72
	Average	108.77	58.91	18.37	9.82	0.15	0.63
	Std. Deviation	39.18	23.59	12.05	4.75	0.03	0.05
A-8: Vadinar Colony, Vadinar	16-12-2024	87.32	36.57	11.71	<6	0.20	0.65
	18-12-2024	120.29	65.04	10.78	<6	0.14	0.55
	23-12-2024	149.90	81.26	10.73	<6	0.20	0.55
	26-12-2024	171.58	76.15	12.81	6.02	0.15	0.58
	30-12-2024	116.51	60.18	12.99	<6	0.18	0.55
	02-01-2025	109.79	91.70	40.11	12.07	0.13	0.56

Station Code & Name	Unit of Average Concentration	Average Pollutant Concentration					
	Pollutants	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	SO ₂ (µg/m ³)	NO _x (µg/m ³)	VOC (µg/m ³)	CO (mg/m ³)
	Duration	(24 hr)				(2 hr)	(1 hr)
	NAAQS by CPCB Monitoring days	100	60	80	80	-	2
	06-01-2025	111.08	36.25	11.96	7.14	0.17	0.63
	07-01-2025	112.69	85.93	18.23	9.60	0.08	0.65
	Minimum	87.32	36.25	10.73	6.02	0.08	0.55
	Maximum	171.58	91.70	40.11	12.07	0.20	0.65
	Average	122.40	66.64	16.17	8.71	0.16	0.59
	Std. Deviation	26.26	21.30	9.96	2.69	0.04	0.05


Graphs 1-6 shows spatial trend of ambient air parameter at all the eight-monitoring location (six at Kandla and 2 at Vadinar)

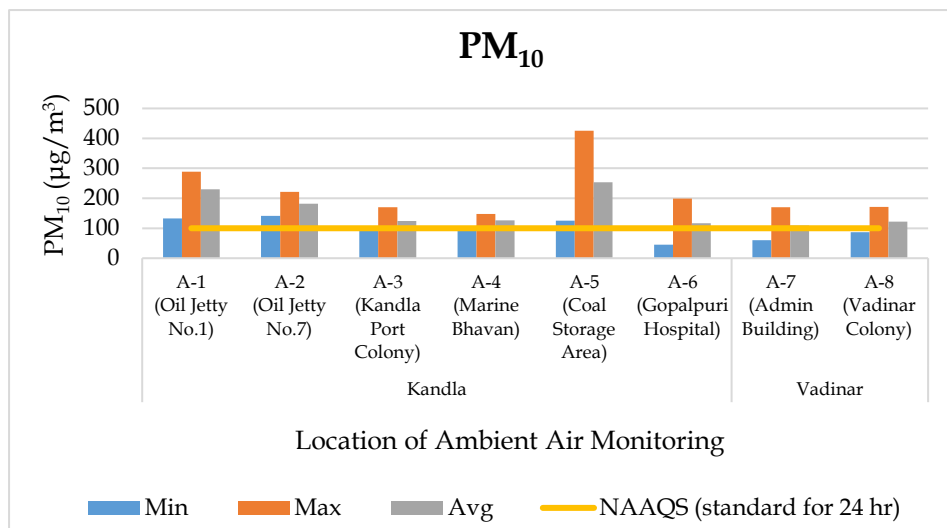


Graph 1: Spatial trend in Ambient PM₁₀ Concentration

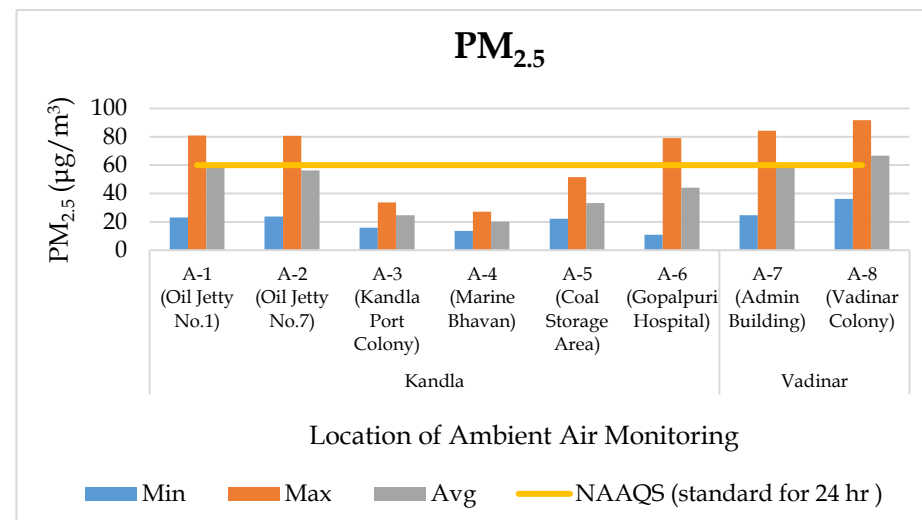


Graph 2: Spatial trend in Ambient PM_{2.5} Concentration

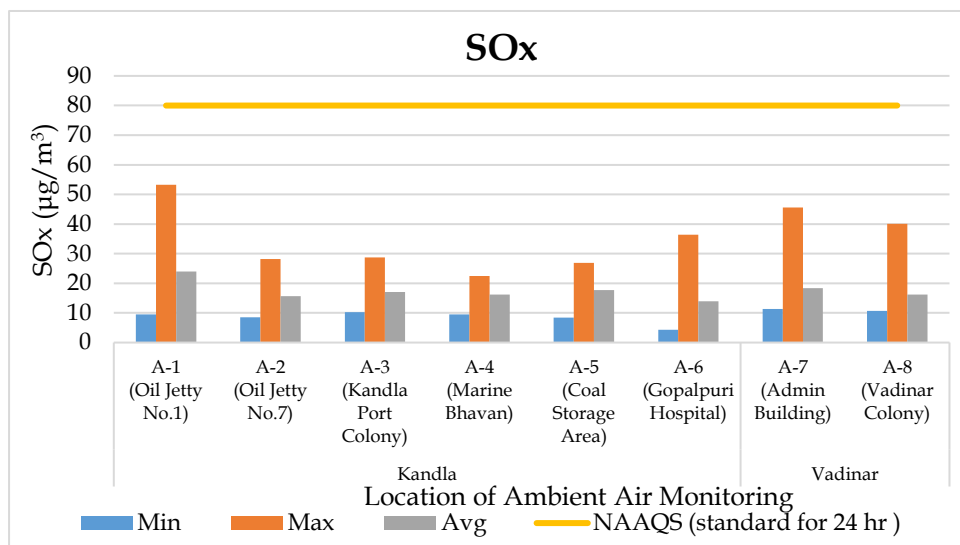


Graph 3: Spatial Trend in Ambient SO_x Concentration

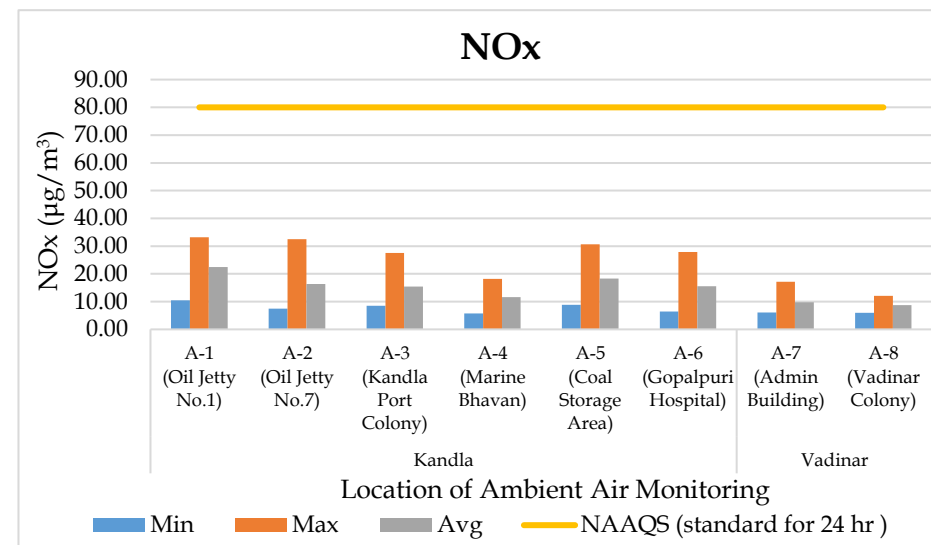

Graph 4: Spatial trend in Ambient Nox Concentration

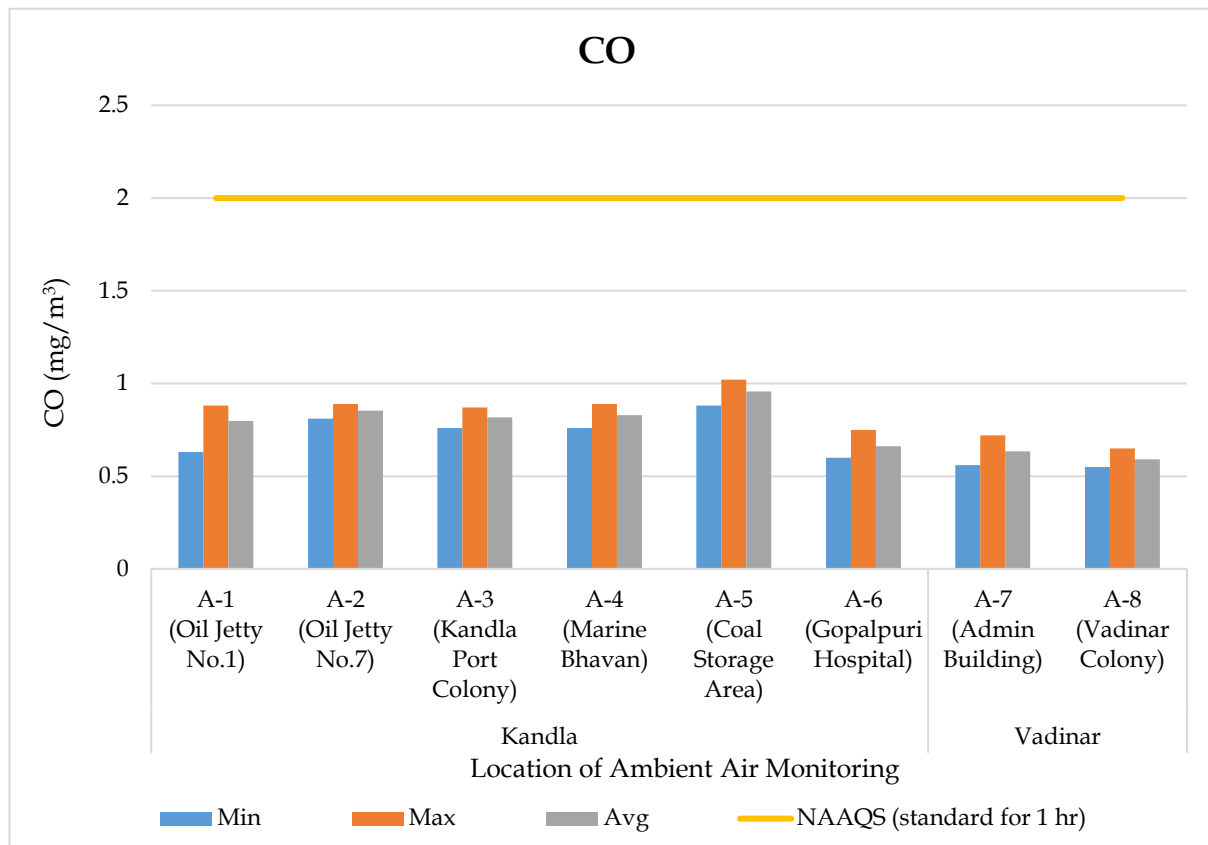

Graph 5: Spatial trend in Ambient CO Concentration

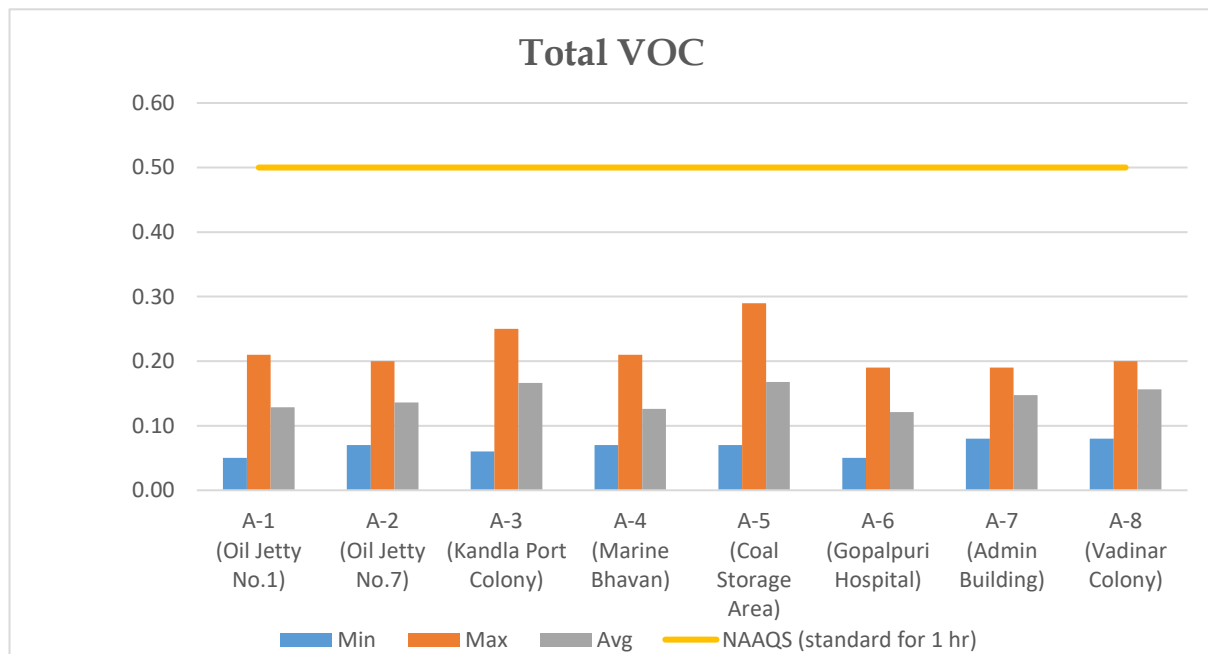

Graph 6: Spatial trend in Ambient Total VOCs

Table 7: Summarized results of Benzene for Ambient Air quality monitoring

Benzene ($\mu\text{g}/\text{m}^3$)									
Sr. No	Kandla						Vadinar		NAAQS standards (24 hr)
	A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8	
1	0.05	0.02	0.04	0.01	0.08	0	0	0	5 $\mu\text{g}/\text{m}^3$

Table 8: Summarized results of Polycyclic Aromatic Hydrocarbons

Sr. No.	Components	Kandla						Vadinar	
		A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8
1	Napthalene	1.10	1.52	0.02	1.53	1.2	0.01	0.46	0.41
2	Acenaphthylene	0.59	0.72	0.07	0.87	0.31	0.01	0.00	0.00
3	Acenaphthene	0.58	0.61	0.18	0.19	0.26	0.14	0.00	0.00
4	Fluorene	0.05	0.45	0.01	0.54	0.62	0.58	0.00	0.01
5	Anthracene	0.11	0.05	0.01	0.21	0.23	0.01	0.02	0.02
6	Phenanthrene	0.05	0.02	0.03	0.01	0.00	0.10	0.00	0.00
7	Fluoranthene	0.02	0.41	0.05	0.25	0.02	0.36	0.00	0.01
8	Pyrene	0.16	0.59	0.42	0.29	0.48	0.06	0.00	0.00
9	Chrycene	1.22	0.98	0.25	0.40	0.02	1.20	0.00	0.00
10	Banz(a)anthracene	0.22	0.26	0.36	0.27	0.02	0.15	0.00	0.00
11	Benzo[k]fluoranthene	3.7	0.20	2.6	0.2	1.02	1.68	0.00	0.04
12	Benzo[b]fluoranthene	0.02	0.06	0.02	0.02	0.05	0.03	0.00	0.02
13	Benzopyrene	1.74	0.93	3.56	0.01	0.63	0.05	0.00	0.00
14	Indeno [1,2,3-cd] fluoranthene	0.52	0.75	0.71	0.55	0.98	1.49	0.00	0.11
15	Dibenz(ah)anthracene	0.00	0.01	0.25	0.00	0.18	0.05	0.00	0.00
16	Benzo[ghi]perylene	1.3	8.9	28.1	13.2	9.3	12.8	0.00	0.00

Table 9: Summarized results of Non-methane VOC

Sr No	Kandla						Vadinar	
	A-1	A-2	A-3	A-4	A-5	A-6	A-7	A-8
1	0.92	0.96	1.13	1.26	1.56	1.10	1.45	1.12

4.3 Data Interpretation and Conclusion

The results were compared with the National Ambient Air Quality Standards (NAAQS), 2009 of Central Pollution Control Board (CPCB).

- The concentration of PM_{10} at Kandla varies in the range of **45.26 to 425.68 $\mu\text{g}/\text{m}^3$** with an average value of **172.10 $\mu\text{g}/\text{m}^3$** . PM_{10} exceeded NAAQS of all the monitoring locations in Kandla. Whereas, at Vadinar, the concentration varies from **60.52 to 171.58 $\mu\text{g}/\text{m}^3$** , with an average value of **115.68 $\mu\text{g}/\text{m}^3$** , and complies with the stipulated norm (100 $\mu\text{g}/\text{m}^3$).

- The elevated PM_{10} concentration at location A-5, the Coal Storage Area, can be attributed to several factors. Heavy vehicular traffic in upwind areas significantly contributes to the dispersion of particulate matter into the ambient air. The process of unloading coal directly onto trucks using grabs leads to the emission of coal dust into the air and its subsequent settling on the ground. This settled dust is re-entrained into the atmosphere as trucks travel through the area. Additionally, coal-loaded trucks are often not adequately covered with tarpaulin sheets, which exacerbates the suspension of coal particles during transit from vessels to the storage yard or site. These factors collectively contribute to increased PM_{10} levels in and around the Coal Storage Area and Marine.
- The $PM_{2.5}$ concentrations at Kandla varies from **10.92 to 80.83 $\mu\text{g}/\text{m}^3$** with average **39.96 $\mu\text{g}/\text{m}^3$** . The $PM_{2.5}$ concentration falls within the NAAQS limit for all locations of Kandla. Whereas, at Vadinar its concentration varies from **24.61 to 91.70 $\mu\text{g}/\text{m}^3$** with average **62.77 $\mu\text{g}/\text{m}^3$** . During winter, the concentrations of particulate matter (PM_{10} & $PM_{2.5}$) are seen to increase. Also due to construction and demolition all around the port contributing in increased particulate matter levels.
- The concentration of SO_x varies from **4.37 to 53.31 $\mu\text{g}/\text{m}^3$** with average concentration as **17.42 $\mu\text{g}/\text{m}^3$** at Kandla and **10.73 to 45.56 $\mu\text{g}/\text{m}^3$** with average as **17.27 $\mu\text{g}/\text{m}^3$** at Vadinar. The average concentration of SO_x complies with the prescribed limit of NAAQS (80 $\mu\text{g}/\text{m}^3$) for both the monitoring site.
- The concentration of NO_x varies from **5.75 to 33.23 $\mu\text{g}/\text{m}^3$** with average **16.63 $\mu\text{g}/\text{m}^3$** at Kandla and **6.02 to 17.11 $\mu\text{g}/\text{m}^3$** with average **9.26 $\mu\text{g}/\text{m}^3$** at Vadinar. The concentration of NO_x falls within the prescribed limit of NAAQS i.e. 80 $\mu\text{g}/\text{m}^3$ at both the monitoring site of Kandla and Vadinar.
- The concentration of CO varies from **0.60 to 1.02 $\mu\text{g}/\text{m}^3$** with average **0.82 $\mu\text{g}/\text{m}^3$** at Kandla and **0.55 to 0.72 $\mu\text{g}/\text{m}^3$** with average **0.61 $\mu\text{g}/\text{m}^3$** at Vadinar. The concentration falls within the norm of 2 mg/ m^3 specified by NAAQS at both the monitoring sites
- The concentration of **Total VOCs** levels was recorded in range of **0.05 to 0.29 $\mu\text{g}/\text{m}^3$** at Kandla and **in range of 0.08 to 0.20 $\mu\text{g}/\text{m}^3$** at the location of Vadinar respectively. The main source of VOCs in the ambient air may be attributed to the burning of Gasoline and Natural gas in Vehicle exhaust and burning fossil fuels, and garbage that release VOCs into the atmosphere. During the monitoring period, the wind flows towards South direction at Kandla, and hence the wind direction and speed also contribute to increased dispersion of pollutants from the upward areas towards the downward areas.
- **Benzene** was detected on the location of Kandla in the range of **0 to 0.08 ($\mu\text{g}/\text{m}^3$)** whereas not detected on the location of Vadinar.
- **Polycyclic Aromatic Hydrocarbons (PAHs)** are ubiquitous pollutants in urban atmospheres. Anthropogenic sources of total PAHs in ambient air emissions are greater than those that come from natural events. These locations are commercial areas where Vehicular activity and dust emission is common. PAHs are a class of chemicals that occur naturally in coal, crude oil, and gasoline. The higher

concentration which results from burning coal, oil, gas, road dust, etc. Other outdoor sources of PAHs may be the industrial plants in-and-around the DPA premises.

- The Ambient air Monitoring location of Kandla recorded the **Non-methane VOC** (NM-VOC) concentration in the range of **0.92 to 1.56 $\mu\text{g}/\text{m}^3$** . While at Vadinar, the concentration of NM-VOC falls is found to be **1.12 to 1.45 mg/m^3** at both the location.

With reference to the Ambient Air Quality monitoring conducted under the study, it may be concluded that the particulate matter PM_{10} , were reported in higher concentration and apparently exceeds the NAAQS particularly at locations of Kandla., whereas $\text{PM}_{2.5}$ complies with the NAAQS at majority of the locations. For both the ambient air monitoring parameters (PM_{10} and $\text{PM}_{2.5}$), the major exceedance was observed at location A-5 i.e. Coal Storage Area. The gaseous pollutants (NO_x , SO_x , CO, VOCs etc.) falls within the permissible limit. The probable reasons contributing to these emissions of pollutants into the atmosphere in-and-around the port area are summarized as follows: -

1. **Port Machinery:** Port activities involve the use of various machinery and equipment, including cranes, for lifts, tugboats, and cargo handling equipment. These machines often rely on diesel engines, which can emit pollutants such as NO_x , Particulate matter, and CO. Older or poorly maintained equipment tends to generate higher emissions.
2. **Port Vehicles:** Trucks and other vehicles operating within port and port area contributes to air pollution. Similar to port machinery, diesel-powered vehicles can emit NO_x , PM, CO, and other pollutants such as PAH, VOCs etc. Vehicle traffic and congestion in and around port areas can exacerbate the air quality issues.
3. Apart from that, construction and demolition activities majorly contribute to particulate matter pollution.

4.4 Remedial Measures:

To improve air quality, DPA has implemented a number of precautionary measures, such as maintaining Green zone, initiated Inter-Terminal Transfer of tractor-trailers, Centralized Parking Plaza, providing shore power supply to tugs and port crafts, the use of LED lights at DPA area helps in lower energy consumption and decreases the carbon foot prints in the environment, time to time cleaning of paved and unpaved roads, use of tarpaulin sheets to cover dumpers at project sites etc. are helping to achieve the cleaner and green future at port. To address air pollution from port shipping activities, various measures that can be implemented are as follows:

- Practice should be initiated for using mask as preventative measure, to avoid Inhalation of dust particle-Mask advised in sensitive areas. Covering vehicles with tarpaulin during transportation will help to reduce the suspension of pollutants in air.
- Frequent water sprinkling on roads to reduce dust suspension due to vehicular movement, this can be use during transporting coal to avoid suspension of coal dust.
- Use of proper transport methods, such as a conveyor belt, for excavated material and screens around the construction site.
- Temporary pavement of roads in construction site could considerably reduce dust emission. Prohibition of use of heavy diesel oil as fuel could be possibly reduce

pollutants. Encouraging use of low-sulfur fuels (viz. Marine Gas Oil (MGO)/Liquefied Natural Gas (LNG), can significantly reduce sulfur and PM emissions from ships.

- Investing in infrastructure for cold ironing allows ships to connect to the electrical grid while docked, reducing the need for auxiliary engines and associated emissions.
- Implementing efficient cargo-handling processes, optimizing logistics to reduce congestion and idling times, and encouraging use of cleaner port machinery and vehicles can all contribute to reducing air pollution in port areas.



CHAPTER 5: DG STACK MONITORING

5.1 DG Stack Monitoring


A diesel generator is a mechanical-electrical machine that produces electrical energy (electricity) from diesel fuel. They are used by the residential, commercial, charitable and governmental sectors to provide power in the event of interruption to the main power, or as the main power source. Diesel generating (DG) sets are generally used in places without connection to a power grid, or as an emergency power supply if the grid fails. These DG sets utilize diesel as fuel and generate and emit the air pollutants such as Suspended Particulate Matter, SO₂, NO_x, CO, etc. from the stack during its functioning. The purpose of stack sampling is to determine emission levels from plant processes to ensure they are in compliance with any emission limits set by regulatory authorities to prevent macro environmental pollution. The stack is nothing but chimney which is used to disperse the hot air at a great height, emissions & particulate matters that are emitted. Hence, monitoring of these stacks attached to DG Sets is necessary in order to quantify the emissions generated from it.

As defined in scope by DPA, the monitoring of DG Stack shall be carried out at two locations, one at Kandla and one at Vadinar. The details of the DG Sets at Kandla and Vadinar have been mentioned in **Table 10** as follows:

Table 10: Details of DG Stack monitoring locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	DG-1	Kandla	22.98916N 70.22083E
2.	DG-2	Vadinar	22.44155N 69.67419E

The map depicting the locations of DG Stack Monitoring to be monitored in Kandla and Vadinar have been mentioned in **Map 6 and 7** as follows:

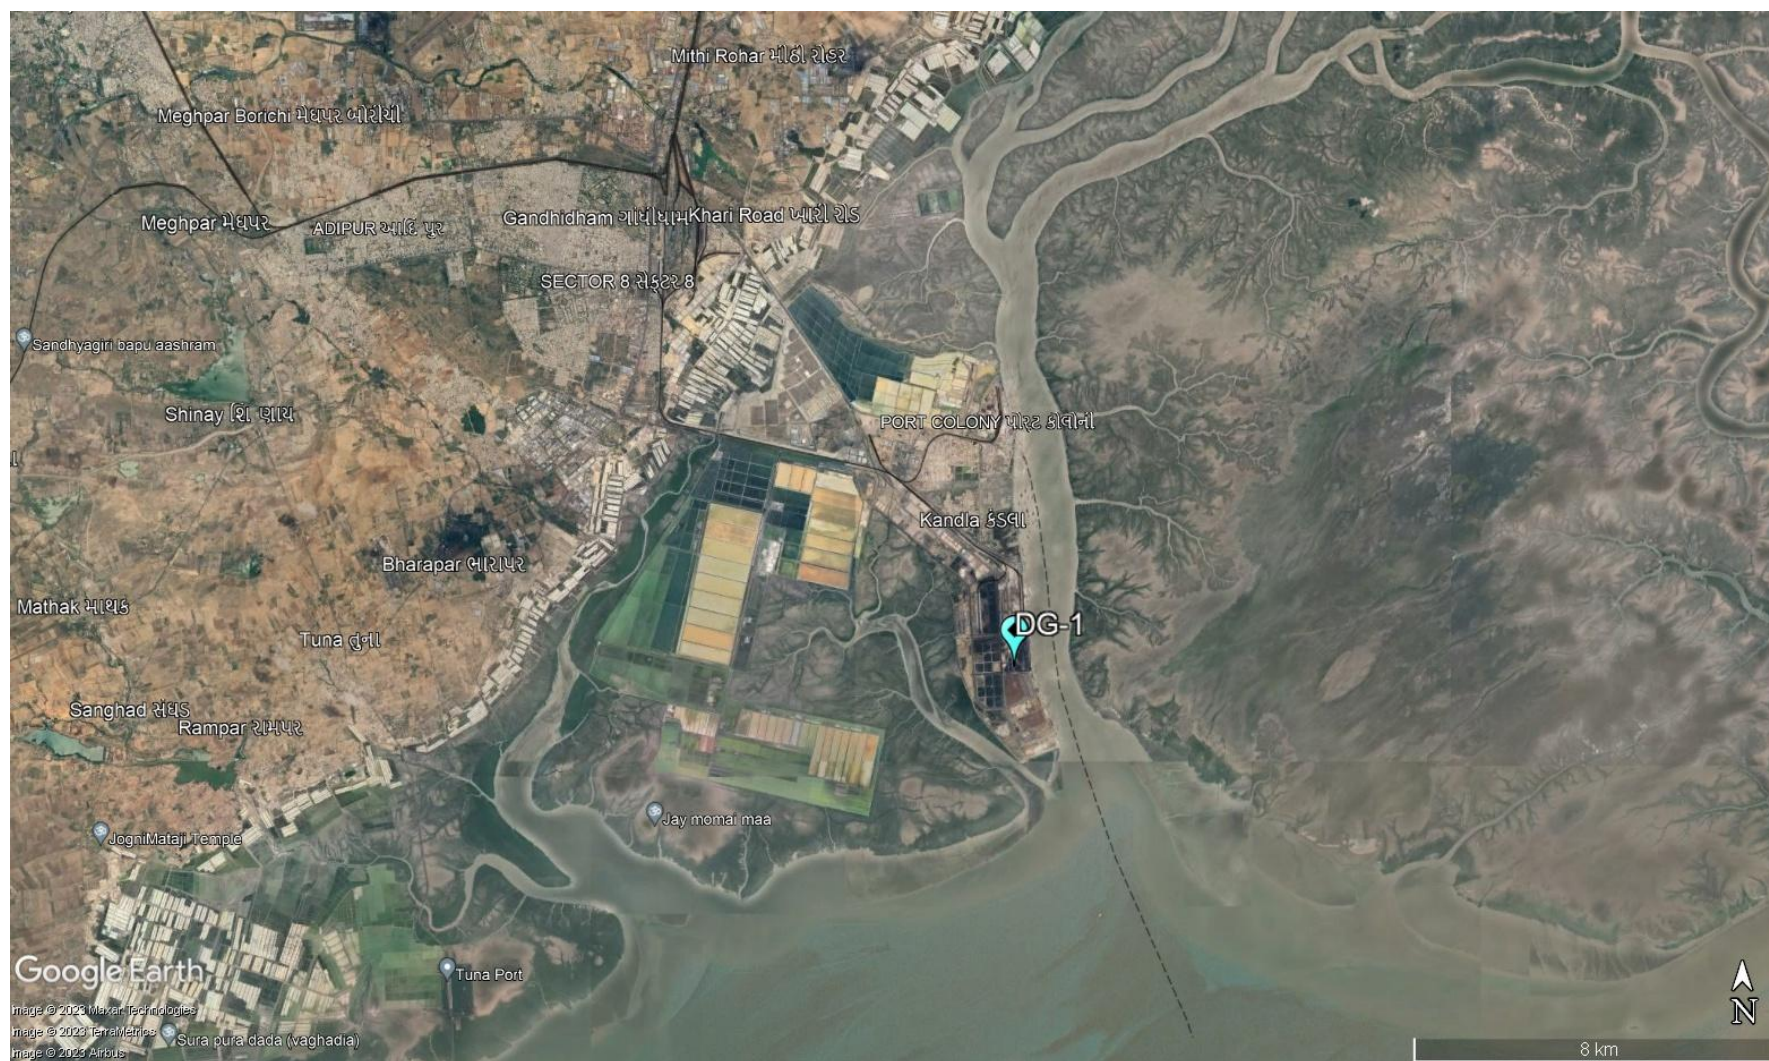

Map 6: Locations for DG Stack monitoring at Kandla



Map 7: Locations for DG Stack monitoring at Vadinar

Methodology:

Under the study, the list of parameters to be monitored under the projects for DG Stack Monitoring has been mentioned in **Table 11** as follows:

Table 11: DG stack parameters

Sr. No.	Parameter	Unit	Instrument
1.	Suspended Particulate Matter	mg/Nm ³	Stack Monitoring Kit
2.	Sulphur Dioxide (SO ₂)	PPM	Sensor based Flue Gas Analyzer (Make: TESTO, Model 350)
3.	Oxides of Nitrogen (NO _x)	PPM	
4.	Carbon Monoxide	%	
5.	Carbon Dioxide	%	

The methodology for monitoring of DG Stack has been mentioned as follows:

The monitoring of DG Stack is carried out as per the IS:11255 and USEPA Method. The Stack monitoring kit is used for collecting representative samples from the stack to determine the total amount of pollutants emitted into the atmosphere in a given time. Source sampling is carried out from ventilation stack to determine the emission rates/or characteristics of pollutants. Sample collected must be such that it truly represents the conditions prevailing inside the stack. Whereas the parameters Sulphur Dioxide, Oxides of Nitrogen (NO_x), Carbon Monoxide and Carbon Dioxide, the monitoring is carried out by using the sensor-based Flue Gas Analyzer.

Frequency

Monitoring is required to be carried out once a month for both the locations of Kandla and Vadinar.

5.2 Result and Discussion

The sampling and monitoring of DG stack emission was carried out at Kandla and Vadinar and its comparison with CPCB or Indian standards for Industrial Stack Monitoring the flue gas emission from DG set has given in **Table 12**.

Table 12: DG monitoring data

Sr. No.	Stack Monitoring Parameters for DG Sets	Stack Monitoring Limits / Standards As per CPCB	DG- 1 (Kandla)	DG-2 (Vadinar)
1.	Suspended Particulate Matter (SPM) (mg/Nm ³)	150	71.45	37.48
2.	Sulphur Dioxide (SO ₂) (PPM)	100	1.17	N.D.
3.	Oxides of Nitrogen (NO _x) (PPM)	50	25.49	9.04
4.	Carbon Monoxide (CO) (%)	1	0.15	0.011
5.	Carbon Dioxide (CO ₂) (%)	-	1.19	1.41

5.3 Data Interpretation and Conclusion

The results of DG stack emission are compared with the permissible limits mentioned in the consent issued by GPCB, and have been found within the prescribed limit for all the monitored parameters.

CHAPTER 6: NOISE MONITORING

6.1 Noise Monitoring

Noise can be defined as an unwanted sound, and it is therefore, necessary to measure both the quality as well as the quantity of environmental noise in and around the study area. Noise produced during operation stage and the subsequent activities may affect surrounding environment impacting the fauna and as well as the human population. Under the scope, the noise monitoring is required to be carried out at 10 locations in Kandla and 3 locations in Vadinar. The sampling locations for noise are not only confined to commercial areas of DPA but also the residential areas of DPA.

The details of the noise monitoring stations are mentioned in **Table 13** and locations have been depicted in the **Map 8 and 9** as follow:

Table 13: Details of noise monitoring locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	N-1	Oil Jetty 7	23.043527N 70.218456E
2.	N-2	West Gate No.1	23.006771N 70.217340E
3.	N-3	Canteen Area	23.003707N 70.221331E
4.	N-4	Main Gate	23.007980N 70.222525E
5.	N-5	Main Road	23.005194N 70.219944E
6.	N-6	Marin Bhavan	23.007618N 70.222087E
7.	N-7	Port & Custom Building	23.009033N 70.222047E
8.	N-8	Nirman Building	23.009642N 70.220623E
9.	N-9	ATM Building	23.009985N 70.221715E
10.	N-10	Wharf Area/ Jetty	22.997833N 70.223042E
11.	N-11	Near Main Gate	22.441544N 69.674495E
12.	N-12	Near Vadinar Jetty	22.441002N 69.673147E
13.	N-13	Port Colony Vadinar	22.399948N 69.716608E



Map 8: Locations for Noise Monitoring at Kandla



Map 9: Locations for Noise Monitoring at Vadinar

Methodology:

The intensity of sound energy in the environment is measured in a logarithmic scale and is expressed in a decibel (dB(A)) scale. The ordinary sound level meter measures the sound energy that reaches the microphone by converting it into electrical energy and then measures the magnitude in dB(A). Whereas, in a sophisticated type of sound level meter, an additional circuit (filters) is provided, which modifies the received signal in such a way that it replicates the sound signal as received by the human ear and the magnitude of sound level in this scale is denoted as dB(A). The sound levels are expressed in dB(A) scale for the purpose of comparison of noise levels, which is universally accepted. Noise levels were measured using an integrated sound level meter of the make Envirotech Sound Level Meter (Class-I) (model No. SLM-109). It has an indicating mode of Lp and Leq. Keeping the mode in Lp for few minutes and setting the corresponding range and the weighting network in "A" weighting set the sound level meter was run for one-hour time and Leq was measured at all locations.

Frequency

Monitoring was carried out at each noise monitoring station for Leq. noise level (Day and Night), which was recorded for 24 hours continuously at a monthly frequency with the help of Sound/Noise Level Meter (Class-1). The details of the noise monitoring have been mentioned in **Table 14**.

Table 14: Details of the Noise Monitoring

Sr. No.	Parameters	Units	Reference Method	Instrument
1.	Leq (Day)	dB(A)	IS 9989: 2014	Noise Level Meter (Class-I) model No. SLM-109
2.	Leq (Night)	dB(A)		

Standard for Noise

Ministry of Environment & Forests (MoEF) has notified the noise standards vide the Gazette notification dated February 14, 2000 for different zones under the Environment Protection Act (1986). The day time noise levels have been monitored from 6.00 AM to 10.00 PM and night noise levels were measure from 10.00 PM to 6.00 AM at all the thirteen locations (10 at Kandla and 3 at Vadinar) monthly. The specified standards are as mentioned in **Table 15** as follows:

Table 15: Ambient Air Quality norms in respect of Noise

Area Code	Category of Area	Noise dB(A) Leq	
		Daytime	Night time
A	Industrial Area	75	70
B	Commercial Area	65	55
C	Residential Area	55	45
D	Silence Zone	50	40

6.2 Result and Discussion

The details of the Noise monitoring conducted during the monitoring period have been summarized in the **Table 16** as below:

Table 16: The Results of Ambient Noise Quality

Sr. No.	Station Code	Station Name	Category of Area	Standard	Day Time			Standard	Night Time		
					Max.	Min.	Leq dB(A) Total		Max.	Min.	Leq dB(A) Total
1	N-1	Oil Jetty 7	A	75	53.4	33.8	43.6	70	45.7	32.1	38.9
2	N-2	West Gate No.1	A	75	61.8	44.2	53	70	50.2	41.2	45.7
3	N-3	Canteen Area	B	65	54.2	43.5	48.8	55	47.2	32.4	39.8
4	N-4	Main Gate	A	75	71.9	44.6	58.2	70	50.2	33.7	41.9
5	N-5	Main Road	A	75	70.5	37.3	53.9	70	48.5	35.1	41.8
6	N-6	Marin Bhavan	B	65	61.7	42.8	52.2	55	49.8	32.9	41.3
7	N-7	Port & Custom Building	B	65	59.1	34.9	47	55	48.1	34.7	41.4
8	N-8	Nirman Building	B	65	62.5	35.6	49.0	55	47.2	32.9	40
9	N-9	ATM Building	B	65	56.9	36	46.4	55	50.2	33.4	41.8
10	N-10	Wharf Area/ Jetty	A	75	60.4	41.9	51.1	70	47.1	38.1	42.6
11	N-11	Near Main Gate	A	75	63.4	55.3	59.3	70	56.2	45.7	50.9
12	N-12	Near Vadinar Jetty	A	75	65.2	58.5	61.8	70	56.5	51.9	54.2
13	N-13	Port Colony Vadinar	C	55	43.3	38.4	40.8	45	39.7	34.2	36.9

6.3 Data Interpretation and Conclusion

The noise level at both the locations (Kandla and Vadinar) was compared with the standard limits specified in NAAQS by CPCB. During the Day Time, the average noise level at all 10 locations at Kandla ranged from **33.8 dB(A) to 71.9 dB(A)**, while at Vadinar, the noise levels for the three-locations ranged from **38.4 dB(A) to 65.2 dB(A)**. Whereas, during Night Time the average Noise Level ranged from **32.1 dB(A) to 50.2 dB(A)** at Kandla and **34.2 dB(A) to 56.5 dB(A)** at Vadinar.

6.4 Remedial Measures

Though, the noise levels detected at the locations of Kandla and Vadinar, are found within the prescribed norms, the noise can further be considerably reduced by adoption of low noise equipment or installation of sound insulation fences. Green belt of plants can be a good barrier. If noise exceeds the applicable norms, then the working hours may be altered as a possible means to mitigate the nuisances of construction activities.

CHAPTER 7: SOIL MONITORING

7.1 Soil Quality Monitoring:

The purpose of soil quality monitoring is to track changes in the features and characteristics of the soil, especially the chemical properties of soil occurring at specific time intervals under the influence of human activity. Soil quality assessment helps to determine the status of soil functions and environmental risks associated with various practices prevalent at the location.

As defined in scope by Deendayal Port Authority (DPA), Soil Quality Monitoring shall be carried out at Six locations, four at Kandla and two at Vadinar. The details of the soil monitoring locations within the Port area of DPA are mentioned in **Table 17**:

Table 17: Details of the Soil quality monitoring

Sr. No.	Location Code		Location Name	Latitude Longitude
1.	Kandla	S-1	Oil Jetty 7	23.043527N 70.218456E
2.		S-2	IFFCO Plant	23.040962N 70.216570E
3.		S-3	Khori Creek	22.970382N 70.223057E
4.		S-4	Nakti Creek	23.033476N 70.158461E
5.	Vadinar	S-5	Near SPM	22.400026N 69.714308E
6.		S-6	Near Vadinar Jetty	22.440759N 69.675210E

Methodology

As per the defined scope by Deendayal Port Authority (DPA), the sampling and analysis of Soil quality has been carried out on monthly basis.

The samples of soil collected from the locations of Kandla and Vadinar and analyzed for the various physico-chemical parameter. Collection and analysis of these samples was carried out as per established standard methods and procedures. The samples were analyzed for selected parameters to get the present soil quality status and environmental risks associated with various practices prevalent at the location. GEMI has framed its own guidelines for collection of soil samples titled as '*Soil Sampling Manual*'. Soil samples were collected from 30 cm depth below the surface using scrapper, filled in polythene bags, labelled on-site with specific location code and name and sent to GEMI's laboratory, Gandhinagar for further detailed analysis. The samples collected from all locations are homogeneous representative of each location. The list of parameters to be monitored under the projects for the Soil Quality Monitoring been mentioned in **Table 18** as follows:

Frequency

Monitoring is required to be carried out once a month for both the locations of Kandla and Vadinar.

Table 18: Soil parameters

Sr. No.	Parameters	Units	Reference method	Instruments
1.	TOC	%	Methods Manual Soil Testing in India January, 2011, 09. Volumetric method (Walkley and Black, 1934)	Titration Apparatus
2.	Organic Carbon	%		
3.	Inorganic Phosphate	Kg/Hectare	Practical Manual Chemical Analysis of Soil and Plant Samples, ICAR-Indian Institute of Pulses Research 2017 Determination of Available Phosphorus in Soil	UV-Visible Spectrophotometer
4.	Texture	-	Methods Manual Soil Testing in India January 2011,01	Hydrometer
5.	pH	-	IS 2720 (Part 26): 1987	pH Meter
6.	Conductivity	μS/cm	IS 14767: 2000	Conductivity Meter
7.	Particle size distribution & Silt content	-	Methods Manual Soil Testing in India January 2011	Sieves Apparatus
8.	SAR	meq/L	Procedures for Soil Analysis, International Soil Reference and Information Centre, 6 th Edition 2002 13-5.5.3 Sodium Absorption Ratio (SAR), Soluble cations	Flame Photometer
9.	Water Holding Capacity	%	NCERT, Chapter 9, 2022-23 and Water Resources Department Laboratory Testing Procedure for Soil & Water Sample Analysis	Muffle Furnace
10.	Aluminium	mg/Kg	EPA Method 3051A	ICP-OES
11.	Chromium	mg/Kg		
12.	Nickel	mg/Kg		
13.	Copper	mg/Kg	Methods Manual Soil Testing in India January, 2011, 17a	
14.	Zinc	mg/Kg	Methods Manual Soil Testing in India January, 2011, 17a	
15.	Cadmium	mg/Kg	EPA Method 3051A	
16.	Lead	mg/Kg		
17.	Arsenic	mg/Kg		
18.	Mercury	mg/Kg		

The map depicting the locations of Soil Quality Monitoring to be monitored in Kandla and Vadinar have been mentioned in **Map 10 and 11** as follows:



Map 10: Locations for Soil Quality Monitoring at Kandla



Map 11: Locations for Soil Quality Monitoring at Vadinar

7.2 Result and Discussion

The analysis results of physical analysis of the soil samples collected during environmental monitoring mentioned in **Table 19** are shown below:

Table 19: Soil Quality for the sampling period

Sr. No	Location Parameters	Unit	Kandla				Vadinar	
			S-1 (Oil Jetty 7)	S-2 (IFFCO Plant)	S-3 (Khorī Creek)	S-4 (Nakti Creek)	S-5 (Near SPM)	S-6 (Near Vadinar Jetty)
1	pH	-	8.73	8.25	8.51	8.44	7.85	8.38
2	Conductivity	μS/cm	12210	13780	2630	15690	271	231
3	Inorganic Phosphate	Kg/ha	0.68	1.62	1.94	1.28	0.87	0.86
4	Organic Carbon	%	0.41	0.39	0.3	0.78	0.35	0.82
5	Organic Matter	%	0.71	0.67	0.52	1.35	0.6	1.42
6	SAR	meq/L	18.31	12.29	1.31	13.21	0.10	0.13
7	Aluminium	mg/Kg	12387	11554	8105	11739	34107	31358.80
8	Chromium	mg/Kg	52.24	52.52	49.18	58.81	69.59	71.12
9	Nickel	mg/Kg	22.89	15.87	21.32	28.84	28.84	32.53
10	Copper	mg/Kg	77.03	85.80	70.86	24.96	89.51	76.23
11	Zinc	mg/Kg	73.96	95.08	61.84	63.50	62.67	63.70
12	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL
13	Lead	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL
14	Arsenic	mg/Kg	0.95	0.93	2.31	3.86	0.35	0.72
15	Mercury	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL
16	Water Holding Capacity	%	52	47.2	48.8	60	47.2	65.59
17	Sand	%	61.69	67.68	70.4	57.69	78.24	78.96
18	Silt	%	26	32	21.28	39.99	20	14
19	Clay	%	12.32	0.32	8.32	2.32	1.76	7.04
20	Texture	-	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Loamy sand	Loamy sand

7.3 Data Interpretation and Conclusion

Soil samples were collected from 6 locations (4 at Kandla and 2 at Vadinar) and further analysed for its physical & chemical characteristics. Each of the parameters have been given an interpretation based on the observations as follows:

- The value of **pH** ranges from **8.25-8.73**, highest at location S-1 (Oil Jetty 7) and lowest at S-2 (IFFCO Plant); while the average pH for Kandla was observed to be 8.48. Whereas, at Vadinar the pH value observed at S-5 i.e., Near SPM (7.85) and at S-6 i.e.,

Near Jetty Area (8.38). As per the observation the pH was found to be **moderately to strongly alkaline** both the monitoring station of Kandla and Vadinar.

- At entire monitoring locations of Kandla the value of **Electrical Conductivity** ranges from **2630-15690 $\mu\text{S/cm}$** , highest at location S-4 (Nakti Creek) with the average as **11077.5 $\mu\text{S/cm}$** . Whereas, at Vadinar the range of conductivity was between the range of **231 to 271 $\mu\text{S/cm}$** with an average value of **251 $\mu\text{S/cm}$** .
- At Kandla, the concentration of **Inorganic Phosphate** varied from **0.68-1.94 Kg/ha**, with average **1.38 Kg/ha**. Whereas, at the locations of Vadinar, the Inorganic Phosphate was observed at S-5 i.e., Near SPM (**0.87 Kg/ha**) and detected at S-6 i.e., near Jetty Area (**0.86 Kg/ha**). The phosphorus availability in soil solution is influenced by a number of factors such as Organic matter, clay content, pH, temperature, etc.
- The concentration of **Total Organic Carbon** ranges from **0.30-0.78%** while the average TOC at Kandla was detected as **0.47%**. Whereas, at Vadinar the average TOC was found to be **0.58%** where the observed TOC value found at S-5 i.e. Near SPM (**0.35%**) and S-6 i.e. near Jetty Area to be **0.82 %** and below quantification limit respectively.
- The concentration of **Water Holding Capacity** in the soil samples of Kandla and Vadinar varies from **47.2-60%** and **47.2-65.59%** respectively.
- The concentration of **Sodium Adsorption Ratio** ranges from **1.31-18.31 meq/L** with an average value **11.28 meq/L** at Kandla. Whereas, at Vadinar, the average SAR was found to be **0.11 meq/L**. A component of conductivity is the SAR. A high SAR indicates a large concentration of sodium ions in the soil, which raises conductivity.

Sandy Loam to loamy sand **Soil Texture** was observed at all the monitoring locations of Kandla and Vadinar.

Heavy Metals

For the sampling period, the concentration of **Aluminium** varied from **8105 to 12387 mg/kg** at Kandla and **31358.8 to 34107.4 mg/kg** at Vadinar and the average value was observed to be **10946.25 and 32733.1 mg/kg** at Kandla and Vadinar monitoring station, respectively.

- The concentration of **Chromium** varied from **49.18 to 58.81 mg/kg** at Kandla and **69.59 to 71.12 mg/kg** at Vadinar and the average value was observed to be **53.18 and 70.35 mg/kg** at Kandla and Vadinar monitoring station, respectively.
- The concentration of **Nickel** varied from **15.87 to 28.84 mg/kg** at Kandla and **28.84 to 32.53 mg/kg** at Vadinar and the average value was observed to be **22.23 and 30.68 mg/kg** at Kandla and Vadinar monitoring station, respectively.

- The concentration of **Zinc** varied from **61.84 to 95.08 mg/kg** at Kandla and **62.67 to 63.70 mg/kg** at Vadinar and the average value was observed to be **73.59 and 63.18 mg/kg** at Kandla and Vadinar monitoring station, respectively
- The concentration of **copper** varied from **24.96 to 85.80 mg/kg** at Kandla and **76.23 to 89.51 mg/kg** at Vadinar and the average value was observed to be **64.66 and 82.87 mg/kg** at Kandla and Vadinar monitoring station, respectively.
- The concentration of **Arsenic** varied from **0.93 to 3.86 mg/kg** at Kandla and the average value was observed to be **2.01** at Kandla Vadinar and the average value was observed to be **0.35 and 0.72 mg/kg** at Kandla and Vadinar monitoring station.
- While other heavy metals in the Soil i.e., **Mercury, Lead and Cadmium** were observed “Below Quantification Limit” for majority of the soil samples collected at Kandla and Vadinar.

CHAPTER 8: DRINKING WATER MONITORING

8.1 Drinking Water Monitoring

It is necessary to check with the drinking water sources regularly so as to know whether water quality conforms to the prescribed standards for drinking. Monitoring the drinking water quality is essential to protect human health and the environment. With reference to the scope specified by DPA, a total of 20 locations (18 at Kandla and 2 at Vadinar) were monitored to assess the Drinking Water quality. The DW-2 location was replaced by Shramdeep due to demolition of past sampling location (port & custom building)

The details of the drinking water sampling stations have been mentioned in **Table 20** and the locations have been depicted through Google map in **Map 12 and 13**.

Table 20: Details of Drinking Water Sampling Locations

Sr. No.	Location Code	Location Name	Latitude/ Longitude
1.	DW-1	Oil Jetty 7	23.043527N 70.218456E
2.	DW-2	Shramdeep	23.009631N, 70.220877E
3.	DW-3	North Gate	23.007938N 70.222411E
4.	DW-4	Workshop	23.009372N 70.222236E
5.	DW-5	Canteen Area	23.003707N 70.221331E
6.	DW-6	West Gate 1	23.006771N 70.217340E
7.	DW-7	Sewa Sadan -3	23.009779N 70.221838E
8.	DW-8	Nirman Building	23.009642N 70.220623E
9.	DW-9	Custom Building	23.018930N 70.214478E
10.	DW-10	Port Colony Kandla	23.019392N 70.212619E
11.	DW-11	Wharf Area/ Jetty	22.997833N 70.223042E
12.	DW-12	Hospital Kandla	23.018061N 70.212328E
13.	DW-13	A.O. Building	23.061914N 70.144861E
14.	DW-14	School Gopalpuri	23.083619N 70.132061E
15.	DW-15	Guest House	23.078830N 70.131008E
16.	DW-16	E- Type Quarter	23.083306N 70.132422E
17.	DW-17	F- Type Quarter	23.077347N 70.135731E
18.	DW-18	Hospital Gopalpuri	23.081850N 70.135347E
19.	DW-19	Near Vadinar Jetty	22.440759N 69.675210E
20.	DW-20	Near Port Colony	22.401619N 69.716822E



Map 12: Locations for Drinking Water Monitoring at Kandla



Map 13: Locations for Drinking Water Monitoring at Vadinar

Methodology

The water samples were collected from the finalized sampling locations and analyzed for physico-chemical and microbiological parameter, for which the analysis was carried out as per APHA, 23rd Edition and Indian Standard method in GEMI's NABL Accredited Laboratory, Gandhinagar. GEMI has followed the CPCB guideline as well as framed its own guidelines for the collection of water/wastewater samples, under the provision of Water (Preservation and Control of Pollution) Act 1974, titled as '**Sampling Protocol for Water & Wastewater**'; approved by the Government of Gujarat vide letter no. ENV-102013-299-E dated 24-04-2014. The samples under the study were collected and preserved as per the said Protocol. The parameters finalized to assess the drinking water quality have been mentioned in **Table 21** as follows:

Table 21: List of parameters for Drinking Water Quality monitoring

Sr. No.	Parameters	Units	Reference method	Instrument
1.	pH	-	APHA, 23 rd Edition (Section-4500-H+B):2017	pH Meter
2.	Colour	Hazen	APHA, 23 rd Edition, 2120 B:2017	Color Comparator
3.	EC	μS/cm	APHA, 23 rd Edition (Section-2510 B):2017	Conductivity Meter
4.	Turbidity	NTU	APHA, 23 rd Edition (Section -2130 B):2017	Nephlo Turbidity Meter
5.	TDS	mg/L	APHA, 23 rd Edition (Section-2540 C):2017	Vaccum Pump with filtration assembly and Oven
6.	TSS	mg/L	APHA, 23 rd Edition, 2540 D: 2017	
7.	Chloride	mg/L	APHA, 23 rd Edition (Section-4500-Cl-B):2017	Titration Apparatus
8.	Total Hardness	mg/L	APHA, 23 rd Edition (Section-2340 C):2017	
9.	Ca Hardness	mg/L	APHA, 23 rd Edition (Section-3500-Ca B):2017	
10.	Mg Hardness	mg/L	APHA, 23 rd Edition (Section-3500-Mg B):2017	
11.	Free Residual Chlorine	mg/L	APHA 23 rd Edition, 4500	
12.	Fluoride	mg/L	APHA, 23 rd Edition (Section-4500-F-D):2017	UV- Visible Spectrophotometer
13.	Sulphate	mg/L	APHA, 23 rd Edition (Section 4500-SO ₄ -2-E):2017	
14.	Sodium	mg/L	APHA, 23 rd Edition (Section-3500-Na-B):2017	Flame Photometer
15.	Potassium	mg/L	APHA, 23 rd Edition, 3500 K-B: 2017	
16.	Salinity	mg/L	APHA, 23 rd Edition (section 2520 B, E.C. Method)	Salinity /TDS Meter
17.	Nitrate	mg/L	APHA, 23 rd Edition, 4500 NO ₃ - B: 2017	UV- Visible Spectrophotometer

Sr. No.	Parameters	Units	Reference method	Instrument
18.	Nitrite	mg/L	APHA, 23 rd Edition, 4500 NO ₂ -B: 2017	
19.	Hexavalent Chromium	mg/L	APHA, 23 rd Edition, 3500 Cr B: 2017	
20.	Manganese	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
21.	Mercury	mg/L	EPA 200.7	
22.	Lead	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
23.	Cadmium	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
24.	Iron	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
25.	Total Chromium	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	ICP-OES
26.	Copper	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	
27.	Zinc	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
28.	Arsenic	mg/L	APHA ICP 23 rd Edition (Section-3120 B):2017	
29.	Total Coliforms	MPN/100ml	IS 15185: 2016	LAF/ Incubator

8.2 Result and Discussion

The drinking water quality of the locations at Kandla and Vadinar and its comparison with the to the stipulated standard (Drinking Water Specifications i.e., IS: 10500:2012) have been summarized in **Table 22** as follows:

Table 22: Summarized results of Drinking Water quality

Sr. No.	Parameters	Units	Standard values as per IS		Kandla																		Vadinar	
			A	P	DW-1	DW-2	DW-3	DW-4	DW-5	DW-6	DW-7	DW-8	DW-9	DW-10	DW-11	DW-12	DW-13	DW-14	DW-15	DW-16	DW-17	DW-18	DW-19	DW-20
1.	pH	-	6.5-8.5	-	8.40	7.20	7.54	7.41	7.02	7.99	7.36	7.16	6.91	6.93	7.99	7.15	7.50	6.96	6.99	7.10	7.08	6.76	6.90	6.79
2.	Colour	Hazen	5	15	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
3.	EC	µS/ cm	-	-	125.5	279	23.1	43.9	50	149	23	25.4	61.4	217	138	212	65.4	203	174.4	49.2	29.7	126.8	165.3	105.6
4.	Salinity	PSU	-	-	0.06	0.13	0.02	0.03	0.03	0.06	0.02	0.02	0.03	0.11	0.09	0.10	0.04	0.10	0.09	0.03	0.02	0.06	0.08	0.05
5.	Turbidity	NTU	1	5	0.59	0.64	0.56	0.71	0.64	0.65	0.65	0.69	0.73	BQL	0.98	BQL	0.52	0.71	BQL	BQL	0.63	0.83	BQL	BQL
6.	Chloride	mg/L	250	1000	28.58	60.12	7.88	13.80	11.50	111.97	7.88	7.88	16.75	45.33	109.97	45.33	17.74	48.29	43.36	15.77	9.86	35.48	20.70	13.80
7.	Total Hardness	mg/L	200	600	16	40	2	2	5	180	2	2.5	7	42	160	34	8	26	10	4	2	6	54	22
8.	Ca Hardness	mg/L	-	-	8	18	1.5	1.5	3	100	1.5	2	4	24	90	18	2	12	8	2.5	1.5	4	26	12
9.	Mg Hardness	mg/L	-	-	8	22	BQL	BQL	2	80	BQL	BQL	3	18	70	16	6	14	2	1.5	BQL	2	28	10
10.	Free Residual Chlorine	mg/L	0.2	1	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
11.	TDS	mg/L	500	2000	66	92	12	22	26	342	12	14	32	112	346	108	34	106	90	26	16	66	84	54
12.	TSS	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
13.	Fluoride	mg/L	1.0	1.5	BQL	BQL	BQL	0.62	BQL	0.435	BQL	BQL	BQL	BQL	0.349	BQL	BQL	BQL	0.35	BQL	BQL	BQL	BQL	BQL
14.	Sulphate	mg/L	200	400	BQL	15.25	BQL	BQL	BQL	36.66	BQL	BQL	BQL	11.59	35.50	10.59	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
15.	Nitrate	mg/L	45	-	BQL	1.635	BQL	BQL	1.040	5.851	BQL	BQL	BQL	1.236	5.470	1.246	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
16.	Nitrite	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	0.033	BQL	BQL	BQL	BQL	0.263	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
17.	Sodium	mg/L	-	-	19.91	30.35	BQL	BQL	7.26	76.79	BQL	BQL	BQL	17.55	71.89	16.59	5.08	19.27	16.79	BQL	BQL	5.25	8.67	5.06
18.	Potassium	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL



Environmental Monitoring Report of Deendayal Port Authority, December-2024, January-2025

Sr. No.	Parameters	Units	Standard values as per IS		Kandla																		Vadinar	
			A	P	DW-1	DW-2	DW-3	DW-4	DW-5	DW-6	DW-7	DW-8	DW-9	DW-10	DW-11	DW-12	DW-13	DW-14	DW-15	DW-16	DW-17	DW-18	DW-19	DW-20
19.	Hexavalent Chromium	mg/L	-	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
20.	Odour	TON	Agreeable		1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1	1
21.	Arsenic	mg/L	0.01	0.05	BQL	BQL	BQL	BQL	BQL	9.792	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
22.	Cadmium	mg/L	0.003	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
23.	Copper	mg/L	0.05	1.5	BQL	BQL	BQL	BQL	0.0072	BQL	BQL	BQL	0.0080	0.0062	BQL	0.0058	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.0086
24.	Iron	mg/L	0.3	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.139	BQL
25.	Lead	mg/L	0.01	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	0.00335	BQL
26.	Manganese	mg/L	0.1	0.3	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
27.	Mercury	mg/L	0.001	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
28.	Total Chromium	mg/L	0.05	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
29.	Zinc	mg/L	5	15	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
30.	Total Coliform*	MPN/100ml	Shall not be detected		150	BQL	BQL	BQL	BQL	BQL	BQL	10	BQL	BQL	85	BQL	65	40	110	20	BQL	170	235	BQL

A: Acceptable, P:Permissible, BQL: Below Quantification limit; Turbidity (QL=0.5 NTU), Free Residual Chlorine (QL=2 mg/L), Total Suspended Solids (QL=2 mg/L), Fluoride (QL=0.3 mg/L), Sulphate (QL=10 mg/L), Nitrate as NO₃ (QL=1 mg/L), Nitrite as NO₂ (QL=0.1mg/L), Sodium as Na (QL=5mg/L), Potassium as K (QL=5mg/L), Hexavalent Chromium (QL=0.01 mg/L), Arsenic (QL=0.005 mg/L), Cadmium (QL=0.002 mg/L), Copper (QL=0.005 mg/L), Iron (QL=0.1mg/L), Lead (QL=0.002 mg/L), Manganese (QL=0.04 mg/L), Mercury (QL=0.0005 mg/L), Total Chromium (QL=0.005 mg/L), Zinc (QL=0.5 mg/L), Total Coliforms (QL=1 MPN/ 100ml)

AQL: Above Quantification Limit; Total Coliforms (QL=1000000)

*Note: For Total Coliform, one MPN is equivalent to one CFU. The use of either method; MPN or CFU for the detection of bacteria are considered valid measurements for bacteria limits.

8.3 Data Interpretation and Conclusion

Drinking water samples were taken at 20 locations (18 at Kandla and 2 at Vadinar), and their physical and chemical properties were analyzed. The analysis's results were compared with standard values as prescribed in IS 10500:2012 Drinking Water Specification.

- **pH:** The pH values of drinking water samples in Kandla were reported to be in the range of **6.76 to 8.40** with an average pH of **7.30**. In Vadinar, its values ranged from **6.90 to 6.79**, with an average pH of **6.85**. remarkably, the pH values at project locations are within the permissible range of 6.5 to 8.5. specified under IS: 10500:2012, expect DW-19 and DW-20.
- **Colour:** The value of Color in Drinking water sample at Kandla is found to be **1 Hazen** in each sample. In Vadinar the color value is found to be **1 Hazen** in both the locations.
- **Turbidity:** At the drinking water locations of Kandla, the turbidity was found to be in the range of **0.52 to 0.98** with an average of **0.68**. Whereas, in Vadinar the value of turbidity was reported BQL for both the monitoring location.
- **Total Dissolved Solids (TDS):** Monitoring TDS is crucial because it provides an indication of overall quality of the water. During the monitoring period, the TDS concentrations in Kandla were observed to vary in a wide range i.e., between **12 to 346 mg/L**, with an average concentration of **84.55 mg/L**. while in Vadinar, it ranged from **84 to 54 mg/L**, with average at **69 mg/L**.

It is important to note that the TDS concentrations in both Kandla and Vadinar fall well within the acceptable limit of 500 mg/L.

- **Electrical Conductivity (EC):** It is a measure of the ability of a solution to conduct electric current, and it is often used as an indicator of the concentration of dissolved solids in water. During the monitoring period, the EC values for samples collected in Kandla were observed to range from **23 to 279 $\mu\text{S/cm}$** , with an average value of **110.87 $\mu\text{S/cm}$** . In Vadinar, the EC values showed variation from **105.6 to 165.3 $\mu\text{S/cm}$** , with an average value of **135.45 $\mu\text{S/cm}$** . It's important to regularly monitor EC levels in drinking water as it can provide valuable information about water quality and presence of dissolved substances.
- **Chlorides:** The concentrations in the drinking water samples collected from Kandla and Vadinar were within acceptable limits, as specified by the BIS. The chloride in Kandla varied from **7.88 to 111.97 mg/L**, with an average value of **35.41 mg/L**. In Vadinar, it ranged from **13.80 to 20.70 mg/L**, with an average value of **17.25 mg/L**. It's important to note that all the recorded chloride concentrations in both Kandla and Vadinar were well below the acceptable limit of 250 mg/L except for location DW-5, DW-11.
- **Total Hardness (TH):** Total Hardness varied from **2 to 180 mg/L**, with the average value as **30.47 mg/L**. While at Vadinar, the variation was observed from **22 to 54 mg/L**; with the average conc. At **38 mg/L**. It's important to note that all the recorded chloride concentrations in both Kandla and Vadinar were well below the acceptable limit of 200 mg/L.

- **Sulphate:** During monitoring period in Kandla and Vadinar, the sulphate concentrations were found to be within the acceptable limits i.e., 200 mg/L as per the specified norms. In Kandla, the sulphate concentrations varied from **10.59 to 36.66 mg/L**, with an average value of **21.92 mg/L**. In Vadinar, the sulphate concentration was observed below quantification limit.
- **Sodium:** During the monitoring period, at Kandla variation in the concentration of sulphate was observed to be in the range of **5.08 to 76.79 mg/L**, with the average concentration of **26.06 mg/L**. While at Vadinar, the concentration recorded **8.67 mg/L at DW-19** and **5.06 mg/L at DW-20** with the average concentration of **6.87 mg/L**.
- **Nitrate:** During the monitoring period, at Kandla & Vadinar variation in the concentration of Nitrate was observed to be in the range of **1.04 to 5.85 mg/L**, with the average concentration of **2.74 mg/L** also majority of the location recorded as “**BQL**”. While at Vadinar, the concentration recorded as below Quantification limit.
- **Fluoride:** The concentration was found to be BQL in majority of the monitoring location except for location DW-4 (Workshop) i.e. 0.62 mg/L, DW-6 (West Gate 1) i.e. 0.43 mg/L, DW-11 (Wharf area/Jetty) i.e. 0.34 mg/L at Kandla. While at Vadinar its value also reported to be BQL for both the monitoring location.
- **Nitrite:** The Concentration was found to be **BQL** in all of the monitoring location except for location DW-6 (West Gate 1) i.e. 0.033 mg/L, DW-11 (Wharf Area/Jetty) i.e. 0.263 mg/L at Kandla. While at Vadinar its value also reported to be BQL for both the Monitoring location.
- **Iron:** The Concentration was found to be **BQL** in all of the monitoring location except for location DW-18 (Hospital Gopalpuri) i.e. 0.139 mg/L at Kandla.
- **Copper:** The Concentration was found to be **BQL** in all of the monitoring location except for location DW-5 (Canteen Area) i.e. 0.00720 mg/L, DW-10 (Port Colony Kandla) i.e. 0.00623 mg/L, DW-12 (Hospital Kandla) i.e. 0.00587 mg/L, at Kandla. While at Vadinar, the concentration recorded BQL at DW-19 and 0.00868 mg/L at DW-20 with the average concentration of 0.00868 mg/L.
- The parameters such as **Free Residual Chlorine, Lead, Potassium, Total Suspended Solids, Manganese, Hexavalent Chromium**, and the metals **Arsenic, Cadmium, Total Chromium and Zinc** were all observed to have concentrations “Below the Quantification Limit (BQL)” at majority of the locations during the monitoring period.
- **Total Coliforms:** During the monitoring period, at Kandla variation in the concentration of sulphate was observed to be in the range of **10 to 170 MPN/100ml**, with the average concentration of **81.25 MPN/100ml**. While at Vadinar, the concentration recorded **235 MPN/100ml** at DW-19 and **BQL** at DW-20.

8.4 Remedial Measures

Appropriate water treatment processes should be administered to eradicate coliform bacteria. The methods of disinfection such as **chlorination, ultraviolet (UV), or ozone** etc, apart from that, filtration systems can also be implemented to remove bacteria, sediment, and other impurities.

The following steps can be implemented to ensure that the water being supplied is safe for consumption:

- Regular monitoring should be carried out to assess the quality of drinking water at various stages, including the source, purification plants, distribution network, and consumer endpoints would help in early detection of coliform bacteria or other contaminants in the drinking water.
- It is necessary to carry out a system assessment to determine whether the drinking-water supply chain (up to the point of consumption) as a whole can deliver water of a quality that meets identified targets. This also includes the assessment of design criteria of the treatment systems employed.
- Identifying control measures in a drinking-water system that will collectively control identified risks and ensure that the health-based targets are met. For each control measure identified, an appropriate means of operational monitoring should be defined that will ensure that any deviation from required performance (water quality) is rapidly detected in a timely manner.
- Management and communication plan should be formulated describing actions to be taken during normal operation as well as during incident conditions (such as drinking water contamination) and documenting the same.

CHAPTER 9: SEWAGE TREATMENT PLANT MONITORING

9.1 Sewage Treatment Plant (STP) Monitoring:

The principal objective of STP is to remove contaminants from sewage to produce an effluent that is suitable to discharge to the surrounding environment or an intended reuse application, thereby preventing water pollution from raw sewage discharges. As defined in the scope by Deendayal Port Authority (DPA), Kandla, the STP Monitoring is to be carried out weekly at three locations, one at Kandla, one at Gopalpuri and one STP at Vadinar. The samples from the inlet and outlet of the STP have been collected weekly. The details of the locations of STP to be monitored for Kandla and Vadinar have been mentioned in **Table 23** as follows:

Table 23: Details of the monitoring locations of STP

Sr. No.	Location Code		Location Name	Latitude Longitude
1.	Kandla	STP-1	STP Kandla	23.021017N 70.215594E
2.		STP-2	STP Gopalpuri	23.077783N 70.136759E
3.	Vadinar	STP-3	STP at Vadinar	22.406289N 69.714689E

The Consolidated Consent and Authorization (CC&A) issued by the GPCB were referred for the details of the STP for Kandla and Gopalpuri. The CC&A of Kandla and Gopalpuri entails that the treated domestic sewage should conform to the norms specified in **Table 24**. The treated effluent conforming to the norms shall be discharged on the land within the premises strictly for the gardening and plantation purpose. Whereas, no sewage shall be disposed outside the premises in any manner.

Table 24: Treated effluent Standards (as per CC&A of Kandla STP)

Sr. No.	Parameters	Prescribed limits
1.	pH	6.5-8.5
2.	BOD (3 days at 27°C)	30 mg/L
3.	Suspended Solids	100 mg/L
4.	Fecal Coliform	< 1000 MPN/100 ml

The detailed process flow diagram of the Kandla and Gopalpuri STP have been mentioned in **Figure 3 and 4** as follows:

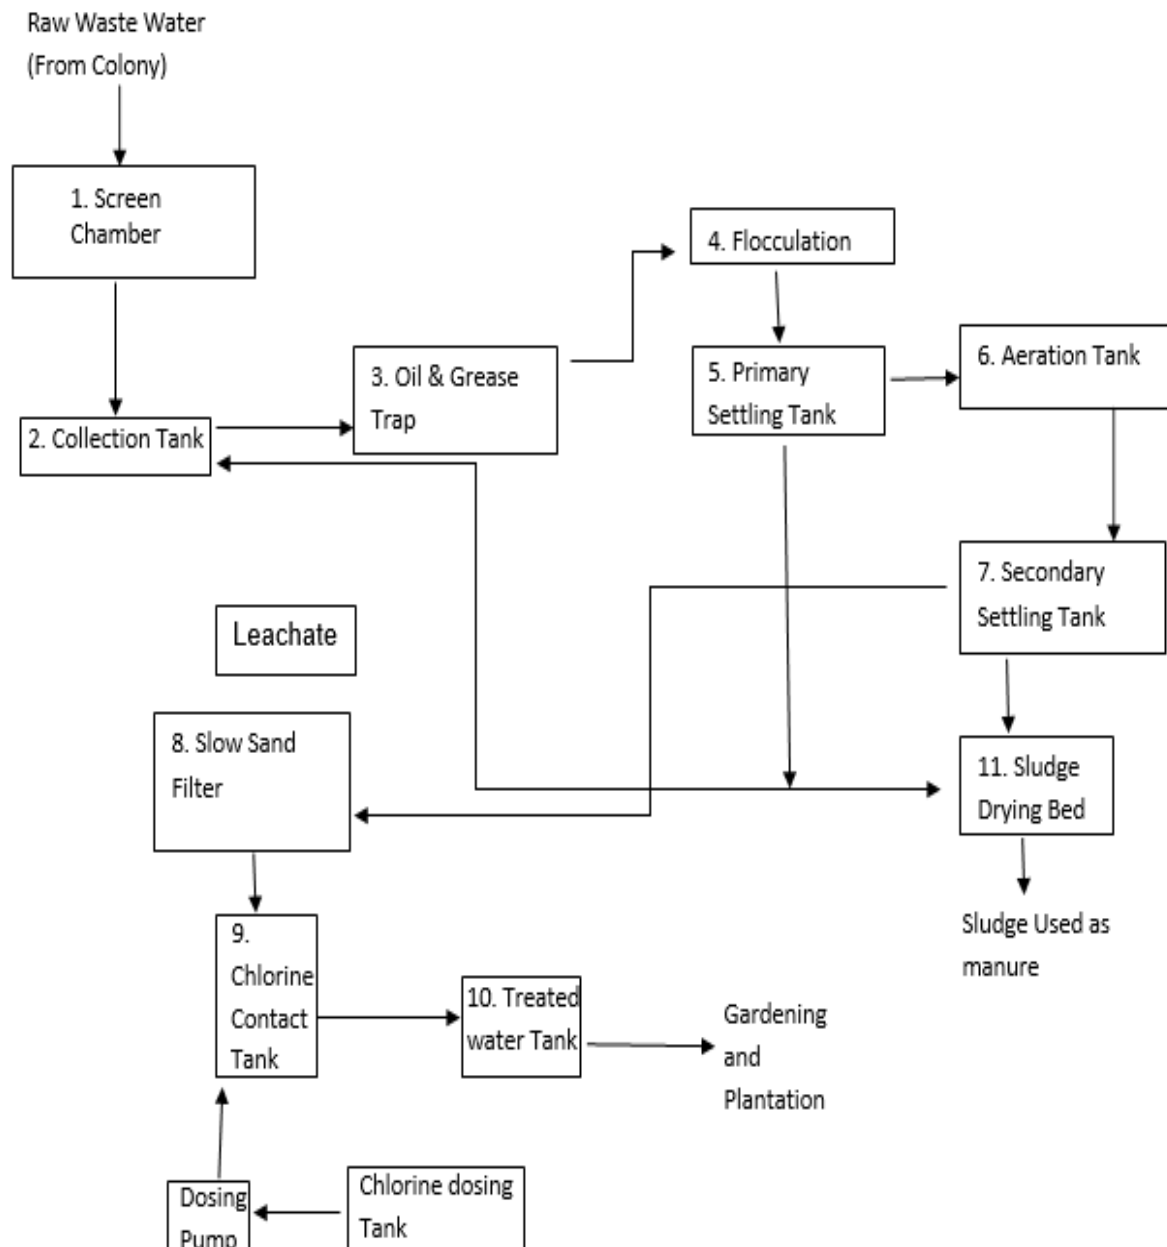


Figure 3: Process flow diagram of STP at Kandla

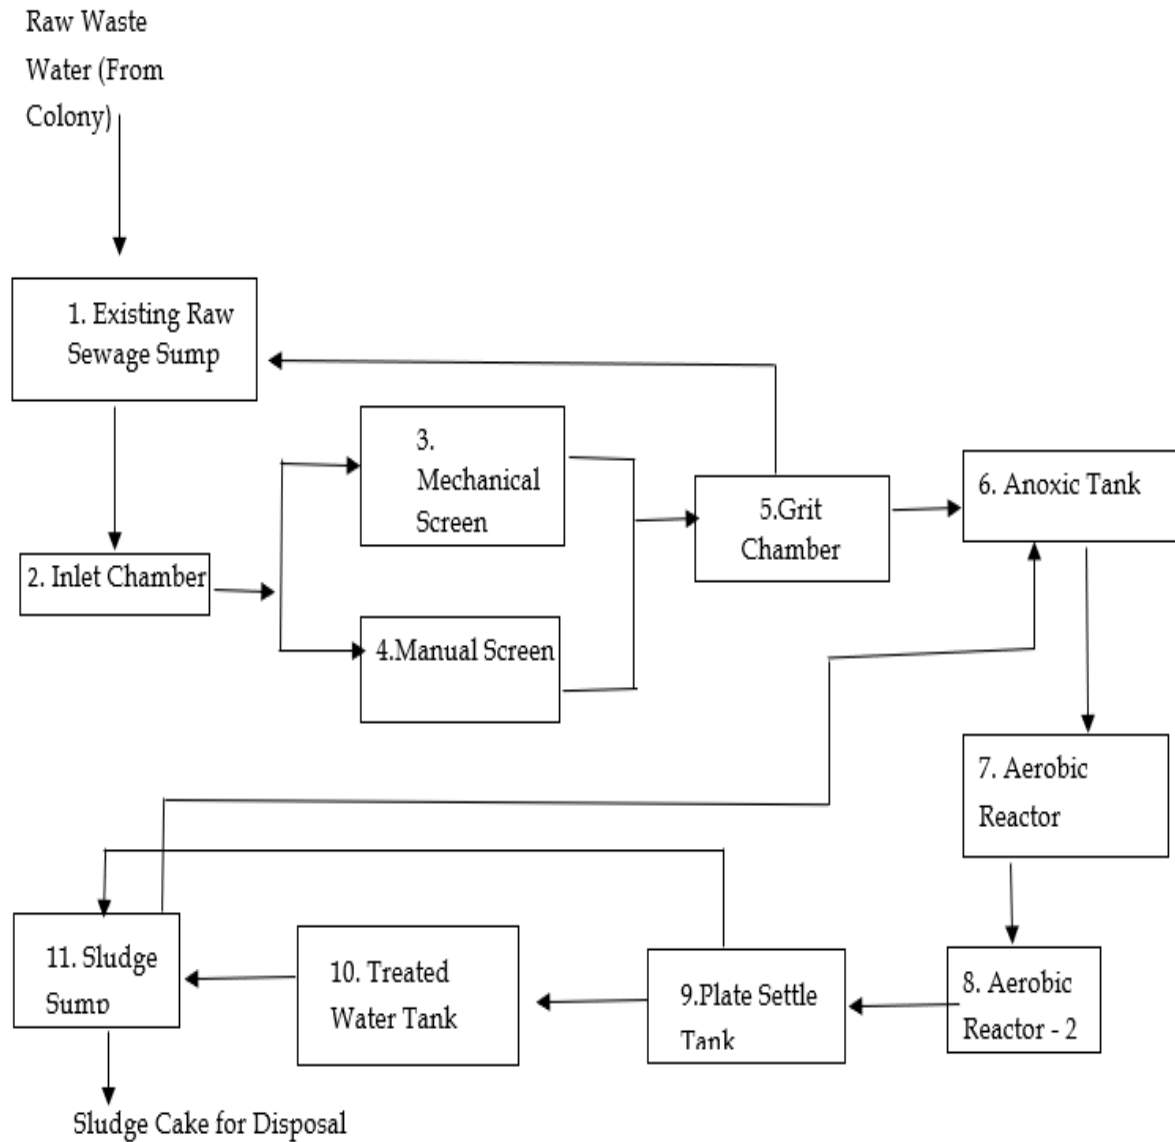


Figure 4: Process flow diagram of STP at Gopalpuri

STP at Vadinar

The STP at Vadinar has been built with a treatment capacity of 450 KLD/day. The Consolidated Consent and Authorization (CC&A) issued by the GPCB has been referred for the details of the said STP. The CC&A of the Vadinar STP suggests that the domestic effluent generated shall be treated as per the norms specified in **Table 25**. The treated effluent conforming to the norms shall be discharged on the land within the premises strictly for the gardening and plantation purpose. Whereas, no sewage shall be disposed outside the premises in any manner.

Table 25: Norms of treated effluent as per CC&A of Vadinar STP

Sr. No.	Parameters	Prescribed limits
1.	pH	5.5-9
2.	BOD (3 days at 27°C)	10 mg/L
3.	Suspended Solids	20 mg/L
4.	Fecal Coliform	Desirable 100 MPN/100 ml Permissible 230 MPN/100 ml
5.	COD	50 mg/L

The detailed process flow diagram of the Vadinar STP have been mentioned in **Figure 5** as follows:


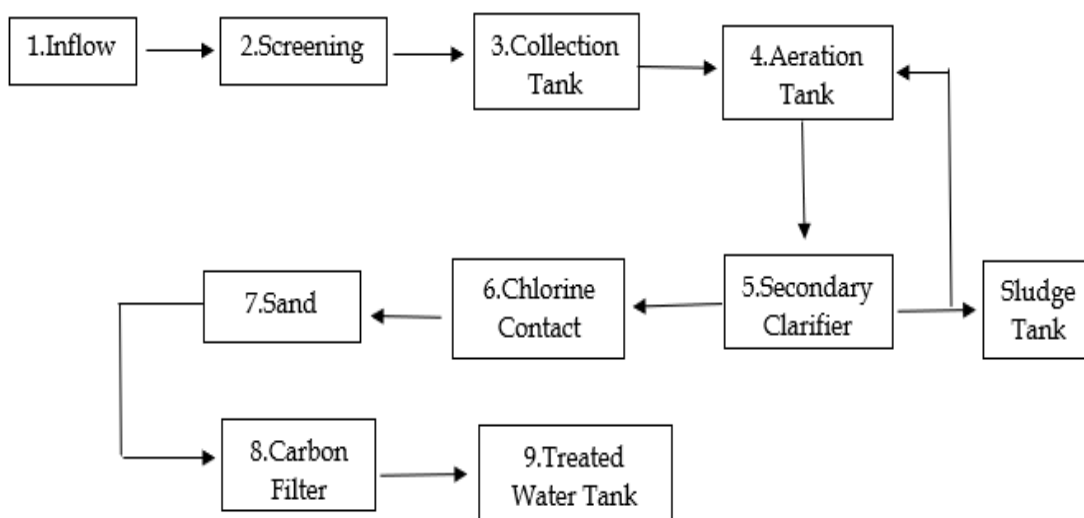


Figure 5: Process flowchart for the STP at Vadinar

The map depicting the locations of STP to be monitored in Kandla and Vadinar have been shown in **Map 14 and 15** as follows:



Map 14: Locations for STP Monitoring at Kandla

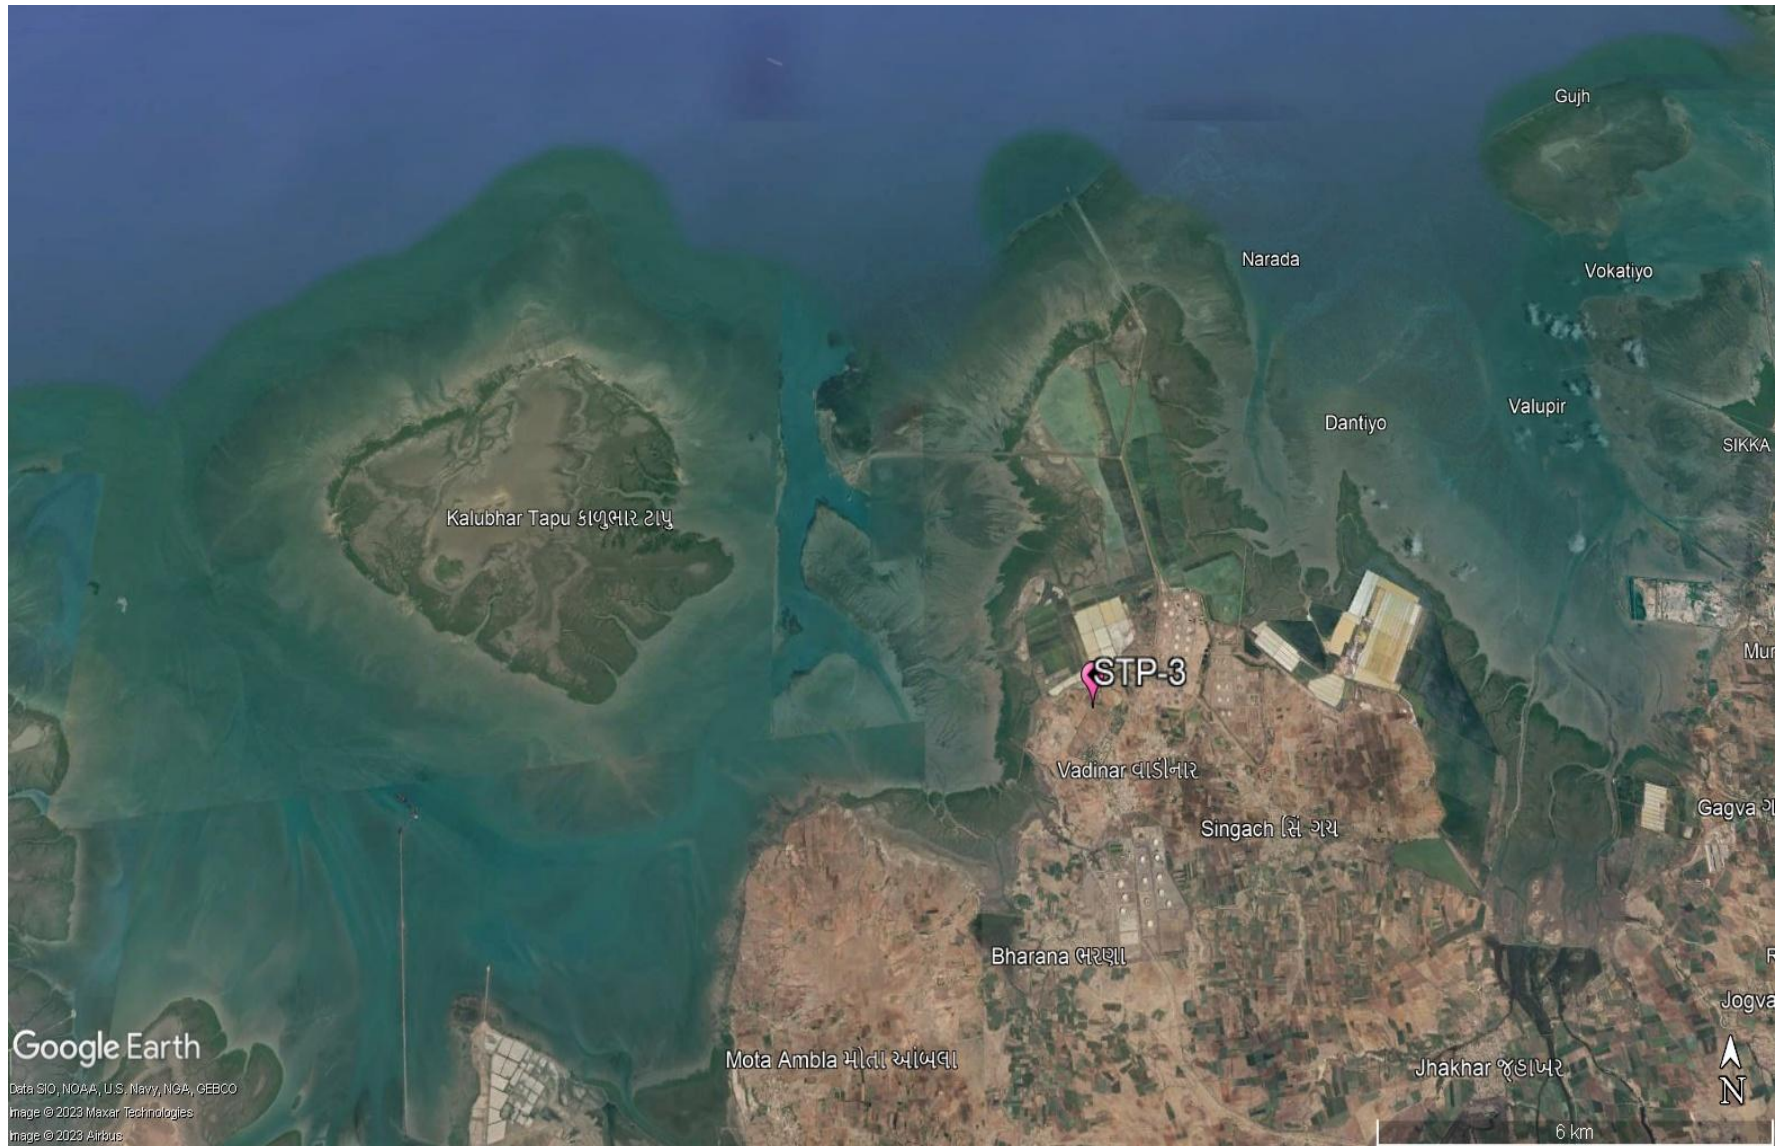

Map 15: Locations for STP Monitoring at Vadinar

Methodology

As per the defined scope by DPA, the sampling and analysis of water samples from the inlet and outlet of the STP's of Kandla and Vadinar are carried out once a week, i.e., four times a month.

The water samples were collected from inlet and the outlet of the STP's and analyzed for physico-chemical and microbiological parameter. Collection and analysis of these samples was carried out as per established standard methods and procedures for the examination of water. The samples were analyzed for selected parameters to establish the existing water quality of the inlet and outlet points of the STP. GEMI has framed its own guidelines for collection of water/wastewater samples titled as 'Sampling Protocol for Water & Wastewater'; which has been approved by the Government of Gujarat vide letter no. ENV-102013-299-E dated 24-04-2014 under the provision of Water (Preservation and Control of Pollution) Act 1974. The sample collection and preservation are done as per the said Protocol. Under the project, the list of parameters to be monitored for the STP have been mentioned in **Table 26** as follows:

Frequency

Monitoring is required to be carried out once a week for monitoring location of Kandla and Vadinar i.e., two STP station at Kandla and one STP station at Vadinar.

Table 26: List of parameters monitored for STP's at Kandla and Vadinar

Sr. No.	Parameters	Units	Reference method	Instruments
1.	pH	-	APHA, 23 rd edition, 4500- H ⁺ B, 2017	pH Meter
2.	TDS	mg/L	APHA, 23 rd Edition, 2540 C: 2017	Vacuum Pump with filtration assembly and Oven
3.	TSS	mg/L		
4.	DO	mg/L	APHA, 23 rd Edition, 4500 C: 2017	Titration Apparatus
5.	COD	mg/L	APHA, 23 rd Edition, 5220 B: 2017	Titration Apparatus plus Digester
6.	BOD	mg/L	IS-3025, Part 44, 1993	BOD Incubator plus Titration Apparatus
7.	SAR	meq/L	IS 11624: 2019	Flame Photometer
8.	Total Coliforms	MPN/100ml	IS 1622: 2019	LAF/ Incubator

9.2 Result and Discussion

Analytical results of the STP samples collected from the inlet and the outlet of the STP's of Kandla and Vadinar have been summarized in **Table 27 & 28**. Further it was compared with the standard norms specified in the CC&A of the respective STPs.



Table 27: Water Quality of inlet and outlet of STP of Kandla

Sr No.	Parameter	Units	GPCB Norms (Kandla)	Kandla															
				Week 3 of December				Week 4 of December				Week 1 of January				Week 2 of January			
				STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)	STP-1 (Inlet)	STP-1 (Outlet)	STP-2 (Inlet)	STP-2 (Outlet)
1.	pH	-	6.5-8.5	7.14	7.12	7.17	7.23	7.1	7.08	7.01	7.38	7.20	7.11	7.07	7.41	7.45	7.16	7.08	7.40
2.	TDS	mg/L	-	1352	1321	1398	1518	1458	1324	1464	1450	1358	1316	1430	1390	1467	1364	1340	1410
3.	TSS	mg/L	100	31	20	108	16	41	16	70	12	64	14	220	18	48	12	280	26
4.	COD	mg/L	-	180	73.2	316.0	48.0	248	164	247.0	51.8	176.7	72.3	441.3	72.9	196.0	56.0	842.0	76.6
5.	DO	mg/L	-	BQL	3.2	BQL	3.7	BQL	1.5	BQL	1.7	BQL	3.4	BQL	1.7	BQL	2.5	BQL	2.0
6.	BOD	mg/L	30	42.58	26.8	98.75	6.0	36.54	12.74	77.19	6.47	29.46	9.04	132.39	7.29	45.34	8.40	252.60	7.66
7.	SAR	meq/L	-	11.15	9.30	7.56	9.14	9.87	5.68	5.90	4.62	9.36	8.68	8.65	10.82	12.32	10.10	6.99	6.94
8.	Total Coliforms	MPN/100ml	<1000	1600	240	1600	1600	1600	280	1600	1600	1600	1600	1600	1600	1600	1600	1600	1600

Table 28: Water Quality of inlet and outlet of STP of Vadinar

Sr No.	Parameter	Units	GPCB Norms (Vadinar)	Week 3 of December		Week 4 of December		Week 1 of January		Week 2 of January	
				STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)	STP-3 (Inlet)	STP-3 (Outlet)
1.	pH	-	6.5-8.5	7.28	7.44	7.15	7.20	6.52	7.12	7.03	7.16
2.	TDS	mg/L	-	408	382	488	374	418	362	424	358
3.	TSS	mg/L	20	8	4	72	10	90	6	38	4
4.	COD	mg/L	50	168.0	56.0	293.2	52.2	498.0	32.4	196.8	36.1
5.	DO	mg/L	-	1.2	8.4	0.7	7.0	BQL	6.0	1.5	6.9
6.	BOD	mg/L	10	50.40	5.60	91.63	6.53	149.40	3.24	59.04	3.61
7.	SAR	meq/L	-	2.21	2.60	1.37	2.31	2.13	2.21	2.45	1.96
8.	Total Coliforms	MPN/100ml	100-230	1600	1600	1600	1600	1600	1600	1600	1600

BQL: Below Quantification limit; Total Suspended Solids (QL=2), Dissolved Oxygen (QL=0.5), Biochemical Oxygen Demand (QL=3 mg/L)

9.3 Data Interpretation and Conclusion

For physicochemical analysis, the treated sewage water was gathered from the Kandla STP, Gopalpuri STP, and Vadinar STP and the analytical results were compared with the standards mentioned in the Consolidated Consent and Authorization (CC&A) by GPCB.

- The **pH** of treated effluent from STPs at Kandla (STP-1 and STP-2) and Vadinar (STP-3) conform to their respective stipulated norms of **7.08 to 7.41** at Kandla and **7.12 to 7.44** at Vadinar respectively.
- The **TDS** of treated sewage at Kandla was ranges from **1316 to 1518 mg/L**, whereas for Vadinar it ranges from **358 to 382 mg/L**.
- The **TSS** of the Treated effluent for the STP-1 and STP-2 at Kandla and STP-3 at Vadinar falls within the stipulated norms of **4 and 26 mg/L** respectively as mentioned in their respective CCA.
- **COD** value for Kandla was observed in the range of **48 to 164 mg/L**. Whereas for Vadinar the value of COD falls within the range of **32.4 to 56 mg/L**.
- The value of **DO** was observed in the range of **1.50 to 3.70 mg/L** at Kandla, whereas for Vadinar it was observed in the range of **6.0 to 8.4 mg/L**.
- The **BOD** of the outlet for the STPs of Kandla and Vadinar falls within the stipulated norms.
- The value of **SAR** for Kandla was observed in the range of **4.62 to 10.82 meq/L**, whereas for Vadinar, it was observed in the range of **1.96 to 2.6 meq/L**.
- The value of **Total Coliforms** for Kandla was observed in the range of **240 to 1600 MPN/100 ml**, whereas for Vadinar, it was observed in the range of **1600 MPN/100 ml**.

During the monitoring period, only Total Coliforms were observed to be exceeding the limits at STPs of Kandla and Vadinar while rest of the treated sewage parameters for STP outlet were within norms as specified under the CCA at both the monitoring sites. Regular monitoring of the STP performance should be conducted on regular basis to ensure adequate treatment as per the norms.

9.4 Remedial Measures:

- The quantum of raw sewage (influent) entering the STP should be monitored by installation of the flow meter. If the quantity of the sewage exceeds the treatment capacity of the treatment plant, then provision of additional capacity of collection sump should be provided.
- The adequacy and efficacy of the stages of Sewage treatment units shall be conducted.
- The results show the presence of total coliforms; hence the method of disinfection (Chlorination) sodium or calcium Hypochlorite can be used.
- Effectiveness of any technology depends on factors such as the specific pollutants in the wastewater, plant size, local regulations, and available resources. There are several processes that may be implemented such as - Advanced oxidation process involve using strong oxidants to break down complex organic compounds. Methods like Fenton's reagent (hydrogen peroxide and iron catalyst) and UV/H₂O₂ treatment can help in reducing COD through oxidation.

- Electrochemical processes like Electrocoagulation (EC) and Electrooxidation (EO) that involve the application of an electric current to facilitate the removal of pollutants through coagulation, flocculation, and oxidation. These methods can be useful for treating sewage containing various pollutants.

CHAPTER 10: MARINE WATER QUALITY MONITORING

10.1 Marine Water

Deendayal Port is one of the largest ports of the country and thus, is engaged in wide variety of activities such as movement of large vessels, oil tankers and its allied small and medium vessels and handling of dry cargo several such activities whose waste if spills in water, can cause harmful effects to marine water quality.

Major water quality concerns at ports include wastewater and leakage of toxic substances from ships, stormwater runoff, etc. This discharge of wastewater, combined with other ship wastes which includes sewage and wastewater from other on-board uses, is a serious threat to the water quality as well as to the marine life. As defined in the scope by DPA, the Marine Water sampling and analysis has to be carried out at a total of eight locations, six at Kandla and two at Vadinar. The marine water sampling has been carried out with the help of Niskin Sampler with a capacity of 5L. The Niskin Sampler is a device used to take water samples at a desired depth without the danger of mixing with water from other depths. Details of the locations to be monitored have been mentioned in **Table 29**:

Table 29: Details of the sampling locations for Marine water

Sr. No.	Location Code	Location Name	Latitude Longitude
1.	Kandla	MW-1	Near Passenger Jetty One
2.		MW-2	Kandla Creek (nr KPT Colony)
3.		MW-3	Near Coal Berth
4.		MW-4	Khori Creek
5.		MW-5	Nakti Creek (nr Tuna Port)
6.		MW-6	Nakti Creek (nr NH-8A)
7.	Vadinar	MW-7	Near SPM
8.		MW-8	Near Vadinar Jetty

The map depicting the locations of Marine Water to be sampled and analysed for Kandla and Vadinar have been mentioned in **Map 16 and 17** as follows:



Map 16: Locations for Marine Water Monitoring at Kandla



Map 17: Locations for Marine Water Monitoring at Vadinar

Methodology

The methodology adopted for the sampling and monitoring of Marine Water was carried out as per the '**Sampling Protocol for Water & Wastewater**' developed by GEMI. The water samples collected through the Niskin Sampler are collected in a clean bucket to reduce the heterogeneity. The list of parameters to be monitored under the project for the Marine Water quality have been mentioned in **Table 30** along with the analysis method and instrument.

Frequency:

As defined in the scope by DPA, the sampling and analysis of Marine Water has to be carried out once in a month at the eight locations (i.e., six at Kandla and two at Vadinar).

Table 30: List of parameters monitored for Marine Water

Sr. No	Parameters	Units	Reference method	Instrument
1.	Electrical Conductivity	μS/cm	APHA, 23 rd Edition (Section-2510 B):2017	Conductivity Meter
2.	Dissolved Oxygen (DO)	mg/L	APHA, 23 rd Edition, 4500 O C, 2017	Titration Apparatus
3.	pH	-	APHA, 23 rd Edition (Section-4500-H+B):2017	pH meter
4.	Color	Hazen	APHA, 23 rd Edition, 2120 B: 2017	Color comparator
5.	Odour	-	IS 3025 Part 5: 2018	Heating mantle & odour bottle
6.	Turbidity	NTU	IS 3025 Part 10: 1984	Nephlo Turbidity Meter
7.	Total Dissolved Solids (TDS)	mg/L	APHA, 23 rd Edition (Section-2540 C):2017	Vaccum Pump with Filtration Assembly and Oven
8.	Total Suspended Solids (TSS)	mg/L	APHA, 23 rd Edition, 2540 D: 2017	
9.	Particulate Organic Carbon	mg/L	APHA, 23 rd Edition, 2540 D and E	TOC analyser
10.	Chemical Oxygen Demand (COD)	mg/L	IS-3025, Part- 58: 2006	Titration Apparatus plus Digester
11.	Biochemical Oxygen Demand (BOD)	mg/L	IS-3025, Part 44,1993,	BOD Incubator plus Titration apparatus
12.	Silica	mg/L	APHA, 23 rd Edition, 4500 C, 2017	UV- Visible Spectrophotometer
13.	Phosphate	mg/L	APHA, 23 rd Edition, 4500 P-D: 2017	
14.	Sulphate	mg/L	APHA, 23 rd Edition, 4500 SO4-2 E: 2017	
15.	Nitrate	mg/L	APHA, 23 rd Edition, 4500 NO3-B: 2017	

Sr. No	Parameters	Units	Reference method	Instrument
16.	Nitrite	mg/L	APHA, 23 rd Edition, 4500 NO2- B: 2017	
17.	Sodium	mg/L	APHA, 23 rd Edition, 3500 Na-B: 2017	Flame photometer
18.	Potassium	mg/L	APHA, 23 rd Edition, 3500 K-B: 2017	
19.	Manganese	µg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
20.	Iron	mg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	
21.	Total Chromium	µg/L	APHA, 23 rd Edition, 3500 Cr B: 2017	
22.	Hexavalent Chromium	µg/L		UV- Visible Spectrophotometer
23.	Copper	µg/L	APHA, 23 rd Edition, ICP Method 3120 B: 2017	ICP-OES
24.	Cadmium	µg/L		
25.	Arsenic	µg/L		
26.	Lead	µg/L		
27.	Zinc	mg/L		
28.	Mercury	µg/L	EPA 200.7	
29.	Floating Material (Oil grease scum, petroleum products)	mg/L	APHA, 23 rd Edition, 5520 C: 2017	Soxhlet Assembly
30.	Total Coliforms (MPN)	MPN/ 100ml	IS 1622: 2019	LAF/ Incubator

10.2 Result and Discussion

The quality of the Marine water samples collected from the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 31**. The said water quality has been represented in comparison with the standard values as stipulated by CPCB for Class SW-IV Waters.

Table 31: Results of Analysis of Marine Water Sample for the sampling period

Sr. No	Parameters	Unit	Primary Water Quality Criteria for Class SW-IV Waters	Kandla						Vadinar	
				MW-1	MW-2	MW-3	MW-4	MW-5	MW-6	MW-7	MW-8
1.	Density	kg/m ³	-	1.021	1.02	1.02	1.021	1.022	1.021	1.02	1.021
2.	pH	-	6.5-9.0	8.13	8.11	8.19	8.24	8.12	8.2	8.19	8.24
3.	Color	Hazen	No Noticeable	5	5	5	5	5	5	5	5
4.	EC	μS/cm	-	51,500	52,300	54,100	54,300	52,400	51,800	54,100	54,300
5.	Turbidity	NTU	-	97	125	4.12	3.42	131	112	4.12	3.42
6.	TDS	mg/L	-	33,326	37,182	32,478	33,142	34,109	33,806	32,478	33,142
7.	TSS	mg/L	-	347	421	115	195	332	411	115	195
8.	COD	mg/L	-	32.7	30.9	47.89	51.26	31.56	33.11	47.89	51.26
9.	DO	mg/L	3.0 mg/L	5.9	6.3	6.1	5.7	6.1	5.8	6.1	5.7
10.	BOD	mg/L	5.0 mg/L	8.15	8.3	7.42	7.13	10.2	9.92	7.42	7.13
11.	Oil & Grease	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
12.	Sulphate	mg/L	-	2364.6	2684.7	2897.4	3157.3	2739.8	2457.3	2897.4	3157.3
13.	Nitrate	mg/L	-	4.63	3.48	3.41	2.980	3.86	4.12	3.41	2.980
14.	Nitrite	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
15.	Phosphate	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
16.	Silica	mg/L	-	3.01	2.71	0.93	0.79	3.83	2.76	0.93	0.79
17.	Sodium	mg/L	-	9485	9206	9,827	9,541	9642	9468	9,827	9,541
18.	Potassium	mg/L	-	360.21	320	421.7	391.40	347.60	247.67	421.7	391.40
19.	Hexavalent Chromium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
20.	Odour	-	-	1	1	1	1	1	1	1	1
21.	Arsenic	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
22.	Cadmium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
23.	Copper	mg/L	-	BQL	6.22	BQL	BQL	6.68	BQL	BQL	BQL
24.	Iron	mg/L	-	1.831	2.281	0.586	0.378	1.819	2.192	0.586	0.378
25.	Lead	mg/L	-	3.16	3.22	2.412	2.984	2.41	3.36	2.412	2.984
26.	Manganese	mg/L	-	92.18	134.29	42.57	BQL	92.74	116.68	42.57	BQL
27.	Total Chromium	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
28.	Zinc	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
29.	Mercury	mg/L	-	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
30.	Particulate Organic Carbon	mg/L	-	1.08	0.68	0.55	0.72	0.98	1.18	0.65	0.72
31.	Total Coliforms	MPN/100ml	500/100 ml	16	15	10	24	10	15	10	24

Sr. No.	Parameters	Unit	Primary Water Quality Criteria for Class SW-IV Waters	Kandla						Vadinar	
				MW-1	MW-2	MW-3	MW-4	MW-5	MW-6	MW-7	MW-8
32.	Floating Material (Oil grease scum, petroleum products)	mg/L	10 mg/L	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL

10.3 Data Interpretation and Conclusion

The Marine water quality of Deendayal Port Harbor waters at Kandla and Vadinar has been monitored for various physico-chemical and biological parameters during the monitoring period. The detailed interpretation of the parameters in comparison to the Class SW-IV for Harbour Waters is as follows:

- **Density** at Kandla was observed in the range of **1.20 to 1.023 kg/m³**, with the average of **1.021 kg/m³**. Whereas for the location of Vadinar, it was observed **1.020 kg/m³** at MW-7 and **1.021 kg/m³** at MW-8, with the average of **1.020 kg/m³**.
- **pH** at Kandla was observed in the range of **8.04 to 8.21**, with the average pH as **8.13**. Whereas for the locations of Vadinar, it was observed in the range of be **8.19 to 8.24**, with the average pH as **8.21**. For the monitoring location of both the study areas, pH was found to comply with the norms of 6.5-8.5.
- **Color** range varied from **5 Hazen** at all the monitoring locations in Kandla, and for Vadinar, it found **5 Hazen** for the both of the location.
- **Electrical conductivity (EC)** was observed in the range of **51,400 to 52,400 µS/cm**, with the average EC as **51,850 µS/cm** for the locations of Kandla, whereas for the locations of Vadinar, it was observed in the range of **54,100 to 54,300 µS/cm**, with the average EC as **54,200 µS/cm**.
- For all monitoring locations of Kandla the value of **Turbidity** was observed in the range of **97 to 210 NTU**, with average value of **137.08 NTU**. For Vadinar it ranges from **4.12 to 3.42 NTU**, with average of **3.77 NTU**. Materials that cause water to be turbid include clay, silt, finely divided organic and inorganic matter, soluble coloured organic compounds, plankton and microscopic organisms. Turbidity affects the amount of light penetrating to the plants for photosynthesis.
- For the monitoring locations at Kandla the value of **Total Dissolved Solids (TDS)** ranged from **32,189 to 37,182 mg/L**, with an average value of **34048.66 mg/L**. Similarly, at Vadinar, the TDS values ranged from **32,478 to 33,142 mg/L**, with an average value of **32,810 mg/L**.
- **TSS** values in the studied area varied between **289 to 421 mg/L** at Kandla and **115 to 195 mg/L** at Vadinar, with the average value of **363.5 mg/L** and **155 mg/L** respectively for Kandla and Vadinar.

- **COD** varied between **30.9 to 33.11 mg/L** at Kandla and **47.89 to 51.26 mg/L** at Vadinar, with the average value as **31.98 and 49.57 mg/L** respectively for Kandla and Vadinar.
- **DO** level in the studied area varied between **5.8 to 6.3 mg/L** at Kandla and **5.7 to 6.1 mg/L** at Vadinar, with the average value of **6.01 mg/L and 5.9 mg/L** respectively for Kandla and Vadinar. Which represents that the marine water is suitable for marine life.
- **BOD** observed was observed in the range of **8.15 to 10.2 mg/L**, with average of **8.95 mg/L** for the location of Kandla and for the locations of Vadinar, it was observed in the range of **7.42 to 7.13 mg/L**, with an average value of **7.27 mg/L**.
- **Sulphate** concentration in the studied area varied between **2364.6 to 3246.3 mg/L** at Kandla and **2897.4 to 3157.3 mg/L** at Vadinar. The average value observed at Kandla was **2680.63 mg/L**, whereas **3027.35 mg/L** was the average value of Vadinar. Sulphate is naturally formed in inland waters by mineral weathering or the decomposition and combustion of organic matter.
- **Nitrate** in the study area was observed in the range of **3.38 to 4.89 mg/L**, with the average of **4.06 mg/L**. Whereas for the Vadinar, recorded value was observed in the range of **2.98 to 3.41 mg/L**, with the average of **3.19 mg/L**.
- In the study area of Kandla the concentration of **Potassium** varied between **247.67 to 360.21 mg/L** and **391.40 to 421.70 mg/L** at Vadinar, with the average value as **324.88 mg/L and 406.55 mg/L** respectively for Kandla and Vadinar.
- **Silica** in the studied area varied between **2.71 to 3.83 mg/L**, with the average of **3.10 mg/L**, at Kandla. Vadinar, observed value was found to be **0.93 mg/L** at location MW-7 and **0.79 mg/L** at MS-8 location.
- **Sodium** in the study area varied between **9206 to 9887 mg/L**, with average of **9513.83 mg/L**, at Kandla whereas at Vadinar the sodium concentration value was observed in the range of **9541 to 9827 mg/L**, with the average value of **9684 mg/L**.
- **Odour** was observed **1** for all locations of Kandla and Vadinar.
- **Copper** at the Kandla and Vadinar location was detected **below the quantification limit (BQL)"** for the all-sampling location.
- **Iron** in the studied area varied between **1.749 to 2.431 mg/L**, with the average of **2.050 mg/L**, at Kandla, and for Vadinar value were recorded **0.586 mg/L** for location MW-7 and **0.378 mg/L** for location MW-8.
- **Lead** concentration varied **0.00241 to 0.00336 mg/L**, with an average of **0.00293 mg/L** at Kandla. At Vadinar location MW-7 observed **0.00241 mg/L** and MW-8 observed **0.00298 mg/L** with an average of **0.00269 mg/L**.
- **Manganese** in the studied area varied between **0.0921 to 0.134 mg/L**, with the average of **0.110 mg/L**, at Kandla. At Vadinar location MW-7 observed **0.0425 mg/L** and MW-8 observed **BQL**.
- **Particulate Organic Carbon** in the study area was observed in the range of **0.55 to 1.18**, with the average value of **0.86**. Whereas for the Vadinar, the value observed was **0.65** at MW-7 and **0.72** at MW-8, with the average of **0.68**.
- **Oil & Grease, Nitrite, Phosphate, Hexavalent Chromium, Arsenic, Cadmium, Total Chromium, Zinc, Mercury and Floating Material (Oil grease scum, petroleum**

products) were observed to have concentrations “**Below the Quantification Limits (BQL)**” for most of the locations of Kandla and Vadinar.

- **Total Coliforms** were detected complying with the specified norm of 500 MPN/100ml for all the locations of Kandla and Vadinar.

During the Monitoring period, marine water samples were analysed and found in line with Primary Water Quality criteria for class-IV Waters (For Harbour Waters).

However, as a safeguard towards marine water pollution prevention, appropriate regulations on ship discharges and provision of reception facilities are indispensable for proper control of emissions and effluent from ships. Detection of spills is also important for regulating ship discharges. Since accidental spills are unavoidable, recovery vessels, oil fences, and treatment chemicals should be prepared with a view to minimizing dispersal. Proper contingency plans and a prompt reporting system are keys to prevention of oil dispersal. Periodical clean-up of floating wastes is also necessary for preservation of port water quality.

CHAPTER 11: MARINE SEDIMENT QUALITY MONITORING

11.1 Marine Sediment Monitoring

Marine sediment, or ocean sediment, or seafloor sediment, are deposits of insoluble particles that have accumulated on the seafloor. These particles have their origins in soil and rocks and have been transported from the land to the sea, mainly by rivers but also by dust carried by wind. The unconsolidated materials derived from pre-existing rocks or similar other sources by the process of denudation are deposited in water medium are known as sediment. For a system, like a port, where large varieties of raw materials and finished products are handled, expected sediment contamination is obvious.

The materials or part of materials spilled over the water during loading and unloading operations lead to the deposition in the harbour water along with sediment and thus collected as harbour sediment sample. These materials, serve as receptor of many trace elements, which are prone to environment impact. In this connection it is pertinent to study the concentration and distribution of environmentally sensitive elements in the harbour sediment. However, human activities result in accumulation of toxic substances such as heavy metals in marine sediments. Heavy metals are well-known environmental pollutants due to their toxicity, persistence in the environment, and bioaccumulation. Metals affect the ecosystem because they are not removed from water by self-purification, but accumulate in sediments and enter the food chain.


Methodology

As defined in the scope by DPA, the Marine Sediment sampling is required to be carried out once in a month at total eight locations, i.e., six at Kandla and two at Vadinar. The sampling of the Marine Sediment is carried out using the Van Veen Grab Sampler (make Holy Scientific Instruments Pvt. Ltd). The Van Veen Grab sampler is an instrument to sample (disturbed) sediment up to a depth of 20-30 cm into the sea bed. While letting the instrument down on the seafloor, sediment can be extracted. The details of locations of Marine Sediment to be monitored under the study are mentioned in **Table 32** as follows:


Table 32: Details of the sampling locations for Marine Sediment

Sr. No	Location Code	Location Name	Latitude Longitude
1.	Kandla	MS-1	Near Passenger Jetty One
2.		MS-2	Kandla Creek
3.		MS-3	Near Coal Berth
4.		MS-4	Khori Creek
5.		MS-5	Nakti Creek (near Tuna Port)
6.		MS-6	Nakti Creek (near NH-8A)
7.	Vadinar	MS-7	Near SPM
8.		MS-8	Near Vadinar Jetty

The map depicting the locations of Marine Sediment sampling at Kandla and Vadinar have been mentioned in **Map 18 and 19** as follows:

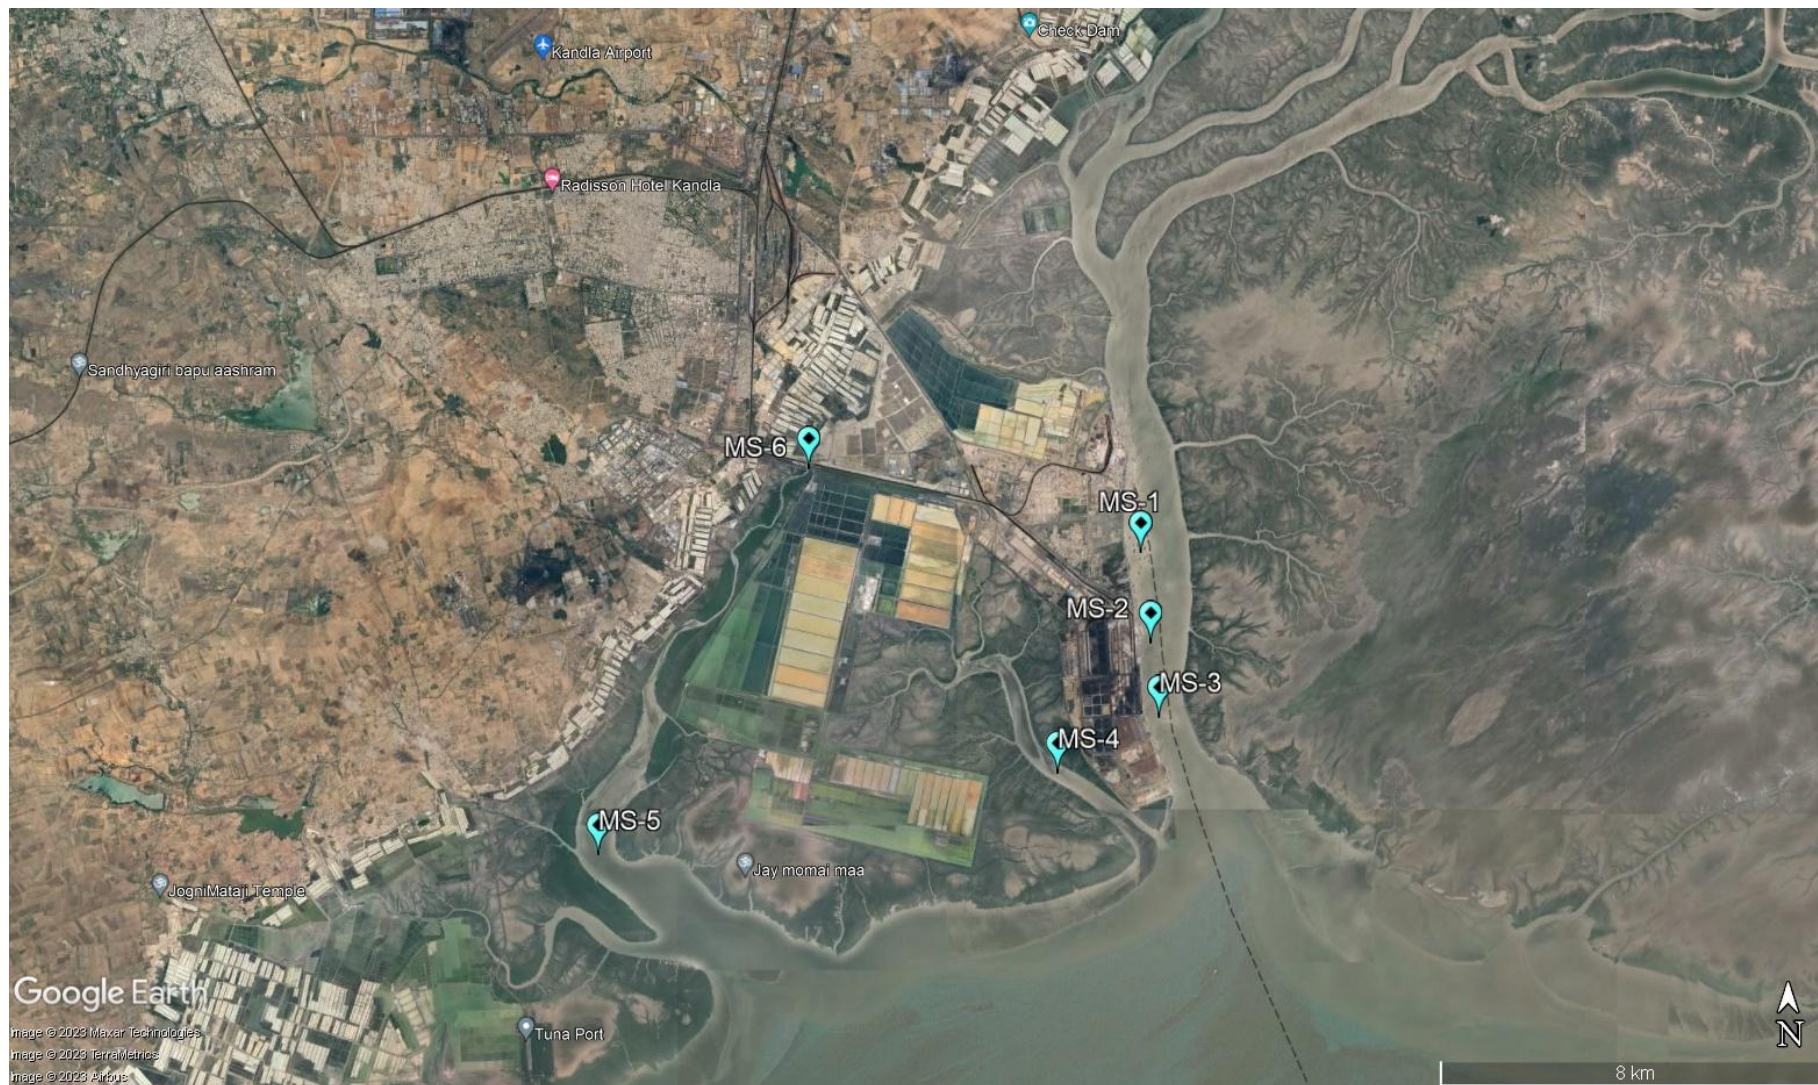

Map 18: Location of Marine Sediment Monitoring at Kandla

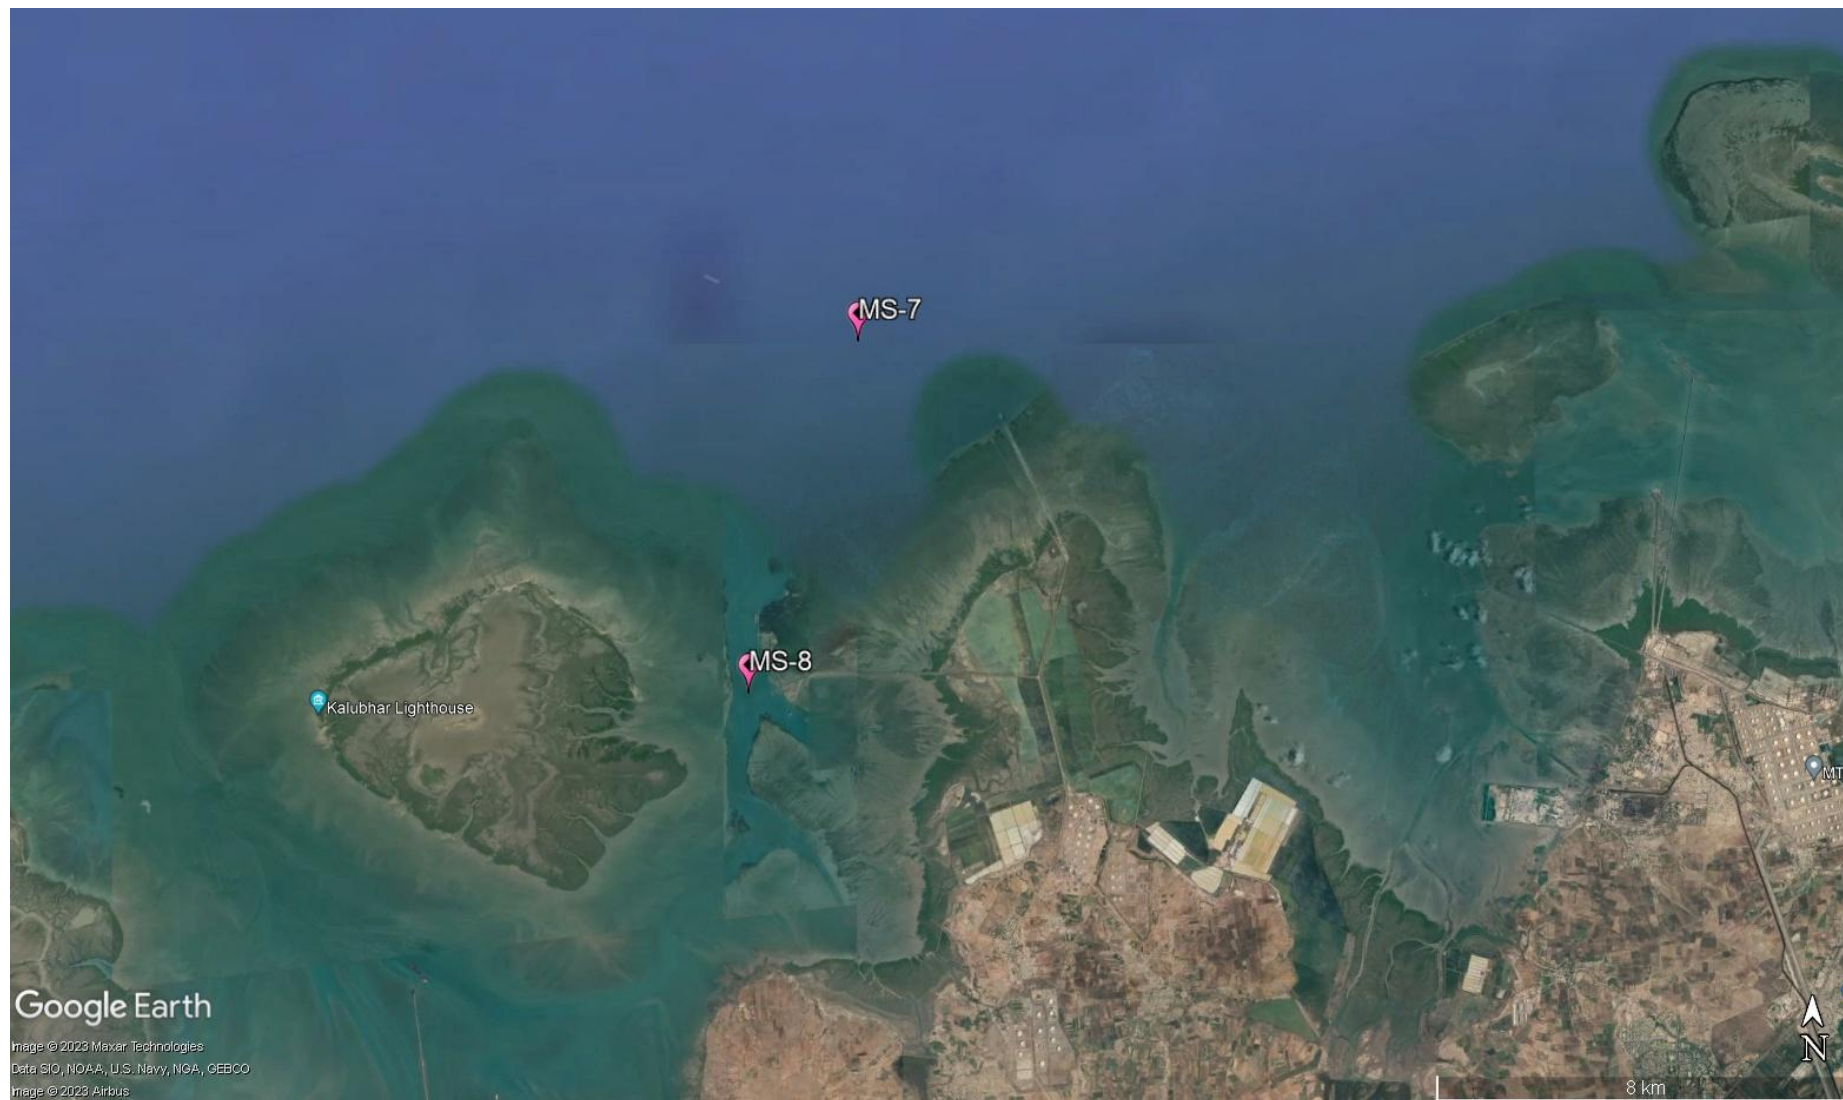

Map 19: Locations of Marine Sediment Monitoring at Vadinar

The list of parameters to be monitored under the projects for the Marine Sediment sampling been mentioned in **Table 33** as follows:

Table 33: List of parameters to be monitored for Sediments at Kandla and Vadinar

Sr. No.	Parameters	Units	Reference method	Instruments
1.	Texture		Methods Manual Soil Testing in India January 2011,01	Hydrometer
2.	Organic Matter	%	Methods Manual Soil Testing in India January, 2011, 09. Volumetric method (Walkley and Black, 1934)	Titration apparatus
3.	Inorganic Phosphates	mg/Kg	Practical Manual Chemical Analysis of Soil and Plant Samples, ICAR-Indian Institute of Pulses Research 2017	UV- Visible Spectrophotometer
4.	Silica	mg/Kg	EPA METHOD 6010 C & IS: 3025 (Part 35) - 1888, part B	
5.	Phosphate	mg/Kg	EPA Method 365.1	
6.	Sulphate as SO ⁴⁻	mg/Kg	IS: 2720 (Part 27) - 1977	
7.	Nitrite	mg/Kg	ISO 14256:2005	
8.	Nitrate	mg/Kg	Methods Manual Soil Testing in India January, 2011, 12	
9.	Calcium as Ca	mg/Kg	Methods Manual Soil Testing in India January 2011, 16.	Titration Apparatus
10.	Magnesium as Mg	mg/Kg	Method Manual Soil Testing in India January 2011	
11.	Sodium	mg/Kg	EPA Method 3051A	Flame Photometer
12.	Potassium	mg/Kg	Methods Manual Soil Testing in India January, 2011	
13.	Aluminium	mg/Kg	EPA Method 3051A	ICP-OES
14.	Chromium	mg/Kg		
15.	Nickel	mg/Kg		
16.	Zinc	mg/Kg		
17.	Cadmium	mg/Kg		
18.	Lead	mg/Kg		
19.	Arsenic	mg/Kg		
20.	Mercury	mg/Kg		

11.2 Result and Discussion

The quality of Marine Sediment samples collected from the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 34**.

Table 34: Summarized result of Marine Sediment Quality

Sr No.	Parameters	Unit	Kandla						Vadinar	
			MS-1	MS-2	MS-3	MS-4	MS-5	MS-6	MS-7	MS-8
1.	Inorganic Phosphate	kg/ ha	4.41	10.27	22.43	8.63	15.6	14.5	3.16	2.17
2.	Phosphate	mg/Kg	1055.2	1862.2	1586.7	653.7	816.3	667.1	203.5	247.4
3.	Organic Matter	%	0.81	0.31	0.27	0.51	0.73	0.33	0.65	0.87
4.	Sulphate as SO ⁴⁻	mg/Kg	190.09	170.70	210.19	155.27	92.28	101.26	84.17	115.9
5.	Calcium as Ca	mg/Kg	2165.50	2439.90	1890.90	2947.40	1693.10	2368.70	2427.7	2389.6
6.	Magnesium as Mg	mg/Kg	1584.50	1725.00	1826.00	1623.00	1421.10	1089.30	1198.2	1478
7.	Silica	g/Kg	582.9	476.3	421.3	291.71	236.4	325.63	290.1	408.3
8.	Nitrite	mg/Kg	0.32	0.64	0.39	0.41	0.49	0.59	0.16	0.3
9.	Nitrate	mg/Kg	21.48	18.36	29.31	23.63	14.51	16.13	13.2	7.96
10.	Sodium	mg/Kg	3514	2453	2619	3219	3442	2916	6136	8643
11.	Potassium	mg/Kg	2084	1967.9	2819	3071.2	2741	2613.7	2938	2481
12.	Copper	mg/Kg	2283.3	1826.7	1278.5	2379.5	1628.3	1347.8	1493.78	1681.39
13.	Aluminium	mg/Kg	49.51	38.7	36.83	49.1	47.2	51.3	53.6	29.7
14.	Chromium	mg/Kg	3.11	3.57	4.07	3.91	4.97	5.27	4.58	3.78
15.	Nickel	mg/Kg	43.35	38.9	21.47	28.11	22.64	24.39	14.79	26.87
16.	Zinc	mg/Kg	61.16	54.6	49.3	47.7	51.26	40.65	23.68	42.96
17.	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
18.	Lead	mg/Kg	4.97	5.02	3.84	5.11	4.76	4.26	4.76	5.22
19.	Arsenic	mg/Kg	4.47	2.55	5.2	3.63	2.98	3.21	2.83	3.42
20.	Mercury	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL
21.	Texture	-	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Sandy loam	Loam

11.3 Data Interpretation and Conclusion

The Marine sediment quality at Kandla and Vadinar has been monitored for various physico-chemical parameters during the monitoring 2024. The detailed interpretation of the parameters is given below:

- **Inorganic Phosphate** for the sampling period was observed in range of **4.41 to 22.43** Kg/ha for Kandla. Whereas for Vadinar the value observed at location MS-7 (Nakti creek) is 3.16 Kg/ha and MS-8 (Near Vadinar Jetty) is 2.17 Kg/ha. For Kandla and Vadinar the average value of Inorganic Phosphate was observed 12.64 and 2.66 Kg/ha respectively.
- The concentration of **Phosphate** was observed in range of **653.7 to 1862.2 mg/Kg** for Kandla and for Vadinar the value observed at location MS-7 (Nakti creek) as 203.5 mg/Kg and MS-8 (Near Vadinar Jetty) as 247.4 mg/Kg. For Kandla and Vadinar the average concentration of Phosphate was observed 1106.86 and 225.45 mg/Kg respectively.

- The **Organic Matter** for the sampling period was observed in the range of **0.27 to 0.81 %** for Kandla with the average value of 0.49% and for Vadinar the value recorded at location MS-7 and MS-8 was observed 0.65% & 0.87% respectively, with average concentration as 0.76 %.
- The concentration of **Sulphate** was observed in the range of **92.28 to 210.19 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 84.17 mg/Kg and at MS-8 is 115.9 mg/Kg. For Kandla and Vadinar the average value of Sulphate was observed 153.29 and 100.03 mg/Kg respectively.
- The value of **Calcium** was observed in the range of **1693.1 to 2947.4 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 2427.7 mg/Kg and at MS-8, is 2389.65 mg/Kg. The average value of Calcium for the monitoring period was observed 2250.91 mg/Kg and 2408.65 mg/Kg at Kandla and Vadinar, respectively.
- The value of **Magnesium** for the sampling period was observed in the range of **1089.3 to 1826 mg/Kg** for Kandla and for Vadinar the value observed at MS-7 is 1198.2 mg/Kg and at MS-8, is 1478 mg/Kg. For Kandla and Vadinar the average value of Magnesium was observed 1544.81 mg/Kg and 1338.1 mg/Kg respectively.
- For the sampling period **Silica** was observed in the range of **236.4 to 582.9 mg/Kg** for Kandla with average value 389.04 mg/Kg and for Vadinar the value observed to be 290.1 and 408.3 mg/Kg at MS-7 and MS-8, respectively with average 349.2 mg/Kg.
- The value of **Nitrate** was observed in the range of **14.51 to 29.31 mg/Kg** for Kandla with average value 20.57 mg/Kg and for Vadinar the value observed to be 13.2 and 7.96 mg/Kg at MS-7 and MS-8, respectively with average 10.58 mg/Kg.
- The value of **Nitrite** was observed in the range of **0.32 to 0.64 mg/Kg** for Kandla with average value 0.47 mg/Kg and for Vadinar the value observed to be 0.16 and 0.30 mg/Kg at MS-7 and MS-8, respectively with average 0.23 mg/Kg.
- The value of **Sodium** was observed in the range of **2453 to 3514 mg/Kg** for Kandla with average value 3027.16 mg/Kg and for Vadinar the value observed to be 6136 and 8643 mg/Kg at MS-7 and MS-8, respectively with average 7389.5 mg/Kg.
- The value of **Potassium** was observed in the range of **1967.9 to 3071.2 mg/Kg** for Kandla with average value 2549.46 mg/Kg and for Vadinar the value observed to be 2938 and 2481 mg/Kg at MS-7 and MS-8, respectively with average 2709.5 mg/Kg.
- The value of **Aluminium**, was observed in the range of **1278.5 to 2379.5 mg/Kg** for Kandla with average value 1790.68 mg/Kg and for Vadinar the value observed to be 1493.78 and 1681.39 mg/Kg at MS-7 and MS-8, respectively with average 1587.58 mg/Kg.
- The value of **Mercury** was observed “Below the Quantification Limit” at all the eight-monitoring location of Kandla and Vadinar.
- Texture was observed to be “**Sandy Loam**” at location MS-1, MS-2, MS-3, MS-4, MS-5, MS-6 in Kandla. “**Sandy Loam**” at location MS-7 & “**loam**” at location MS-8 in Vadinar during sampling period.

Heavy Metals

The sediment quality of Kandla and Vadinar has been compared with respect to the Average Standard guideline applicable for heavy metals in marine sediment specified by EPA have been mentioned in **Table 35**.

Table 35: Standard Guidelines applicable for heavy metals in sediments

Sr. No.	Metals	Sediment quality (mg/kg)			Source
		Not polluted	Moderately polluted	Heavily polluted	
1.	As	<3	3-8	>8	EPA
2.	Cu	<25	25-50	>50	
3.	Cr	<25	25-75	>75	
4.	Ni	<20	20-50	>50	
5.	Pb	<40	40-60	>60	
6.	Zn	<90	90-200	>200	
7.	Cd	-	<6	>6	
ND = Not Detected					

(Source: G Perin et al. 1997)

Table 36: Comparison of Heavy metals with Standard value in Marine Sediment

Sr. No.	Parameters	Unit	Kandla						Vadinar	
			MS-1	MS-2	MS-3	MS-4	MS-5	MS-6	MS-7	MS-8
1.	Arsenic	mg/Kg	4.47	2.55	5.2	3.63	2.98	3.21	2.83	3.42
2.	Copper	mg/Kg	3.11	3.57	4.07	3.91	4.97	5.27	4.58	3.78
3.	Chromium	mg/Kg	49.51	38.7	36.83	49.1	47.2	51.3	53.6	29.7
4.	Nickel	mg/Kg	43.35	38.9	21.47	28.11	22.64	24.39	14.79	26.87
5.	Lead	mg/Kg	4.97	5.02	3.84	5.11	4.76	4.26	4.76	5.22
6.	Zinc	mg/Kg	72.65	61.16	54.6	49.3	47.7	51.26	23.68	42.96
7.	Cadmium	mg/Kg	BQL	BQL	BQL	BQL	BQL	BQL	BQL	BQL

- Arsenic** was observed in the range of **2.55 to 5.20 mg/Kg** for Kandla with average value 3.67 mg/Kg and for Vadinar the value observed to be 2.83 and 3.42 mg/Kg at MS-7 and MS-8, respectively with average 3.12 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to arsenic falls in moderately polluted class.
- Copper** was observed in the range of **3.11 to 5.27 mg/Kg** for Kandla with average value 4.15 mg/Kg and for Vadinar the value observed to be 4.58 and 3.78 mg/Kg at MS-7 and MS-8, respectively with average 4.18 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to copper falls in non-polluted class.
- Chromium** was observed in the range of **36.83 to 51.3 mg/Kg** for Kandla with average Value 45.44 mg/Kg and for Vadinar the value observed to be 53.6 and 29.7 mg/Kg at MS-7 and MS-8, respectively with average 41.65 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to chromium falls in moderately polluted class.

- **Nickel** was observed in the range of **21.47 to 43.35 mg/Kg** for Kandla with average value 29.81 mg/Kg and for Vadinar the value observed to be 14.79 and 26.87 mg/Kg at MS-7 and MS-8, respectively with average 20.83 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to nickel falls in moderately polluted class.
- **Lead** was observed in the range of **3.84 to 5.11 mg/Kg** for Kandla with average value 4.66 mg/Kg and for Vadinar the value observed to be 4.76 and 5.22 mg/Kg at MS-7 and MS-8, respectively with average 4.99 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to lead falls in Not polluted class.
- **Zinc** was observed in the range of **40.65 to 61.16 mg/Kg** for Kandla with average value 50.77 mg/Kg and for Vadinar the value observed to be 23.68 and 42.96 mg/Kg at MS-7 and MS-8, respectively with average 33.32 mg/Kg. With reference to the guidelines mentioned in table 35, the sediment quality with respect to zinc falls in non-polluted class.
- **Cadmium** was observed BQL for all locations at Kandla and Vadinar during sampling period. With reference to the guidelines mentioned in table 35, the sediment quality with respect to cadmium falls in non-polluted class.

Analysis of the sediments indicates moderate pollution. However, it may be noted that, the sediments are highly dynamic being constantly deposited and carried away by water currents. Hence maintaining the quality of sediments is necessary as it plays a significant role in regulating the quality of the marine water and the marine ecology.

The presence of anthropic activity in the coastal areas has an effect upon the marine water and sediment. One of the primary risks associated with contaminated sediments is bioaccumulation in benthic organisms, which is a route of entry into the food chain. Generally adopted sediment remediation approaches include dredging, capping of contaminated areas, and monitored natural recovery (MNR). Dredging can remove contaminated sediments, but it requires large areas of land for sediment disposal. It is expensive and may cause secondary contamination of the water column during re-suspension. MNR relies on ongoing naturally occurring processes to decrease the bioavailability or toxicity of contaminants in sediment. These processes may include physical, biological, and chemical mechanisms that act together to reduce the environmental risks posed by contaminated sediments. MNR require longer monitoring time and can be even more expensive than for dredging and capping. Capping consists of in situ covering of clean or suitable isolating material over contaminated sediments layer to limit leaching of contaminants, and to minimize their re-suspension and transport. Hence appropriate remedial measures for the polluted sediment sites may be implemented, to reduce the concentration of the heavy metals.



CHAPTER 12: MARINE ECOLOGY MONITORING

12.1 Marine Ecological Monitoring

The monitoring of the biological and ecological parameters is important in order to assess the marine environment. A marine sampling is an estimation of the body of information in the population. The theory of the sampling design is depending upon the underlying frequency distribution of the population of interest. The requirement for useful water sampling is to collect a representative sample of suitable volume from the specified depth and retain it free from contamination during retrieval. Deendayal Port and its surroundings have mangroves, mudflats and creek systems as major ecological entities. As defined in the scope by DPA, the Marine Ecological Monitoring is required to be carried out once a month specifically at eight locations, six at Kandla and two at Vadinar. The sampling of the Benthic Invertebrates has been carried out with the help of D-frame nets, whereas the sampling of zooplankton and phytoplankton has been carried out with the help of Plankton Nets (60 micron and 20 micron). The details of the locations of Marine Ecological Monitoring have been mentioned in **Table 37** as follows:

Table 37: Details of the sampling locations for Marine Ecological

Sr. No.	Location Code		Location Name	Latitude Longitude
1.	Kandla	ME-1	Near Passenger Jetty One	23.017729N 70.224306E
2.		ME-2	Kandla Creek (near KPT Colony)	23.001313N 70.226263E
3.		ME-3	Near Coal Berth	22.987752N 70.227923E
4.		ME-4	Khori Creek	22.977544N 70.207831E
5.		ME-5	Nakti Creek (near Tuna Port)	22.962588N 70.116863E
6.		ME-6	Nakti Creek (near NH - 8A)	23.033113N 70.158528E
7.	Vadinar	ME-7	Near SPM	22.500391N 69.688089E
8.		ME-8	Near Vadinar Jetty	22.440538N 69.667941E

The map depicting the locations of Marine Ecological monitoring in Kandla and Vadinar have been mentioned in **Map 20 and 21** as follows:



Map 20: Locations of Marine Ecological Monitoring at Kandla



Map 21: Locations of Marine Ecological Monitoring at Vadinar

The various parameters to be monitored under the study for Marine Ecological Monitoring are mentioned in **Table 38** as follows:

Table 38: List of parameters to be monitored for Marine Ecological Monitoring

Sr. No.	Parameters
1.	Productivity (Net and Gross)
2.	Chlorophyll-a
3.	Pheophytin
4.	Biomass
5.	Relative Abundance, species composition and diversity of phytoplankton
6.	Relative Abundance, species composition and diversity of zooplankton
7.	Relative Abundance, species composition and diversity of benthic invertebrates (Meio, Micro and macro benthos)
8.	Particulate Oxidisable Organic Carbon
9.	Secchi Depth

Methodology

- Processing for chlorophyll estimation:**

Samples for chlorophyll estimation were preserved in ice box on board in darkness to avoid degradation in opaque container covered with aluminium foil. Immediately after reaching the shore after sampling, 1 litre of collected water sample was filtered through GF/F filters (pore size 0.45 µm) by using vacuum filtration assembly. After vacuum filtration the glass micro fiber filter paper was grunted in tissue grinder, macerating of glass fiber filter paper along with the filtrate was done in 90% aqueous Acetone in the glass tissue grinder with glass grinding tube. Glass fiber filter paper will assist breaking the cell during grinding and chlorophyll content was extracted with 10 ml of 90% Acetone, under cold dark conditions along with saturated magnesium carbonate solution in glass screw cap tubes. After an extraction period of 24 hours, the samples were transferred to calibrated centrifuge tubes and adjusted the volume to original volume with 90% aqueous acetone solution to make up the evaporation loss. The extract was clarified by using centrifuge in closed tubes. The clarified extracts were then decanted in clean cuvette and optical density was observed at wavelength 664, 665 nm.

- Phytoplankton Estimation**

Phytoplankton are free floating unicellular, filamentous and colonial eutrophic organisms that grow in aquatic environments whose movement is more or less dependent upon water currents. These micro flora acts as primary producers as well as the basis of food chain, source of protein, bio-purifier and bio-indicators of the aquatic ecosystems of which diverse array of the life depends. They are considered as an important component of aquatic flora, play a key role in maintaining equilibrium between abiotic and biotic components of aquatic ecosystem. The phytoplankton includes a wide range of photosynthetic and phototrophic organisms. Marine

phytoplankton is mostly microscopic and unicellular floating flora, which are the primary producers that support the pelagic food-chain. The two most prominent groups of phytoplankton are Diatoms (*Bacillariophyceae*) and Dinoflagellates (*Dinophyceae*). Phytoplankton also include numerous and diverse collection of extremely small, motile algae which are termed micro flagellates (naked flagellates) as well as Cyanophytes (Bluegreen algae). Algae are an ecologically important group in most aquatic ecosystems and have been an important component of biological monitoring programs. Algae are ideally suited for water quality assessment because they have rapid reproduction rates and very short life cycles, making them valuable indicators of short-term impacts. Aquatic populations are impacted by anthropogenic stress, resulting in a variety of alterations in the biological integrity of aquatic systems. Algae can serve as an indicator of the degree of deterioration of water quality, and many algal indicators have been used to assess environmental status.

- **Zooplankton Estimation**

Zooplankton includes a taxonomically and morphologically diverse community of heterotrophic organisms that drift in the waters of the world's oceans. Qualitative and quantitative studies on zooplankton community are a prerequisite to delineate the ecological processes active in the marine ecosystem. Zooplankton community plays a pivotal role in the pelagic food web as the primary consumers of phytoplankton and act as the food source for organisms in the higher trophic levels, particularly the economically essential groups such as fish larvae and fishes. They also function in the cycling of elements in the marine ecosystem. The dynamics of the zooplankton community, their reproduction, and growth and survival rate are all significant factors determining the recruitment and abundance of fish stocks as they form an essential food for larval, juvenile and adult fishes. Through grazing in surface waters and following the production of sinking faecal matters and also by the active transportation of dissolved and particulate matter to deeper waters via vertical migration, they help in the transport of organic carbon to deep ocean layers and thus act as key drivers of 'biological pump' in the marine ecosystem. Zooplankton grazing and metabolism also, transform particulate organic matter into dissolved forms, promoting primary producer community, microbial demineralization, and particle export to the ocean's interior. The categorisation of zooplankton into various ecological groups is based on several factors such as duration of planktonic life, size, food preferences and habitat. As they vary significantly in size from microscopic to metazoic forms, the classification of zooplankton based on size has paramount importance in the field of quantitative plankton research.

- **Benthic Organisms Estimation**

Benthic macroinvertebrates are small aquatic animals and the aquatic larval stages of insects. They include dragonfly and stonefly larvae, snails, worms, and beetles. Use of benthic macroinvertebrates has been in vogue as indicator organisms for water quality monitoring since long. Traditional methods of water quality monitoring incorporates mostly monitoring of physicochemical parameters. Benthic macroinvertebrates are

majorly insects that dwell on the floor of water bodies. They are found in all water bodies, as they have a wide range of pollution tolerance among various species. The benthic macro-invertebrate's community structure depends on the exposure to pollution it receives. Benthic macroinvertebrates have been used as indicator organisms to measure the water quality of water bodies across the world. Evaluating the abundance and variety of benthic macroinvertebrates in a waterbody gives us an indication of the biological condition of that waterbody. Generally, waterbodies in healthy biological condition support a wide variety and high number of macroinvertebrate taxa, including many that are intolerant of pollution. Samples yielding only pollution-tolerant species or very little diversity or abundance may indicate a less healthy waterbody. Biological condition is the most comprehensive indicator of waterbody health. When the biology of a waterbody is healthy, the chemical and physical components of the waterbody are also typically in good condition.

- **Diversity Index**

A diversity index is a measure of species diversity within a community that consists of co-occurring populations of several (two or more) different species. It includes two components: richness and evenness. Richness is the measure of the number of different species within a sample showing that more the types of species in a community, the higher is the diversity or greater is the richness. Evenness is the measure of relative abundance of the different species with in a community.

1. **Shannon-Wiener's index:**

An index of diversity commonly used in plankton community analyses is the Shannon-Wiener's index (H'), which emphasizes not only the number of species (richness or variety), but also the apportionment of the numbers of individuals among the species. Shannon-Wiener's index (H') reproduces community parameters to a single number by using an equation are as follow:

$$H' = \sum p_i * \ln (p_i)$$

Where, $\sum$ = Summation symbol,

p_i = Relative abundance of the species,

$\ln$ = Natural logarithm

More diverse ecosystems are considered healthier and more resilient. Higher diversity ecosystems typically exhibit better stability and greater tolerance to fluctuations. e.g., The Shannon diversity index values between 2.19 and 2.56 indicate relatively high diversity within the community compared to communities with lower values. It suggests that the community likely consists of a variety of species, and the species are distributed somewhat evenly in terms of their abundance.

2. **Simpson's index:**

A reasonably high level of dominance by one or a small number of species is indicated by the range of **0.89 to 0.91**. The general health and stability of the ecosystem may be

impacted by this dominance. Community disturbances or modifications that affect the dominant species may be more likely to have an impact. The dominating species determined by the Simpson's index can have big consequences on how the community is organised and how ecological interactions take place.

The formula for calculating D is presented as:

$$D = 1 - \sum (p_i^2)$$

Where, $\sum$ = Summation symbol, p_i = Relative abundance of the species

3. Margalef's diversity index:

The number of species is significantly related to the port's vegetation cover surface, depth, and photosynthetic zone. The habitat heterogeneity is a result of these three elements. Species richness is related to the number of distinct species present in the analysed area. Margalef's index has a lower correlation with sample size. Small species losses in the community over time are likely to result in inconsistent changes.

Margalef's index D_{Mg} , which is also a measure of species richness and is based on the presumed linear relation between the number of species and the logarithm of the number of individuals. It is given by the formula:

$$D_{Mg} = \frac{S-1}{\ln N}$$

Where, N = total number of individuals collected

S = No. of taxa or species or genera

4. Berger-Parker index:

This is a useful tool for tracking the biodiversity of deteriorated ecosystems. Environmental factors have a considerable impact on this index, which accounts for the dominance of the most abundant species over the total abundance of all species in the assemblage. The preservation of their biodiversity and the identification of the fundamental elements influencing community patterns are thus critical for management and conservation. Successful colonising species will dominate the assemblage, causing the Berger-Parker index to rise, corresponding to well-documented successional processes. The environmental and ecological features of the system after disturbance may therefore simply but significantly determine the identity of the opportunistic and colonising species through niche selection processes.

The Berger-Parker index is a biodiversity metric that focuses on the dominance or relative abundance of a single species within a community. It provides a measure of the most abundant species compared to the total abundance of all species present in the community. Mathematically, it can be represented as follows:

$$d = \frac{N_{max}}{\sum N_i}$$

Where, N_{max} = Max no of individuals of particular genera or species

$\sum N_i$ = Total no of individuals obtained.

The resulting value of the Berger-Parker index ranges between 0 and 1. A higher index value indicates a greater dominance of a single species within the community. Conversely, a lower index value suggests a more even distribution of abundance among different species, indicating higher species diversity. The range of the Berger-Parker index can be interpreted as when the index value is close to 0, it signifies a high diversity with a more even distribution of abundances among different species. In such cases, no single species dominates the community, and there is a balanced representation of various species.

5. Evenness index-

Evenness index determines the homogeneity (and heterogeneity) of the species' abundance. Intermediate values between 0 and 1 represent varying degrees of evenness or unevenness in the distribution of individuals among species. Value of species evenness represents the degree of redundancy and resilience in an ecosystem. High species evenness = All species of a community can perform similar ecological activities or functions = even utilization of available ecological niches = food web more stable = ecosystem is robust (resistant to disturbances or environmental changes). Intermediate values between 0 and 1 represent variable degrees of evenness or unevenness.

$$EI = \frac{H}{\ln(S)}$$

Where, H= Shannon value

$\ln(S)$ = the natural logarithm of the number of different species in the community

Relative Abundance: The species abundance distribution (SAD) from disturbed ecosystems follows even/ uneven pattern. E.g., If relative abundance is 0.15, then the found species are neither highly dominant nor rare.

$$RA = \frac{\text{No. of Individuals of Sp.}}{\text{Total no. of Individual}} * 100\%$$

The basic idea of index is to obtain a quantitative estimate of biological variability that can be used to compare biological entities composed of discrete components in space and time. Biodiversity is commonly expressed through indices based on species richness and species abundances. Biodiversity indices are a non-parametric tool used to describe the relationship between species number and abundance. The most widely used bio diversity indices are Shannon Weiner index and Simpson's index.

12.2 Result and Discussion

The details of Marine Ecological Monitoring conducted for the locations of Kandla and Vadinar during the monitoring period has been summarized in the **Table 39**.

Table 39: Values of Biomass, Net Primary Productivity (NPP), Gross Primary Productivity (GPP), Pheophytin and Chlorophyll for Kandla and Vadinar

Sr. No.	Parameters	Unit	Kandla						Vadinar	
			ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
1.	Biomass	mg/L	121	76	65	116	98	94	86	125
2.	Net Primary Productivity	mg/L/hr	BQL	BQL	BQL	BQL	0.91	BQL	BQL	BQL
3.	Gross Primary Productivity	mg/L/hr	1.12	0.79	1.21	1.63	1.18	0.69	0.88	1.23
4.	Pheophytin	mg/m ³	BQL	BQL	0.75	1.25	1.33	0.51	1.2	1.31
5.	Chlorophyll-a	mg/m ³	0.69	0.96	1.52	1.26	1.55	1.19	1.77	1.43
6.	Particulate Oxidisable Organic Carbon	mg/L	0.86	1.11	0.69	0.79	1.28	0.89	0.7	0.78
7.	Secchi Depth	ft	0.58	0.70	0.54	0.44	0.49	0.76	1.17	1.24

- Biomass:**

With reference to the **Table 39**, the concentration of **Biomass** reported from location ME-1 to ME-6 in range between **65-121 mg/L** where lowest biomass presents in ME-3 (Near Coal Berth) and highest biomass present in ME-1 (Near Passenger Jetty One) during sampling period. In Vadinar, the value of biomass was observed **86 mg/L** at ME-7 (Near SPM) and **125 mg/L** in ME-8 (Near Vadinar Jetty) monitoring station.

- Productivity (Net and Gross)**

Gross primary productivity (GPP) is the rate at which organic matter is synthesised by producers per unit area and time (GPP). The amount of carbon fixed during photosynthesis by all producers in an ecosystem is referred to as gross primary productivity. The monitoring location of Kandla reported GPP value in range between **0.69 to 1.63 mg/L/48 Hr** where the highest value recorded for ME-4 (Khor Creek) and lowest recorded at ME-6(Nakti creek (near NH-8A)). In Vadinar, the value of **GPP** was observed **0.88** at ME-7 (Near SPM) and **1.23** at ME-8 (Near Vadinar Jetty) monitoring station.

Net primary productivity, is the amount of fixed carbon that is not consumed by plants, and it is this remaining fixed carbon that is made available to various consumers in the ecosystem. The Net primary productivity of the monitoring location at Kandla from (ME-1 to ME-6) has been recorded in as **BQL (Below Quantification Limit)**. While in Vadinar, the value of **NPP** was observed **BQL (Below Quantification Limit)**. at ME-7 (Near SPM) and ME-8 (Near Vadinar Jetty) monitoring station.

- Pheophytin**

The level of Pheophytin was detected in the range from **0.51 to 1.33 mg/m³** where the highest value observed at ME-5 (Nakti Creek (near Tuna Port)) and the lowest value observed at ME-6 (Nakti Creek (near NH - 8A)). While in Vadinar, the value of Pheophytin was observed **1.20 mg/m³** at ME-7 and **1.31 mg/m³** at ME-8 monitoring station.

- **Chlorophyll-a**

In the sub surface water, the value of Chlorophyll-a reported in range from **0.69 to 1.55 mg/m³**. The highest value observed at ME-5 (Nakti creek (near KPT Colony)) while the lowest value observed at ME-1 (Near Passenger Jetty One). In Vadinar, the value of chlorophyll-a was observed **1.77 mg/m³** at ME-7 (Near SPM) and **1.43 mg/m³** in ME-8 (Near Vadinar Jetty) monitoring station.

- **Particulate Oxidisable Organic Carbon**

During the sampling period, the particulate oxidisable organic carbon falls within the range of **0.69 to 1.28 mg/L** from monitoring location ME-1 to ME-6 at Kandla, whereas for Vadinar, the value of POC observed **0.70 mg/L** at ME-7 (Near SPM) and **0.78 mg/L** in ME-8 (Near Vadinar Jetty) monitoring station.

- **Secchi Depth**

In monitoring station of Kandla (ME-1 to ME-6) the level of Secchi Depth was observed between **0.44 to 0.76 ft** whereas at Vadinar, the value recorded at ME-7 i.e. Near SPM is **1.17 ft** and in Near Vadinar Jetty is **1.24 ft**.

Ecological Diversity

Phytoplankton: For the evaluation of the Phytoplankton population in DPA Kandla and Vadinar within the immediate surroundings of the port, sampling was conducted during the study period. Total 8 sampling locations were studied i.e. sampling locations (6 from Kandla and two from Vadinar).

The details of variation in abundance and diversity in phytoplankton communities is mentioned in **Table 40**.

Table 40: Phytoplankton variations in abundance and diversity in sub surface sampling stations

Genera	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
<i>Bacillaria sp.</i>	212	-	-	202	-	436	-	187
<i>Biddulphia sp.</i>	-	315	235	137	118	-	268	159
<i>Chaetoceros sp.</i>	317	166	-	-	-	561	186	-
<i>Chlamydomonas sp.</i>	185	-	188	-	298	-	-	319
<i>Cyclotella sp.</i>	126	468	-	266	125	-	408	107
<i>Coscinodiscus sp.</i>	-	-	426	-	-	286	-	160
<i>Ditylum sp</i>	-	225	-	271	-	-	270	-
<i>Fragilaria sp.</i>	486	174	142	158	210	153	-	181
<i>Bacteriastrium sp.</i>	252	-	-	-	119	146	161	-
<i>Pleurosigma sp.</i>	-	-	308	-	-	-	125	212
<i>Navicula sp.</i>	147	-	-	147	374	252	-	183
<i>Merismopedia sp.</i>	-	156	177	-	-	-	-	-
<i>Synedra sp.</i>	-	-	-	-	-	-	232	-
<i>Skeletonema sp.</i>	239	-	-	256	415	118	-	329
<i>Oscillatoria sp.</i>	-	201	355	-	-	-	178	-
<i>Thalassiosira</i>	187	-	158	-	175	123	163	280
<i>Gomphonema sp.</i>	-	345	-	178	-	-	135	-
Density-Units/L	2151	2050	1989	1615	1834	2075	2126	2117
No. of genera	9	8	8	8	8	8	10	10

The phytoplankton community of the sub surface water in the Kandla and Vadinar was represented by, Diatoms, green algae and filamentous Cynobacteria. Diatoms were represented by 15 genera; green algae were represented by 1 genera and filamentous Cynobacteria were represented by 1 genera during the sampling period.

The density of phytoplankton of the sampling stations from ME-1 to ME-6 (Kandla) varying from **1615 to 2151 units/L**, while for Vadinar its density of phytoplankton observed **2126 units/L at ME-7 and 2117 units/L at ME-8**. During the sampling, phytoplankton communities were dominated, *Cyclotella sp*, *Fragilaria sp*, *Navicula sp* & *Thalassiosira* in Kandla, while *Cyclotella sp.* in Vadinar

The details of Species richness Index and Diversity Index in Phytoplankton is mentioned in **Table 41**.

Table 41: Species richness Index and Diversity Index in Phytoplankton

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	9	8	8	8	8	8	10	10
Individuals	2151	2050	1989	1615	1834	2075	2126	2117
Shannon diversity	2.11	1.96	1.93	1.75	1.81	1.89	2.22	2.23
Simpson 1-D	0.87	0.86	0.86	0.87	0.85	0.83	0.89	0.89
Species Evenness	0.96	0.94	0.93	0.84	0.87	0.91	0.96	0.97
Margalef richness	1.04	0.92	0.92	0.95	0.93	0.92	1.17	1.18
Berger-Parker	0.23	0.23	0.21	0.17	0.23	0.27	0.19	0.16
Relative abundance	0.42	0.39	0.40	0.50	0.44	0.39	0.47	0.47

- Shannon- Wiener's Index (H)** of phytoplankton communities was in the range of **1.75 to 2.11** between selected sampling stations from ME-1 to ME-6 with an average value of **1.91** at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of phytoplankton communities recorded to be **2.22** at location ME-7 and **2.23** at ME-8 with an average value of **2.23**. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla.
- Simpson diversity index (1-D)** of phytoplankton communities was ranged between **0.83 to 0.87** at all sampling stations in the Kandla creek and nearby creeks, with an average of **0.86**. Similarly, for Vadinar Simpson diversity index (1-D) of phytoplankton communities was **0.89** at location ME-7 and **0.89** at ME-8 with an average of **0.89**.
- Margalef's diversity index (Species Richness)** of phytoplankton communities in Kandla and nearby creeks sampling stations was varying from **0.92 to 1.04** with an average of **0.95** during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of phytoplankton communities observed **1.17** at ME-7 and **1.18** at ME-8 with an average value of **1.18**.
- Berger-Parker Index (d)** of phytoplankton communities was in the range of **0.17 to 0.27** between selected sampling stations from ME-1 to ME-6 with an average value of **0.22** at Kandla creek and nearby creeks. Berger-Parker Index (d) of phytoplankton communities in the sampling stations of Vadinar, was in the range of **0.19 to 0.16** with an average value of **0.18**. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.84 to 0.96** for all the six-monitoring station of Kandla and for the Vadinar the species evenness is observed **0.96** at location ME-7 & **0.97** at ME-8 location.
- During the sampling period, **Relative Abundance** of phytoplankton communities was in range of **0.39 to 0.50** between selected sampling stations from ME-1 to ME-6 with an average value of **0.42** at Kandla creek and nearby creeks. Whereas for Vadinar the Index value **0.47** at ME-7 and **0.47** at ME-8 with an average value **0.47**, thus it is concluded that the studied species can be stated as neither highly dominant nor rare.

The details of variation in abundance and diversity in zooplankton communities is mentioned in **Table 42**.

Table 42: Zooplankton variations in abundance and diversity in sub surface sampling stations

Genera	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
<i>Acartia sp.</i>	-	1	1	1	-	2	2	-
<i>Acrocalanus</i>	1	-	1	-	1	-	2	-
<i>Amoeba</i>	-	1	1	2	-	1	1	2
<i>Brachionus sp.</i>	2	1	-	-	1	2	-	1
<i>Calanus sp.</i>	2	1	1	2	2	-	-	-
<i>Cladocera sp.</i>	1	-	-	-	-	-	1	-
<i>Cyclopoid sp.</i>	-	1	3	2	1	1	1	3
<i>Copepod larvae</i>	1	2	-	1	-	1	1	1
<i>Diaptomus sp.</i>	-	-	1	-	2	-	1	-
<i>Eucalanus sp.</i>	2	1	-	1	-	1	-	2
<i>Mysis sp.</i>	-	-	2	-	1	-	-	1
<i>Paracalanus sp.</i>	1	1	-	-	-	1	1	1
Density Unit/L	10	9	10	9	8	9	10	11
No. of genera	7	8	7	6	6	7	8	7

A total of 12 groups/taxa of zooplankton were recorded in Kandla and Vadinar during the study period which mainly constituted by *Mysis*, *brachionus*, *Calanus*, fish and shrimp larval forms. *Cladocera*, *Mysis* and *Paracalanus* had the largest representation at all stations from (ME-1 to ME-8). The density of Zooplankton of the sampling stations from ME-1 to ME-6 (Kandla) varying from **8 to 10 units/L**, while for Vadinar its density of zooplankton observed **10 units/L at ME-7** and **11 units/L at ME-8**. During the sampling, zooplankton communities were dominated by *Cyclopoid sp*, *Calanus sp*, *Amoeba* in Kandla, while *Cyclopoid sp* and *Calanus sp* had the largest representation at monitoring location of Vadinar.

The details of Species richness Index and Diversity Index in Zooplankton communities is mentioned in **Table 43**.

Table 43: Species richness Index and Diversity Index in Zooplankton

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	7	8	7	6	6	7	8	7
Individuals	10	9	10	9	8	9	10	11
Shannon diversity	1.89	1.93	1.83	1.66	1.56	1.8	2.03	1.93
Simpson (1-D)	0.93	0.97	0.91	0.92	0.93	0.94	0.96	0.91
Species Evenness	0.97	0.93	0.94	0.93	0.87	0.93	0.98	0.99
Margalef	2.61	3.19	2.61	2.28	2.4	2.73	3.04	2.5
Berger-Parker	0.2	0.22	0.3	0.22	0.25	0.22	0.2	0.27
Relative abundance	70	88.89	70	66.67	75	77.78	80	63.64

- **Shannon- Wiener's Index (H)** of zooplankton communities was in the range of **1.56 to 1.93** between selected sampling stations from ME-1 to ME-6 with an average value of **1.77** at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of zooplankton communities recorded to be **2.03** at ME-7 and **1.93** at ME-8 with an average

value of **1.98**. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla and Near SPM (Vadinar).

- **Simpson diversity index (1-D)** of zooplankton communities was ranged between **0.91 to 0.97** at all sampling stations in the Kandla creek and nearby creeks, with an average of **0.93**. Similarly, for Vadinar Simpson diversity index (1-D) of zooplankton communities was **0.96** at ME-7 and **0.91** at ME-8 with an average of **0.93**.
- **Margalef's diversity index** (Species Richness) of zooplankton communities in Kandla and nearby creeks sampling stations was varying from **2.28 to 3.19** with an average of **2.63** during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of zooplankton communities observed **3.04** at ME-7 and **2.50** at ME-8 with an average value of **2.77**.
- **Berger-Parker Index (d)** of zooplankton communities was in the range of **0.20 to 0.30** between selected sampling stations from ME-1 to ME-6 with an average value of **0.23** at Kandla creek and nearby creeks. Berger-Parker Index (d) of zooplankton communities in the sampling stations of Vadinar, was observed **0.20** at ME-7 and **0.27** at ME-8 with an average value of **0.23**. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.87 to 0.97** for all the six-monitoring station of Kandla whereas, for the Vadinar the species evenness was observed **0.98** at ME-7 and **0.99** at ME-8 the locations, during the monitoring month.
- During the sampling period, **Relative Abundance** of zooplankton communities was in range of **66.67 to 88.89** between selected sampling stations from ME-1 to ME-6 with an average value of **74.72** at Kandla creek and nearby creeks. Whereas for Vadinar the Index value **80** at ME-7 and **63.64** at ME-8 with an average value **71.82**, thus it can be concluded that the studied species is stated as neither highly dominant nor rare.

The details of variation in abundance and diversity in **Benthic organism** is mentioned in **Table 44**.

Table 44: Benthic Fauna variations in abundance and diversity in sub surface sampling

Family/Class	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Thiaridae	-	1	1	-	-	-	-	1
Mollusca	1	-	-	1	1	-	1	-
Odonata	2	2	2	-	-	2	1	1
Lymnidae	1	1	1	-	2	1	-	-
Planorbidae	-	-	-	1	-	-	-	2
Talitridae	-	1	-	1	2	-	1	1
Trochidae	1	-	1	-	-	1	-	-

Family/Class	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Atyidae	1		1	2	-	-	1	1
Gammaridae	-	1	-	-	1	2	2	-
Portunidae	1	-	-	2	1	1	1	-
Turbinidae	1	1	-	-	-	-	-	-
Palaemonidae	-	-	-	-	-	-	-	-
Density-Units/l	8	7	6	7	7	7	7	6
No of Class	7	6	5	5	5	6	6	5

Few Benthic organisms were observed in the collected sample by using the Van-Veen grabs during the sampling conducted for DPA Kandla and Vadinar. Majority of the species were found under the Macro-benthic organisms during the sampling period were represented by *Odonta*, Lymnidae, etc. The No. of Family of benthic fauna was varying from 6 to 8. The dominating benthic communities at Near Passenger Jetty One were represented Talitridae, Atyidae. While lowest number of benthic species was represented by Palaemonidae.

The details of Species richness Index and Diversity Index in Benthic Organisms is mentioned in **Table 45**.

Table 45: Species richness Index and Diversity Index in Benthic Organisms

Indices	ME-1	ME-2	ME-3	ME-4	ME-5	ME-6	ME-7	ME-8
Taxa S	7	6	5	5	5	5	6	5
Individuals	8	7	6	7	7	7	7	6
Shannon diversity	1.91	1.65	1.39	1.47	1.47	1.47	1.65	1.39
Simpson 1-D	0.96	0.95	0.93	0.95	0.9	0.9	0.95	0.93
Species Evenness	0.98	0.92	0.86	0.91	0.91	0.91	0.92	0.86
Margalef	2.89	2.57	2.23	2.06	2.06	2.06	2.57	2.23
Berger-Parker	0.25	0.29	0.33	0.29	0.29	0.29	0.29	0.33
Relative abundance	87.5	85.71	83.33	71.43	71.43	71.43	85.71	83.33


- **Shannon- Wiener's Index (H)** of benthic organism was in the range of **1.39 to 1.91** between selected sampling stations from ME-1 to ME-6 with an average value of **1.56** at Kandla creek and its nearby creeks. While for Vadinar, Shannon Wiener's index of benthic organism recorded to be **1.65** at ME-7 & **1.39** at ME-8 location with an average value of **1.52**. The apportionment of the numbers of individuals among the species observed higher stability at all monitoring location of Kandla and Vadinar.
- **Simpson diversity index (1-D)** of benthic organism was ranged between **0.90 to 0.96** at all sampling stations in the Kandla creek and nearby creeks, with an average of **0.93**. Similarly, for Vadinar Simpson diversity index (1-D) of benthic organism was **0.95** at ME-7 and **0.93** at ME-8 location with an average of **0.94**.
- **Margalef's diversity index (Species Richness)** of benthic organism in Kandla and nearby creeks sampling stations was varying from **2.06 to 2.89** with an average of **2.31** during the sampling period. While for Vadinar, Margalef's diversity index (Species Richness) of

benthic organism observed to be **2.57** at ME-7 and **2.23** at ME-8 location with an average of **2.4**.

- **Berger-Parker Index (d)** of benthic organism was in the range of **0.25 to 0.33** between selected sampling stations from ME-1 to ME-6 with an average value of **0.29** at Kandla creek and nearby creeks. Berger-Parker Index (d) of benthic organism in the sampling stations of Vadinar, was observed to be **0.29** at ME-7 and **0.33** at ME-8 location with an average value of **0.31**. All the monitoring station signifies a low diversity with an even distribution among the different species.
- The **Species Evenness** is observed in the range of **0.86 to 0.98** for all the six-monitoring station of Kandla and for the Vadinar the species evenness is observed in the range of **0.86 to 0.92** at both of the location.
- During the sampling period, **Relative Abundance** of Benthic organisms was **71.43 to 87.5** between selected sampling stations from ME-1 to ME-6 with an average value of **78.47** at Kandla creek and nearby creeks. Whereas for Vadinar the Index value **85.71** at ME-7 and **83.33** at ME-8 location, with an average value **84.52**, thus it is concluded that the studied species can be stated as neither highly dominant nor rare.

Annexure 1: Photographs of the Environmental Monitoring conducted at Kandla

STP Monitoring

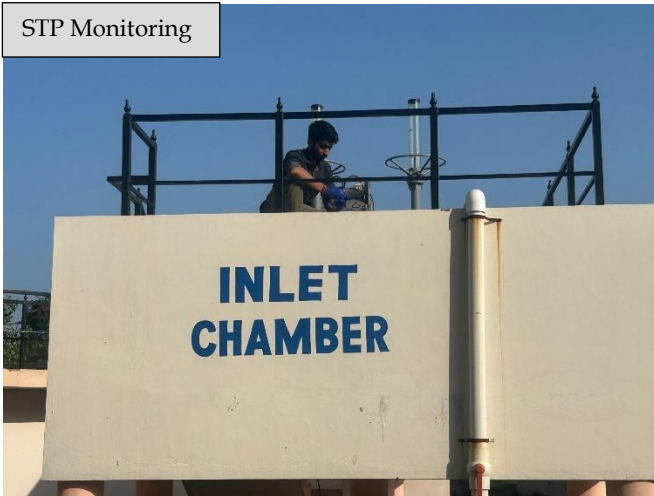

Noise Monitoring



Soil Monitoring



Marine Monitoring



Air Monitoring



Drinking Water Monitoring



Annexure 2: Photographs of the Environmental Monitoring conducted at Vadinar

Air Monitoring



Noise Monitoring



STP Monitoring



Drinking water Monitoring



Marine Monitoring



Soil Monitoring



Source: GEMI



Gujarat Environment Management Institute (GEMI)

(An Autonomous Institute of Government of Gujarat)

'An ISO 9001:2015, ISO 14001:2015 & ISO 45001:2018 Certified Institute

Head Office

Plot No. B 246 & 247, G.I.D.C. Electronic Estate,
Sector-25, Gandhinagar-382024

Laboratory

Plot No. B-64, G.I.D.C. Electronic Estate,
Opp. I.P.R., Sector-25, Gandhinagar-382025

Tel: (+91) 79-23240964 (O), T: (+91) 79-23287758 (Lab), F: (+91) 79-23240965

E-mail: info-gemi@gujarat.gov.in | Website: www.gemi.gujarat.gov.in

"We Provide Environmental Solutions"

Annexure -D

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001.

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

RISK DETAILS

TYPE: MARINE PORT PACKAGE INSURANCE POLICY

INSURED: DEENDAYAL PORT AUTHORITY, (hereinafter referred as DPA) and/ or associated and/ or affiliated and/ or interrelated and/ or subsidiary companies and/ or corporations as they now are or may hereafter be created and/ or constituted and/ or for whom the Assured receive instructions to insure and/ or for whom the Assured have or assume a responsibility to arrange insurance, whether contractually or otherwise, as their respective rights and interests may appear hereinafter known as the Assured and/ or as original

PRINCIPAL ADDRESS: Address of the Original Insured
Administrative Office Building, Near Madhuban Hotel, Gandhidham, Kutch, Gujarat.

INSURANCE INTERMEDIARY: MARINE PORT PACKAGE INSURANCE
Marsh India Insurance Brokers Pvt. Ltd.

PERIOD: 12 months with effect from 24th July 2024 till 23rd July 2025, both days included

INTEREST: Section 1
Port Authority Liabilities including liability of contractor and subcontractors and wreck removal.

Section 2
Real and Personal Property - In respect of all properties, owned by / under custody of Insured(s) hereunder including adjacent warehouses associate structures.

Section 3
Port Equipment including all Cargo Handling Equipment /Vehicles, Machineries and spares

Section 4
Business Interruption consequent upon Property damage (including cargo handling equipment, machineries etc.)

For Business interruption of the Port operation (wholly or partly) due to/consequent upon or arising out of:

012

and Personal Property -
under Page 1 of 8

पंजीकृत एवं प्रधान कार्यालय : न्यू इन्डिया एश्योरन्स बिल्डिंग, 87, महात्मा गांधी रोड, फोर्ट, मुंबई - 400 001.

Regd. & Head Office : New India Assurance Bldg, 87, Mahatma Gandhi Road, Fort, Mumbai - 400 001.

Website : www.newindia.co.in

CIN: L66000MH1919G01000526



AnyScanner

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001.

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

(a) Interruption of electric supply to insured properties Or insured handling equipment, which is beyond the control of the assured.

(b) Blockage of Channel/ Waterways due to any cause

(c) Blockage of any land access within the immediate Vicinity* of the Port/ Terminals.

*(immediate vicinity will mean at least 8 km radii from main entrance of Port's operational area applicable for both Kandla as well as for Vadinar)

LIMIT OF LIABILITY

Section 1

Overall Limit of Liability: INR 40,00,00,000 any one accident or occurrence and in the aggregate

Sublimit for liability arising out of wreck removal: INR 5,00,00,000

Sections 2, 3 & 4

Loss Limit: INR 760,00,00,000 any one accident or occurrence and in the aggregate

TOTAL SUM INSURED FOR PROPERTIES (excludes owned vessels): INR 66,018,944,786.

Sections 4

Indemnity Period: 2 Months

Annual Revenue - INR 27,107,385,666

Annual Gross Profit - INR 25,759,485,666

Loss limit - INR 100,00,00,000

Combined Single Limit for PD /BI / Liability across all sections is INR 800,00,00,000

LOCATION:

Insured Location addresses as under:

1. Administrative Office Building, Near Madhuban Hotel, Gandhidham, Kutch, Gujarat -370201
2. Custom Bounded Area Port of Kandla - 370210.
3. Port Colony, KDLB colony, FCI colony, Residential quarters-400 quarters, Gopalpuri, Gandhidham -370201.
4. Office Buildings and Residential Quarters outside port area, Kandla - 370210
5. Dispensary at Adipur-370205
6. Baba Saheb Ambedkar Convention Centre Gandhidham

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001.

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

7. Jetty Area, Vadinar-361010 – Latitude : 220 44' N ;
Longitude : 690 67' E

8. Port Colony, Vadinar-361010 – Latitude : 230 01' N ;
Longitude : 700 13' E

**POLICY
CONDITIONS:**

Section 1

Ports and Terminals Consortium Section 1 – Liability Wording
Amended.

Clause 2.3 (Insuring Clause) amended.

Ports and Terminals Consortium Fire Extension (Liability).

Ports and Terminals Consortium Advice and Information

Extension

(Liability).

Ports and Terminals Consortium Fines and Duty Extension
(Liability).

Ports and Terminals Consortium Infringement of Personal Rights

Extension (Liability).

Ports and Terminals Consortium Wrongful Delivery of Cargo
Extension (Liability).

Subject to Joint Liability Committee War and Terrorism
Exclusion Clause 11/2002/02/17/01/02 plus Joint Liability
Committee

Clause 2.3 (Insuring Clause) amended.

Deductible:

For Liability (including environmental pollution): Flat: INR

5,00,000

Section 2

Ports and Terminals Consortium Section 2 – Property Damage
Wording Amended.

Clause 2.1 (Insuring Clause) amended to include electrical
and machinery breakdown.

Exclusion 4.8 (Safe working load) amended.

Exclusion 5.2 (Road) deleted.

Exclusion 5.4 (Stock) does not apply to stock of spare parts.

Exclusion 4.9 (Communication Equipment) deleted.

Clause 5.1 amended to include land development cost

Clause 8.1 (Automatic Acquisition) amended to 90

days. Clause 8.2 (Automatic Acquisition) amended to
10%.

Ports and Terminals Consortium Earthquake Extension Clause
(Property) Amended; 1/04 LSW1517.

Clause A amended to include

Tsunami. Clause B amended to
include Tsunami.

48 hours amended to 72 hours.

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी. आर. अंबेडकर चौक, मुंबई - 400 001

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

Deductible: Removal of Wreck/Debris

(A) Other than AOG peril & Vessel Impact: 2% of claim amount subject to Minimum INR 3,00,000 each and every claim

(B) AOG Peril: 2% of claim amount subject to Minimum INR 20,00,000 each and every claim (including losses affecting breakwater)

(C) Vessel impact: 2% of claim amount subject to Minimum INR 20,00,000 each and every claim (including losses affecting breakwater)

Section 3

Ports and Terminals Consortium Section 3 – Handling Equipment Wording Amended.

Clause 2.1 (Insuring Clause) amended to include electrical and machinery breakdown.

Clause 2.4 (Removal of Wreck/Debris) included

Exclusion 4.7 (Communication Equipment) deleted.

Exclusion 4.9 (Safe working load) amended.

Exclusion 4.15 (Mechanical or Electrical Breakdown) deleted.

Clause 8 (Protective Maintenance) amended.

Clause 9.1 (Automatic Acquisition) amended to 90 days

Clause 9.2 (Automatic Acquisition) amended to 10%

Ports and Terminals Consortium Earthquake Extension Clause

(Handling Equipment) Amended 1/04 LSW1520. Clause A amended to include Tsunami.

Clause B amended to include Tsunami.

48 hours amended to 72 hours.

Deductible: 2% of claim subject to Minimum INR 3,00,000

Section 4

Ports and Terminals Consortium Section 4 Business Interruption Wording Amended 1/04 LSW1522.

Clause 2.3 (Interruption to Utility Supply) amended to include gas, fuel or water supply.

Additional Clause 2.4 interruption due to damage and/or blockage of pipeline.

Deductible: 7 days

Applicable to Sections 2, 3 & 4

Subject to Expediting Expenses Clause

Subject to Architects, Surveyors', Legal and Consulting Engineers' Fees Clause

Subject to Minor Works Clause

Page 4 of 8

पंजीकृत एवं प्रधान कार्यालय : न्यू इन्डिया एश्योरन्स बिल्डिंग, 87, महात्मा गांधी रोड, फोर्ट, मुंबई - 400 001.

Regd. & Head Office : New India Assurance Bldg. 87, Mahatma Gandhi Road, Fort, Mumbai - 400 001.

Website : www.newindia.co.in

CIN : L66000MH1919GOI000526



AnyScanner

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001.

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

Subject to Public Authority Clause

Subject to Reinstatement Clause

Subject to Temporary Removal Clause

Subject to Additional Increased Cost of Working Clause.

Subject to Prevention of Ingress/Egress Clause.

Subject to Professional Accountants Fees Clause

Subject to Average Clause (85%)

Pollution Clean-up Costs Clause

Claims Preparation Costs Clause

Minimization of Loss Clause

Designation of Property Clause

Listed Perils resulting from seepage and/or pollution and/or contamination clause

Subject to Reinstatement Clause

Limited seepage &/or pollution &/or contamination resulting from physical damage caused by listed perils clause

Waiver of under-insurance upto 15% of Sum Insured under property damage and BI Sum Insured

Marine Impact Insurance Clause

Specialized / Heavy Lift/ Oversize Lifting clause

Toxic Mould Exclusion Clause

Claims Control Clause

NMA 2919 War and Civil War and Terrorism Exclusion Clause

Pollution Clean-up Costs Clause

Claims Preparation Costs Clause

Minimization of Loss Clause

General Policy Provisions LSW1524 01/04 Amended

Clause 5 (Radioactive Contamination, etc) deleted

Clause 6.1 B. amended to delete 'strike, lock-out, labour disturbance, riot, civil commotion'.

Clause 11 (Notice of Potential Claims)

amended. Clause 18 (Premium Payment

Clause) deleted.

Clause 21 (Governing Law) amended to India.

Clause 10 (Electronic Exclusion Clause) deleted.

Employment Practices Clause

Simultaneous Payment Clause (Losses)

Waiver of Subrogation and Additional Assured Clause

Special Termination Clause.

Continuity Clause

Subject to Institute Radioactive Contamination, Chemical, Biological, Bio-chemical and Electromagnetic Weapons Exclusion

Page 5 of 8

पंजीकृत एवं प्रधान कार्यालय : न्यू इन्डिया एश्योरन्स बिल्डिंग, 87, महात्मा गांधी रोड, फोर्ट, मुंबई - 400 001.

Regd. & Head Office : New India Assurance Bldg. 87, Mahatma Gandhi Road, Fort, Mumbai - 400 001.

Website : www.newindia.co.in

CIN : L66000MH1919G0100526



AnyScanner

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरेगा रोड,

डॉ. बी.आर. अम्बेडकर चौक, मुंबई - 400 001

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

Clause CL370 10/11/03, and Marine Cyber Exclusion LMA5402 and Marine Cyber Endorsement LMA5403.

Subject to Sanction Limitation and Exclusion Clause LMA3100

15th
September 2010.

Subject to Unintentional Errors and Omission Clause.

Notwithstanding anything contained elsewhere, insurance shall be governed by and construed in accordance with the laws of

India and the exclusive jurisdiction of India.

Payment on account clause - Payment on account of any loss recoverable under this insurance will be promptly made by the insurers to the insured if so desired, provided that such payment are deducted from the finally agreed claim settlement figures.

Paneled surveyor clause: In the event of a claim, the surveyors shall be appointed only from the panel of agreed surveyors as mentioned below:

a) Proclaim Insurance Surveyors and Loss Assessors Private Limited

b) McLaren's Insurance Surveyors And Loss Assessors India Pvt. Ltd.

c) Alex Stewart International (India) Private Limited

In case above surveyors are not available, the appointment of alternate surveyor by insurance company will be done in agreement and after consent of the assured.

EXPRESS WARRANTIES:

None

CONDITIONS PRECEDENT:

None

SUBJECTIVITIES:

None

PREMIUM:

Total Premium inclusive of sections 1,2,3 &4:

INR 14,30,39,825 plus 18% GST of INR 2,57,47,168.50

Total premium of INR 16,87,86,993.50

Paid in full prior to inception

Page 6 of 8

पंजीकृत एवं प्रधान कार्यालय : न्यू इन्डिया एश्योरन्स बिल्डिंग, 87, महात्मा गांधी रोड, फोर्ट, मुंबई - 400 001.

Regd. & Head Office : New India Assurance Bldg, 87, Mahatma Gandhi Road, Fort, Mumbai - 400 001.

Website : www.newindia.co.in

CIN : L66000MH1919GOI000526



AnyScanner

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,

डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001.

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

Terrorism Cover

Insured:

DEENDAYAL PORT AUTHORITY, (hereinafter referred as MPT) and/ or associated and/ or affiliated and/ or interrelated and/ or subsidiary companies and/ or corporations as they now are or may hereafter be created and/ or constituted and/ or for whom the Assured receive instructions to insure and/ or for whom the Assured have or assume a responsibility to arrange insurance, whether contractually or otherwise, as their respective rights and interests may appear hereinafter known as the Assured and/ or as original.

Insurance
Intermediary:

Marsh India Insurance Brokers Pvt. Ltd.

Risk Location:

Insured Location addresses as under:

1. Administrative Office Building, Near Madhuban Hotel, Gandhidham, Kutch, Gujarat -370201
2. Custom Bounded Area Port of Kandla - 370210.
3. Port Colony, Gopalpur, Gandhidham -370201.
4. Office Buildings and Residential Quarters outside port area, Kandla - 370210
5. Dispensary at Adipur -370205
6. Baba Saheb Ambedkar Convention Centre Gandhidham
7. Jetty Area, Vadinar-361010 - Latitude : 220 44' N ; Longitude : 690 67' E
8. Port Colony, Vadinar-361010 - Latitude : 230 01' N ; Longitude : 700 13' E

Occupancy:

Marine Port

Cover:

Terrorism and Sabotage with third party liability limit

Period:

24th July 2024 to 23rd July 2025

Total Insured Values:

Property Damage and handling equipment-

INR 66,018,944,786

Sections 4

Indemnity Period: 2 Months

Annual Revenue - INR 27,107,385,666

Annual Gross Profit - INR 25,759,485,666

Loss limit - INR 100,00,00,000

दि न्यू इन्डिया एश्योरन्स कं. लि.

(भारत सरकार का उपक्रम)

बृहत कॉर्पोरेट एवं ब्रोकर्स कार्यालय : 920000

न्यू इन्डिया सेंटर, 11वीं मंजिल, 17/ए, कोपरगेज रोड,
डॉ. बी.आर. अंबेडकर चौक, मुंबई - 400 001

फोन : 022-22044973 / 2204 4976 / 2204 4977 / 2204 4974



THE NEW INDIA ASSURANCE CO. LTD.

(A Govt. of India Undertaking)

Large Corporate & Broker's Office : 920000

New India Centre, 11th Floor, 17/A, Cooperage Road,

Dr. B.R. Ambedkar Chowk, Mumbai - 400 001

Phone : 022 - 2204 4973 / 2204 4976 / 2204 4977 / 2204 4974

Limit:

Combined Single Limit for Property Damage, handling equipment
and Business Interruption – INR 760,00,00,000

Third party liability limit of INR 40,00,00,000

Combined Single Limit for Property Damage, handling equipment
and Business Interruption and liability – INR 800,00,00,000

Deductibles:

Material damage – 2% claim amount subject to minimum of INR
300,000

Business Interruption – 7 days

Third Party Liability – INR 500,000 any one accident / occurrence

Total Premium:

INR 21,92,181 plus 18% GST of INR 3,94,592.58 totaling to

INR 25,86,773.58

For The New India Assurance Co. Ltd.



Authorized Signatory

Page 8 of 8

Page 8 of 8

पंजीकृत एवं प्रधान कार्यालय : न्यू इन्डिया एश्योरन्स बिल्डींग, 87, महात्मा गांधी रोड, फोर्ट, मुंबई - 400 001.
Regd. & Head Office : New India Assurance Bldg, 87, Mahatma Gandhi Road, Fort, Mumbai - 400 001.
Website : www.newindia.co.in
CIN : L66000MH1919GOI000526



AnyScanner

Annexure -2

Monitoring the implemental Safe guards
Ministry of Environment, Forests & Climate Change
Regional office, Gandhinagar
Monitoring Report (For the period October, 2024 to March, 2025)

DATA SHEET

1. Project type: River valley/ Mining/Industry/ thermal/nuclear/Other (specify)	Infrastructure and Miscellaneous Projects + CRZ
2. Name of the project	Construction of 13 th to 16 th Cargo Berth at Kandla Port by M/s Deendayal Port Authority (Erstwhile: Deendayal Port Trust) (Under Ministry of Ports, Shipping & Waterways, GoI).
3. Clearance Letter (s). OM no and date	Environment Clearance was issued by the Govt. of India, Ministry of Environment & Forest – New Delhi vide letter No. 11-70/2006-IA-III Dated September 2008. Further, the Ministry of Environment & Forest – New Delhi, Govt. of India, extended the Environmental Clearances validity for five years, i.e. up to 30/09/2018, vide letter No. F.NO.11 – 70/ 2006 – IA.III dated 7th February 2014.
4. Location a) District (s) b) State (s) c) Location/latitude/longitude	District: Kutch State : Gujarat Location: Deendayal Port Authority, 22°58'33.08"N and 70°13'16.28"E
5. Address for Correspondence a) address of Concerned Project Chief Engineer(with pin code &telephone/telex/fax numbers) b) Address of Executive project Engineer/manager/(with pin code fax numbers)	Chief Engineer, Deendayal Port Authority, A.O. Building Post Box No.-50, Gandhidham- Kutch. Gujarat Pin – 370201 Tel: 02836-233192, Fax-02836-220050. Superintending Engineer (Harbour), Office of the Superintending Engineer (Harbour), Nirman Building, New Kandla (Kutch) Pin 370 210. Gujarat
6. Salient features of the project	All the 4 berths, i.e., 13th to 16th Cargo berths, are under operation. 1. The dimension of each berth is 300m x 55m, consisting of a quay and transit area resting on 1200mm and 1000mm R.C.C.

b) Salient features of the Environmental management plan	bored cast-in-situ piles. (Total 1200m x 55m wide for 4 berths). 2. The backup area of size 21.7 Hectares/berth for 13th, 14th, 15th&16th CB, including all facilities, roads, railways & other required infrastructure (Total area: 102.17 ha. + 42 Ha. (1200 m X 350 m) = 144.17 ha.) 3. The Capacity of each Berth is 4.5 MMTPA (As approved by the Tariff Authority of Major Ports). 4. The drawing showing all berths viz. 13th to 16th has already been submitted with an earlier compliance report. NIOT, Chennai, had already suggested an Environmental Management Plan for the project's construction & operation phases, as cited in the EIA study report by NIOT, Chennai. A copy of the same has already been communicated with earlier compliance reports submitted.
7. Breakup of the project area a) Submergence area: forest & non-forest b) Others	Nil Nil
8. Breakup of the project affected population with enumeration of those losing houses/dwelling units only agricultural land & landless labourers/artisen a) SC. ST/Adivasis b) Others (Please indicate whether these figures are based on any scientific and systematic survey carried out or only provisional figures, if a survey is carried out give details and years of survey).	Nil Nil It is based on the EIA report prepared by M/s NIOT, Chennai.
9. Financial details a) Project cost as originally planned and subsequent revised estimates and the year of prices reference. b) Allocation made for environmental management plans with item wise and year wise breakup	Block estimated cost of Rs. 442.90 crores (Dec. 2005); Revised Block estimated cost of Rs. 755.5 crores (Apr 2009). Estimated cost revised (The year 2017) for Berth No. 14 C.B.: 253 Crore & Berth No. 16 C.B.: 278 Crore. The Deendayal Port Authority operates all the 4 berths. The allocation made under the scheme of "Environmental Services & Clearance thereof other related Expenditure" during RBE 2024-25 is Rs. 585 Lakhs.

c) Benefit cost ratio/Internal rate of Return and the year of assessment Whether (c) includes the cost of environmental management plans so far. d) Actual expenditure incurred on the project e) Actual expenditure incurred on the Environmental management plans so far.	<table border="0"> <tr> <td>FIRR</td><td>EIRR</td></tr> <tr> <td>13.61%</td><td>14.62%</td></tr> <tr> <td colspan="2">Berth No. 14 C.B.: 253 Crore</td></tr> <tr> <td>FIRR</td><td>EIRR</td></tr> <tr> <td>15.32%</td><td>17.42%</td></tr> <tr> <td colspan="2">Berth No. 16 C.B.: 278 Crore</td></tr> <tr> <td>FIRR</td><td>EIRR</td></tr> <tr> <td>14.23%</td><td>16.17%</td></tr> </table> Yes 13thC.B: 300.23 Crore 15thC.B: 252.45 Crore Berth No. 14thC. B internal resources DPT: 138.28 Crore (Awarded cost berth & Back up area) Berth No. 16thC.B internal resources DPT: 149.56 Crore (awarded cost berth & backup area). "Environmental Services & Clearance of other related Expenditure" is Rs. 522 Lakhs from October 2024 to March 2025.	FIRR	EIRR	13.61%	14.62%	Berth No. 14 C.B.: 253 Crore		FIRR	EIRR	15.32%	17.42%	Berth No. 16 C.B.: 278 Crore		FIRR	EIRR	14.23%	16.17%
FIRR	EIRR																
13.61%	14.62%																
Berth No. 14 C.B.: 253 Crore																	
FIRR	EIRR																
15.32%	17.42%																
Berth No. 16 C.B.: 278 Crore																	
FIRR	EIRR																
14.23%	16.17%																
10. Forest land requirement a) The status of approval for diversion of forest land for non-forestry use b) The status of clear felling c) The status of compensatory afforestation, if any d) Comments on the viability & sustainability of compensatory	Nil Not Applicable. NIL A) Mangrove Plantation Plan carried out: 1) Year 2005-06 – 20 hectares 2) Year 2008-09 - 50 hectares 3) Year 2010-11 – 100 hectares 4) Year 2011-12 – 200 hectares 5) Year 2012-13 – 300 hectares 6) Year 2013 -14 – 330 hectares 7) Year 2015-17 - 300 hectares 8) Year 2018-19 - 50 hectares 9) Year 2019-20 – 50 Hectares 10) Year 2020-21– 100 Hectares 11) Year 2022-23- 100 Hectares 12) Year 2024-25- 50 Hectares Total - 1650 hectares As per the directions of the GCZMA and MoEF&CC,																

forestation programmed in the light of actual field experience so far	GoI, to date, DPA has undertaken a Mangrove Plantation in an area of 1650 Hectares since the year 2005. The final report by GUIDE, Bhuj, was submitted along with the compliance report submitted in November 2019. Subsequently, DPA awarded the work for monitoring the mangrove plantation to M/s GUIDE, Bhuj, via a work order dated 3/5/2021 (Period 2021-2022). M/s GUIDE, Bhuj submitted its final report for the said project in May 2022, and the copy has already been communicated with earlier compliance report submitted. Further DPA has assigned work to M/s GUIDE, Bhuj vide work order dated 10/06/2024 for "Monitoring of Mangrove Plantation 1600 Ha carried out by DPA" for the Period of 10/06/2024 to 09/06/2025. Further, DPA has appointed the Gujarat Institute of Desert Ecology (GUIDE) for "Green belt development in Deendayal Port Authority and its Surrounding Areas, Charcoal site' (Phase-I) (5000 plants)" vide Work Order No.EG/WK/4757/Part [Greenbelt GUIDE, dated 31st May 2022. The work is completed. Further, DPA assigned work to GUIDE, Bhuj, via a work order dated 23/06/2023 for "Green belt development in Deendayal Port Authority and its Surrounding Areas (Phase II) (10000 plants). The final report is submitting along with this compliance.
11. The status of clear felling in non-forest areas (such as submergence area of reservoir, approach roads), if any with quantitative information.	Nil
12. Status of construction a) Date of commencement (Actual and/or planned) b) Date of completion (Actual and/or planned)	All the 4 berths are under operation. 13th CB: Under operation since 18/02/2013. 15th CB: Under Operation since 16/11/2013. 14th CB: Under Operation since 08/04/2019. 16th CB: Under Operation since 10/03/2019.
13. Reasons for the delay if the Project is yet to start	All the 4 berths are under operation. 13th CB: Under operation since 18/02/2013. 15th CB: Under Operation since 16/11/2013.

	14 th CB: Under Operation since 08/04/2019. 16 th CB: Under Operation since 10/03/2019.
Date of site visited a) The dates on which the project was monitored by the regional office on pervious occasion. if any b) The date site visit for this monitoring report	29/12/2016 -----